

# INVERTEC™ V300-I

IM527-B


July, 1997

For use with machines having code number 10258, 10336 or 10450

## Safety Depends on You

Lincoln arc welding and cutting equipment is designed and built with safety in mind. However, your overall safety can be increased by proper installation ... and thoughtful operation on your part. **DO NOT INSTALL, OPERATE OR REPAIR THIS EQUIPMENT WITHOUT READING THIS MANUAL AND THE SAFETY PRECAUTIONS CONTAINED THROUGHOUT.** And, most importantly, think before you act and be careful.

This manual covers equipment which is obsolete and no longer in production by The Lincoln Electric Co. Specifications and availability of optional features may have changed.

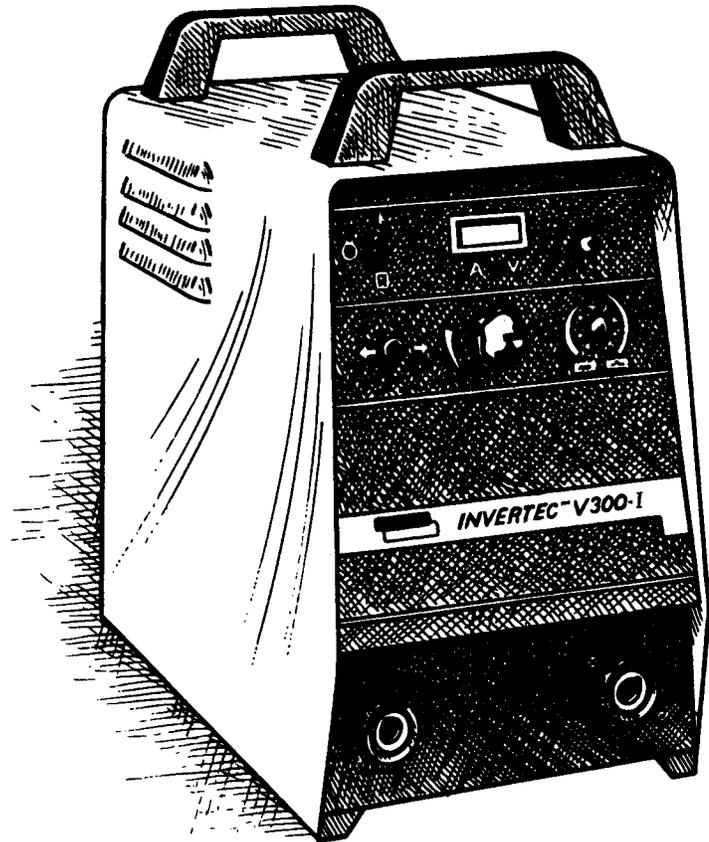

## OPERATOR'S MANUAL

World's Leader in Welding and Cutting Products

**LINCOLN**®  
**ELECTRIC**

Premier Manufacturer of Industrial Motors

Sales and Service through Subsidiaries and Distributors Worldwide  
22801 St. Clair Ave. Cleveland, Ohio 44117-1199 U.S.A. Tel. (216) 481-8100



## WARNING

**ARC WELDING can be hazardous.**

**PROTECT YOURSELF AND OTHERS FROM POSSIBLE SERIOUS INJURY OR DEATH. KEEP CHILDREN AWAY. PACEMAKER WEARERS SHOULD CONSULT WITH THEIR DOCTOR BEFORE OPERATING.**

Read and understand the following safety highlights. For additional safety information it is strongly recommended that you purchase a copy of "Safety in Welding & Cutting - ANSI Standard Z49.1" from the American Welding Society, P.O. Box 351040, Miami, Florida 33135 or CSA Standard W117.2-1974. A Free copy of "Arc Welding Safety" booklet E205 is available from the Lincoln Electric Company, 22801 St. Clair Avenue, Cleveland, Ohio 44117-1199.

**BE SURE THAT ALL INSTALLATION, OPERATION, MAINTENANCE, AND REPAIR PROCEDURES ARE PERFORMED ONLY BY QUALIFIED INDIVIDUALS.**



### ELECTRIC SHOCK can kill.

- 1.a. The electrode and work (or ground) circuits are electrically "hot" when the welder is on. Do not touch these "hot" parts with your bare skin or wet clothing. Wear dry, hole-free gloves to insulate hands.
- 1.b. Insulate yourself from work and ground using dry insulation. Make certain the insulation is large enough to cover your full area of physical contact with work and ground.  
  
**In addition to the normal safety precautions, if welding must be performed under electrically hazardous conditions (in damp locations or while wearing wet clothing; on metal structures such as floors, gratings or scaffolds; when in cramped positions such as sitting, kneeling or lying, if there is a high risk of unavoidable or accidental contact with the workpiece or ground) use the following equipment:**
  - Semiautomatic DC Constant Voltage (Wire) Welder.
  - DC Manual (Stick) Welder.
  - AC Welder with Reduced Voltage Control.
- 1.c. In semiautomatic or automatic wire welding, the electrode, electrode reel, welding head, nozzle or semiautomatic welding gun are also electrically "hot".
- 1.d. Always be sure the work cable makes a good electrical connection with the metal being welded. The connection should be as close as possible to the area being welded.
- 1.e. Ground the work or metal to be welded to a good electrical (earth) ground.
- 1.f. Maintain the electrode holder, work clamp, welding cable and welding machine in good, safe operating condition. Replace damaged insulation.
- 1.g. Never dip the electrode in water for cooling.
- 1.h. Never simultaneously touch electrically "hot" parts of electrode holders connected to two welders because voltage between the two can be the total of the open circuit voltage of both welders.
- 1.i. When working above floor level, use a safety belt to protect yourself from a fall should you get a shock.
- 1.j. Also see Items 4.c. and 6.



### ARC RAYS can burn.

- 2.a. Use a shield with the proper filter and cover plates to protect your eyes from sparks and the rays of the arc when welding or observing open arc welding. Headshield and filter lens should conform to ANSI Z87.1 standards.
- 2.b. Use suitable clothing made from durable flame-resistant material to protect your skin and that of your helpers from the arc rays.
- 2.c. Protect other nearby personnel with suitable non-flammable screening and/or warn them not to watch the arc nor expose themselves to the arc rays or to hot spatter or metal.



### FUMES AND GASES can be dangerous.

- 3.a. Welding may produce fumes and gases hazardous to health. Avoid breathing these fumes and gases. When welding, keep your head out of the fume. Use enough ventilation and/or exhaust at the arc to keep fumes and gases away from the breathing zone. **When welding with electrodes which require special ventilation such as stainless or hard facing (see instructions on container or MSDS) or on lead or cadmium plated steel and other metals or coatings which produce highly toxic fumes, keep exposure as low as possible and below Threshold Limit Values (TLV) using local exhaust or mechanical ventilation. In confined spaces or in some circumstances, outdoors, a respirator may be required. Additional precautions are also required when welding on galvanized steel.**
- 3.b. Do not weld in locations near chlorinated hydrocarbon vapors coming from degreasing, cleaning or spraying operations. The heat and rays of the arc can react with solvent vapors to form phosgene, a highly toxic gas, and other irritating products.
- 3.c. Shielding gases used for arc welding can displace air and cause injury or death. Always use enough ventilation, especially in confined areas, to insure breathing air is safe.
- 3.d. Read and understand the manufacturer's instructions for this equipment and the consumables to be used, including the material safety data sheet (MSDS) and follow your employer's safety practices. MSDS forms are available from your welding distributor or from the manufacturer.
- 3.e. Also see item 7b.




### WELDING SPARKS can cause fire or explosion.

- 4.a. Remove fire hazards from the welding area. If this is not possible, cover them to prevent the welding sparks from starting a fire. Remember that welding sparks and hot materials from welding can easily go through small cracks and openings to adjacent areas. Avoid welding near hydraulic lines. Have a fire extinguisher readily available.
- 4.b. Where compressed gases are to be used at the job site, special precautions should be used to prevent hazardous situations. Refer to "Safety in Welding and Cutting" (ANSI Standard Z49.1) and the operating information for the equipment being used.
- 4.c. When not welding, make certain no part of the electrode circuit is touching the work or ground. Accidental contact can cause overheating and create a fire hazard.
- 4.d. Do not heat, cut or weld tanks, drums or containers until the proper steps have been taken to insure that such procedures will not cause flammable or toxic vapors from substances inside. They can cause an explosion even though they have been "cleaned." For information purchase "Recommended Safe Practices for the Preparation for Welding and Cutting of Containers and Piping That Have Held Hazardous Substances", AWS F4.1 from the American Welding Society (see address above).
- 4.e. Vent hollow castings or containers before heating, cutting or welding. They may explode.

4.f. Sparks and spatter are thrown from the welding arc. Wear oil free protective garments such as leather gloves, heavy shirt, cuffless trousers, high shoes and a cap over your hair. Wear ear plugs when welding out of position or in confined places. Always wear safety glasses with side shields when in a welding area.

4.g. Connect the work cable to the work as close to the welding area as practical. Work cables connected to the building framework or other locations away from the welding area increase the possibility of the welding current passing through lifting chains, crane cables or other alternate circuits. This can create fire hazards or overheat lifting chains or cables until they fail.

4.h. Also see item 7c.

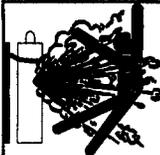

## CYLINDER may explode if damaged.

5.a. Use only compressed gas cylinders containing the correct shielding gas for the process used and properly operating regulators designed for the gas and pressure used. All hoses, fittings, etc. should be suitable for the application and maintained in good condition.

5.b. Always keep cylinders in an upright position securely chained to an undercarriage or fixed support.

5.c. Cylinders should be located:

- Away from areas where they may be struck or subjected to physical damage.
- A safe distance from arc welding or cutting operations and any other source of heat, sparks, or flame.

5.d. Never allow the electrode, electrode holder or any other electrically "hot" parts to touch a cylinder.

5.e. Keep your head and face away from the cylinder valve outlet when opening the cylinder valve.

5.f. Valve protection caps should always be in place and hand tight except when the cylinder is in use or connected for use.

5.g. Read and follow the instructions on compressed gas cylinders, associated equipment, and CGA publication P-1, "Precautions for Safe Handling of Compressed Gases in Cylinders," available from the Compressed Gas Association 1235 Jefferson Davis Highway, Arlington, VA 22202.



## FOR ELECTRICALLY powered equipment.

6.a. Turn off input power using the disconnect switch at the fuse box before working on the equipment.

6.b. Install equipment in accordance with the U.S. National Electrical Code, all local codes and the manufacturer's recommendations.

6.c. Ground the equipment in accordance with the U.S. National Electrical Code and the manufacturer's recommendations.



## FOR ENGINE powered equipment.

7.a. Turn the engine off before troubleshooting and maintenance work unless the maintenance work requires it to be running.



7.b. Operate engines in open, well-ventilated areas or vent the engine exhaust fumes outdoors.



7.c. Do not add the fuel near an open flame welding arc or when the engine is running. Stop the engine and allow it to cool before refueling to prevent spilled fuel from vaporizing on contact with hot engine parts and igniting. Do not spill fuel when filling tank. If fuel is spilled, wipe it up and do not start engine until fumes have been eliminated.



7.d. Keep all equipment safety guards, covers and devices in position and in good repair. Keep hands, hair, clothing and tools away from V-belts, gears, fans and all other moving parts when starting, operating or repairing equipment.

7.e. In some cases it may be necessary to remove safety guards to perform required maintenance. Remove guards only when necessary and replace them when the maintenance requiring their removal is complete. Always use the greatest care when working near moving parts.

7.f. Do not put your hands near the engine fan. Do not attempt to override the governor or idler by pushing on the throttle control rods while the engine is running.

7.g. To prevent accidentally starting gasoline engines while turning the engine or welding generator during maintenance work, disconnect the spark plug wires, distributor cap or magneto wire as appropriate.



7.h. To avoid scalding, do not remove the radiator pressure cap when the engine is hot.



## ELECTRIC AND MAGNETIC FIELDS may be dangerous

8.a. Electric current flowing through any conductor causes localized Electric and Magnetic Fields (EMF). Welding current creates EMF fields around welding cables and welding machines.

8.b. EMF fields may interfere with some pacemakers, and welders having a pacemaker should consult their physician before welding.

8.c. Exposure to EMF fields in welding may have other health effects which are now not known.

8.d. All welders should use the following procedures in order to minimize exposure to EMF fields from the welding circuit:

8.d.1. Route the electrode and work cables together - Secure them with tape when possible.

8.d.2. Never coil the electrode lead around your body.

8.d.3. Do not place your body between the electrode and work cables. If the electrode cable is on your right side, the work cable should also be on your right side.

8.d.4. Connect the work cable to the workpiece as close as possible to the area being welded.

8.d.5. Do not work next to welding power source.

## PRÉCAUTIONS DE SÛRETÉ

Pour votre propre protection lire et observer toutes les instructions et les précautions de sûreté spécifiques qui paraissent dans ce manuel aussi bien que les précautions de sûreté générales suivantes:

### Sûreté Pour Soudage A L'Arc

1. Protégez-vous contre la secousse électrique:
  - a. Les circuits à l'électrode et à la pièce sont sous tension quand la machine à souder est en marche. Eviter toujours tout contact entre les parties sous tension et la peau nue ou les vêtements mouillés. Porter des gants secs et sans trous pour isoler les mains.
  - b. Faire très attention de bien s'isoler de la masse quand on soude dans des endroits humides, ou sur un plancher métallique ou des grilles métalliques, principalement dans les positions assis ou couché pour lesquelles une grande partie du corps peut être en contact avec la masse.
  - c. Maintenir le porte-électrode, la pince de masse, le câble de soudage et la machine à souder en bon et sûr état de fonctionnement.
  - d. Ne jamais plonger le porte-électrode dans l'eau pour le refroidir.
  - e. Ne jamais toucher simultanément les parties sous tension des porte-électrodes connectés à deux machines à souder parce que la tension entre les deux pinces peut être le total de la tension à vide des deux machines.
  - f. Si on utilise la machine à souder comme une source de courant pour soudage semi-automatique, ces précautions pour le porte-électrode s'appliquent aussi au pistolet de soudage.
2. Dans le cas de travail au dessus du niveau du sol, se protéger contre les chutes dans le cas où on recoit un choc. Ne jamais enrrouler le câble-électrode autour de n'importe quelle partie du corps.
3. Un coup d'arc peut être plus sévère qu'un coup de soleil, donc:
  - a. Utiliser un bon masque avec un verre filtrant approprié ainsi qu'un verre blanc afin de se protéger les yeux du rayonnement de l'arc et des projections quand on soude ou quand on regarde l'arc.
  - b. Porter des vêtements convenables afin de protéger la peau de soudeur et des aides contre le rayonnement de l'arc.
  - c. Protéger l'autre personnel travaillant à proximité au soudage à l'aide d'écrans appropriés et non-inflammables.
4. Des gouttes de laitier en fusion sont émises de l'arc de soudage. Se protéger avec des vêtements de protection libres de l'huile, tels que les gants en cuir, chemise épaisse, pantalons sans revers, et chaussures montantes.
5. Toujours porter des lunettes de sécurité dans la zone de soudage. Utiliser des lunettes avec écrans latéraux dans les

zones où l'on pique le laitier.

6. Eloigner les matériaux inflammables ou les recouvrir afin de prévenir tout risque d'incendie dû aux étincelles.
7. Quand on ne soude pas, poser la pince à un endroit isolé de la masse. Un court-circuit accidentel peut provoquer un échauffement et un risque d'incendie.
8. S'assurer que la masse est connectée le plus près possible de la zone de travail qu'il est pratique de le faire. Si on place la masse sur la charpente de la construction ou d'autres endroits éloignés de la zone de travail, on augmente le risque de voir passer le courant de soudage par les chaînes de levage, câbles de grue, ou autres circuits. Cela peut provoquer des risques d'incendie ou d'échauffement des chaînes et des câbles jusqu'à ce qu'ils se rompent.
9. Assurer une ventilation suffisante dans la zone de soudage. Ceci est particulièrement important pour le soudage de tôles galvanisées plombées, ou cadmiées ou tout autre métal qui produit des fumées toxiques.
10. Ne pas souder en présence de vapeurs de chlore provenant d'opérations de dégraissage, nettoyage ou pistolage. La chaleur ou les rayons de l'arc peuvent réagir avec les vapeurs du solvant pour produire du phosgène (gas fortement toxique) ou autres produits irritants.
11. Pour obtenir de plus amples renseignements sur la sûreté, voir le code "Code for safety in welding and cutting" CSA Standard W 117.2-1974.

## PRÉCAUTIONS DE SÛRETÉ POUR LES MACHINES À SOUDER À TRANSFORMATEUR ET À REDRESSEUR

1. Relier à la terre le châssis du poste conformément au code de l'électricité et aux recommandations du fabricant. Le dispositif de montage ou la pièce à souder doit être branché à une bonne mise à la terre.
2. Autant que possible, l'installation et l'entretien du poste seront effectués par un électricien qualifié.
3. Avant de faire des travaux à l'intérieur de poste, la débrancher à l'interrupteur à la boîte de fusibles.
4. Garder tous les couvercles et dispositifs de sûreté à leur place.

# TABLE OF CONTENTS

	Page
Safety Precautions .....	2-4
Introductory Information .....	6
Product Description.....	7
Specifications.....	7
Installation .....	7-10
Safety Precautions .....	7
Location .....	7
Electrical Installation.....	7
Input Voltage Setup .....	8
Power Cord Connection .....	8
Connection of Wire Feeders to Invertec .....	8-10
Output Cables & Plugs .....	10
Operating Instructions .....	11-13
Safety Precautions .....	11
Controls Description and Function.....	11-13
Maintenance.....	13-14
Capacitor Discharge Procedure .....	13
Routine Maintenance.....	13
Periodic Maintenance .....	14
Troubleshooting Guide .....	14-20
Matched Parts.....	20
Switch P.C. Board Replacement Procedure .....	20
Replacement of Power Modules and Output Diodes .....	20-21
Connection Diagrams.....	22-31
Wiring Diagrams .....	32-33
Parts Lists .....	appendix

# Thank You

for selecting a **QUALITY** product by Lincoln Electric. We want you to take pride in operating this Lincoln Electric Company product  
••• as much pride as we have in bringing this product to you!

### **Please Examine Carton and Equipment For Damage Immediately**

When this equipment is shipped, title passes to the purchaser upon receipt by the carrier. Consequently, Claims for material damaged in shipment must be made by the purchaser against the transportation company at the time the shipment is received.

Please record your equipment identification information below for future reference. This information can be found on your machine nameplate.

Model Name & Number \_\_\_\_\_

Code & Serial Number \_\_\_\_\_

Date of Purchase \_\_\_\_\_

Whenever you request replacement parts for or information on this equipment always supply the information you have recorded above.

**Read this Operators Manual completely** before attempting to use this equipment. Save this manual and keep it handy for quick reference. Pay particular attention to the safety instructions we have provided for your protection. The level of seriousness to be applied to each is explained below:

### **⚠ WARNING**

This statement appears where the information **must** be followed **exactly** to avoid **serious personal injury** or **loss of life**.

### **⚠ CAUTION**

This statement appears where the information **must** be followed to avoid **minor personal injury** or **damage to this equipment**.

## PRODUCT DESCRIPTION

The Invertec V300-I is a 300 amp arc welding power source that utilizes single or three phase input power to produce either constant voltage or constant current outputs. The V300-I is designed for 50/60 Hz supply systems. The welding response of the Invertec has been optimized for GMAW, SMAW, TIG and FCAW processes. It is designed to be used with the LN-25 and LN-7 semiautomatic wire feeders.

## SPECIFICATIONS

Product Name	Ordering Information	Input AC Voltage	Rated DC Output Amps/Volts/Duty Cycle	Input Amps at Rated DC Output				Output Range (continuous)	Weight with Gun (net)	Dimensions HxWxD
				200	220	380 - 415	440			
Invertec V300-I	K1363-8 or K1363-9	200/220/380-415/440	300A / 32V / 60% <sup>(1)</sup>	43	39	25	22	AMPS 5-350	64 lbs. (29 kg)	18.7"x10.8x 22.2" (475x274x 564 mm) * Includes handle
		3Ø 50/60 Hz	250A / 30V / 100% <sup>(1)</sup>	34	31	20	18			
			300A / 35/37/33-36/38V / 60%	48	45	26	24			
		200/220/380-415/440	200A / 28V / 60% <sup>(1)</sup>	53	47	32	29			
		1Ø 50/60 Hz	165A / 26.5V / 100%	42	39	25	22			
			200A / 39/41/37-40/42V / 60% <sup>(2)</sup>	69	62	42	38			

<sup>(1)</sup>NEMA Class I Rated Output / Based on a 10 min. Period.

<sup>(2)</sup>Lincoln plus rating.

\* Overall Height Including Handle, (16.4" (417mm without handle).

## INSTALLATION

### ⚠ WARNING



**ELECTRIC SHOCK** can kill.

- Have an electrician install and service this equipment.
- Turn the input power off at the fuse box before working on equipment.
- Do not touch electrically hot parts.

### LOCATION

The Invertec has been designed with many features to protect it from harsh environments. Even so, it is important that simple preventative measures are followed in order to assure long life and reliable operation.

- The machine must be located where there is free circulation of clean air such that air movement into the sides and out the bottom and front will not be restricted. Dirt and dust that can be drawn into the machine should be kept to a minimum. Failure to observe these precautions can result in excessive operating temperatures and nuisance shutdown of the Invertec.
- Keep machine dry. Shelter from rain and snow. Do not place on wet ground or in puddles.

## ELECTRICAL INSTALLATION

1. The Invertec should be connected only by a qualified electrician. Installation should be made in accordance with the U.S. National Electrical Code, all local codes and the information detailed below.
2. Single voltage, 575 VAC machines, can only be connected to 575 VAC. No internal reconnection for other input voltages is possible.
3. Initial 208 VAC and 230 VAC operation will require a voltage panel setup, as will later reconnection back to 460 VAC:
  - a. Open the access panel on the right side of the machine.
  - b. For 208 or 230: Position the large switch to 200-230.  
For 460: Position the large switch to 380-460.
  - c. Move the "A" lead to the appropriate terminal.

## INPUT VOLTAGE SETUP

### **⚠ CAUTION**

#### **DO NOT ATTEMPT TO POWER THIS UNIT FROM THE AUXILIARY POWER SUPPLY OF AN ENGINE WELDER.**

- Special protection circuits may operate, causing loss of output.
- The supply from engine welders often has excessive voltage peaks because the voltage waveform is usually triangular shaped instead of sinusoidal.
- If voltage peaks from the engine welder exceed 380V, the input circuits of this machine protecting the filter capacitors, FETS and other components from damage will not be energized .

## Recommended Fuse Sizes Based On The U.S. National Electrical Code And Maximum Machine Outputs

	Input Volts <sup>(1)</sup>	Fuse Size in Amps (Time Delay Fuses)
3 phase 50/60 Hz	200	60
	220	60
	380-415	35
	440	35
1 phase 50/60 Hz	200	80
	220	70
	380-415	50
	440	50

<sup>(1)</sup> Input voltage must be within  $\pm 10\%$  of rated value.

RECONNECT PROCEDURE	<b>⚠ WARNING</b>
<p>1. BE SURE POWER SWITCH IS OFF.</p> <p>2. CONNECT LEAD 'A' TO DESIRED INPUT VOLTAGE RANGE.</p> <p>440-460V </p> <p>380-415V </p> <p>220-230V </p> <p>200-208V </p> <p>3. POSITION SWITCH TO DESIRED INPUT VOLTAGE RANGE.</p> <p> VOLTAGE=380-460V</p> <p> VOLTAGE=200-230V</p>	<p> <b>ELECTRIC SHOCK CAN KILL!</b></p> <ul style="list-style-type: none"> <li>• Disconnect input power before inspecting or servicing machine.</li> <li>• Do not operate with wraparound removed.</li> <li>• Do not touch electrically live parts.</li> <li>• Only qualified persons should install, use or service this equipment.</li> </ul> <p>IF MACHINE CEASES TO OPERATE (NO METER, NO FAN) AND THERE IS NO OTHER KNOWN FAILURE: CHECK FUSE; REPLACE WITH A 3 AMP SLOW BLOW ONLY.</p>
<p>THE LINCOLN ELECTRIC CO. CLEVELAND, OHIO U.S.A. 9-11-92 <b>S20324</b></p>	

### POWER INPUT CONNECTION

Connect terminal marked to earth ground per any existing local or national electrical codes.

#### Single Phase Input

Connect the supply lines to the upper and lower terminals of the line switch. Torque to 3.0 Nm. Do not use center terminal of the line switch.

#### Three Phase Input

Connect the supply lines to the line switch. Torque to 3.0 Nm.

Install in accordance with all local and national electric codes.

### CONNECTION OF WIRE FEEDERS TO THE INVERTEC

(Note: IEC units do not have 110 VAC auxiliary power).

#### LN-25 Connection Instructions

1. Turn the Invertec power switch "off".
2. Connect the electrode cable to the output terminal of polarity required by electrode. Connect the work lead to the other terminal.
3. LN-25 with remote control options K431 and K432. Use K876 adapter with K432 cable or modify K432 cable with K867 universal adapter plug. See connection diagram S19899 and S19309 or S19405 at the back of this manual.
4. Place the local-remote switch in the "remote" position if output control is desired at the wire feeder rather than the Invertec. (LN-25 must have K431 and K432 options for remote output control operation).

#### LN-7 Connection Instructions (not applicable to machines with 42V Aux.)

1. Turn the Invertec power switch "off".
2. Connect the K480 control cable from the LN-7 to the Invertec control cable connector. The control cable connector is located at the rear of the Invertec.
3. Connect the electrode cable to the output terminal of polarity required by electrode. Connect the work lead to the other terminal.
4. Place the local-remote switch in the "local" position to allow output control at the Invertec. (K864

remote control adapter and K857 remote control are required for remote output control).

5. Set the meter polarity switch on the rear of the Invertec to coincide with wire feeder polarity used. The wire feeder will now display the welding voltage.
6. If K480 is not available, see connection diagram S19404 for modification of K291 or K404 LN-7 input cable with K867 universal adapter plug.

### **General Instructions for Connection of Wire Feeders to Invertec**

Wire feeders other than LN-7 and LN-25 may be used provided that the auxiliary power supply capacity of the Invertec is not exceeded. K867 universal adapter plug is required. See connection diagram S19406 and S19386 at the back of this manual for more information.

### **Remote Control of Invertec**

Remote control K857, hand amptrol K963 and foot amptrol K870 require K864 remote control adapter. See 19309 instruction at the back of this manual for connection information.

### **K954-1 MIG PULSER**

The MIG Pulser is a hand-held "pendant" type GMAW Pulsing option for the V300 Power Source. Refer to the Mig Pulser's IM manual (IM555) for connection information.

### **Parallel Operation**

The Invertec's are operable in parallel in both CC and CV modes. For best results, the currents of each machine should be reasonably well shared. As an example, with two machines set up in parallel for a 400 amp procedure, each machine should be set to deliver approximately 200 amps, not 300 amps from one and 100 amps from the other. This will minimize nuisance shutdown conditions. In general, more than two machines in parallel will not be effective due to the voltage requirements of procedures in that power range.

To set machine outputs, start with output control pots and arc force/pinch pots in identical positions. If running in a CC mode, adjust outputs and arc forces to maintain current sharing while establishing the proper output current. In CV modes, the pots in identical positions. Then switch the machine meters to amps and adjust one of the output control pots for current balance. Check the voltage and if readjustment is necessary, repeat the current balancing step. Pinch settings should also be kept identical on the machines.

### **K900-1 DC TIG Starter Connection**

This versatile new kit was made to mate with the Invertec.

A control cable assembly is supplied with the kit to connect the kit to an Invertec. The cable can be connected, either end, at the DC TIG Starter kit and at the Invertec by attaching to the 14-pin Amphenols on the backs of each unit. Refer to diagram S20405 at the back of this manual.

A negative output cable assembly is also supplied with the DC TIG Starter kit to connect the kit with the Invertec's negative output terminal.

All Magnum™ one and two piece water-cooled torches with 7/8 left-hand threads and gas-cooled torches with 7/8 and 5/16 right-hand threads can be connected to the starter kit.

To secure the DC TIG Starter kit to the bottom of the Invertec and for more detailed instructions, refer to the K900-1 manual.

**LN-9 GMA Connection Instructions (Not applicable to machines with 42V Aux.)**

1. Turn the Invertec power switch "off".
2. Connect the K596 control cable assembly from the LN-9 GMA to the Invertec control cable connector. The control cable connector is located at the rear of the Invertec.
3. Connect the electrode cable to the output terminal of polarity required by electrode. Connect the work lead to the other terminal.
4. Place the local-remote switch in the "remote" position to allow output control at the LN-9 GMA.
5. Set the meter polarity switch on the rear of the Invertec to coincide with wire feeder polarity used. The wire feeder will now display the welding voltage.
6. K608-1 adapter is required in LN-9 GMA for LN-9 type control. K608-1 is installed in line with P10 connection at the LN-9 GMA voltage board. See diagram S20607 at the back of this manual.
7. K442-1 Pulse Power Filter Board is also required for GMAW, but should be disconnected for FCAW.
8. If K596 is not available, see connection diagram S20608 at the back of this manual for modification of K196 LN-9 GMA input cable with K867 universal adapter plug.

**Output Cables**

Select the output cable size based upon the following chart.

Cable sizes for Combined Length of Electrode and Work Cable (Copper) 75° rated:


Duty Cycle	Current	Length Up 61m (200 ft.)	61-76m (200-250 ft.)
100%	250	1/0	1/0
60%	300	1/0	2/0

**Quick Disconnect Plugs**


A quick disconnect system is used for the welding cable connections. The welding plug included with the machine is designed to accept a welding cable size of 1/0 to 2/0.

1. Remote 25mm (1 in.) of welding cable insulation.

2. Slide rubber boot onto cable end. The boot end may be trimmed to match the cable diameter. Soap or other lubricant will help to slide the boot over the cable.

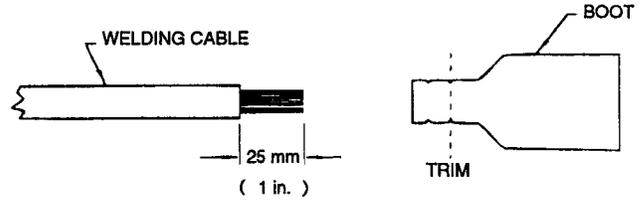

3. Slide the copper tube into the brass plug.
4. Insert cable into copper tube.

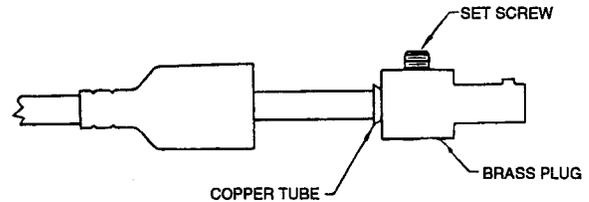

5. Tighten set screw to collapse copper tube. Screw must apply pressure against welding cable. The top of the set screw will be well below the surface of the brass plug after tightening.
6. Slide rubber boot over brass plug. The rubber boot must be positioned to completely cover all electrical surfaces after the plug is locked into the receptacle.

# OPERATING INSTRUCTIONS

## ⚠ WARNING



### ELECTRIC SHOCK can kill.

- Do not touch electrically live parts or electrode with skin or wet clothing.
- Insulate yourself from work and ground.
- Always wear dry insulating gloves.



### FUMES AND GASES can be dangerous.

- Keep your head out of fumes.
- Use ventilation or exhaust to remove fumes from breathing zone.



### WELDING SPARKS can cause fire or explosion.

- Keep flammable material away.
- Do not weld on closed containers.



### ARC RAYS can burn eyes and skin.

- Wear eye, ear and body protection.

 
See additional warning information at front of this operator's manual.

## DUTY CYCLE

The Inverter is rated at 300 amps, 60% duty cycle for 3 phase inputs (based on a 10 minute cycle). It is also rated at 250 amps, 100% duty cycle.


## CONTROL FUNCTION / OPERATION

**Power Switch** - Place the lever in the "ON" position to energize the machine. When the power is on, the digital meter will activate and the fan will operate.



**Output Control** - This controls the output voltage in the CV modes and output current in the CC modes.

Control is provided over the entire output range of the power source with 1 turn of the control knob. This control may be adjusted while under load to change power source output.

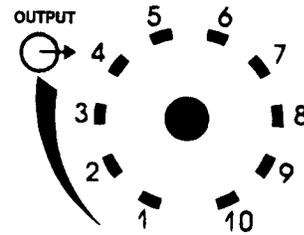

**Local/Remote Switch** - Place in the "LOCAL" position to allow output adjustment at the machine. Place in the "REMOTE" position to allow output adjustment at the wire feeder or with a remote control option package.

REMOTE



**Digital Meter Switch** - Select either "A" for amps or "V" for volts to display welding current or voltage on the meter.

When welding current is not present, the meter will display the set current for the CC modes or the set voltage for the CV modes. This set reading is an indication of machine control setting. For a more precise process reading, read meter during actual welding.



## Mode Switch


**GTAW** Optimized for both scratch start and Hi-Freq kit use.

**CC SOFT** Best for EXX18 thru EXX28 stick electrodes.

**CC Crisp** Use this mode for stick welding with EXX10 thru EXX14 electrodes. Non-welding applications such as resistive heating or output tests with resistive loads should be done in this mode with Arc Force Control set to minimum.

**CV FCAW** This setting has been optimized for Innershield® and Outershield® flux-cored electrodes.


**CV GMAW** Short circuit, glob and spray transfer solid wire and gas welding are done in this mode. Low end procedures, less than 16V, may operate better in the FCAW mode.

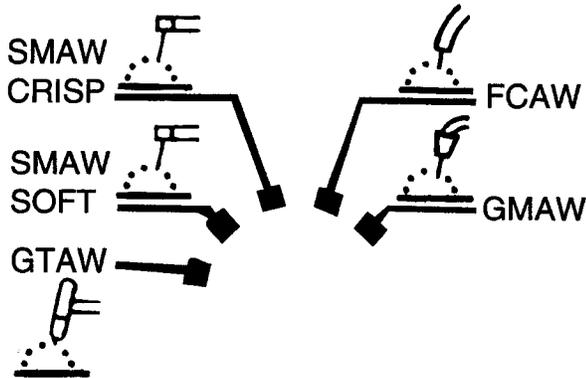

**Output Terminals Switch**

For processes and equipment that require energized machine terminals (stick, TIG, air-carbon arc cutting or hot tip LN-25), set the Output Terminals Switch to "ON" position.


Set to the REMOTE (OFF) position when using LN-25 with K431 and K432 options or LN-7 which will allow the gun trigger to energize the welding terminals.

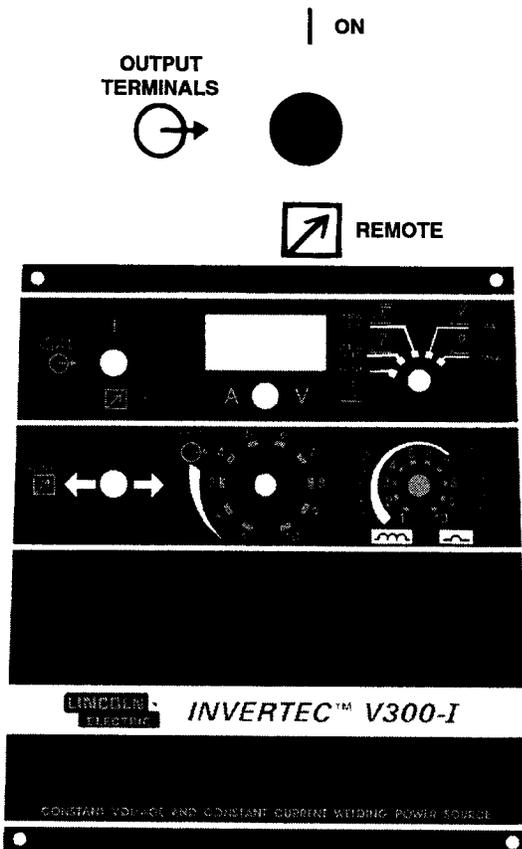

**Arc Force / Inductance Control**

This control functions in all modes except GTAW. For CC modes, this control acts as an Arc Force adjustment. The arc is soft at the minimum settings and more forceful or driving at the maximum settings. Higher spatter levels may be present at the maximum settings.

For CV modes, this control will set the degree of "pinch effect" which predominantly affects short circuit transfer. In FCAW, the maximum setting is generally preferred. With GMAW, the upper half of the range is preferred with CO<sub>2</sub> or high content CO<sub>2</sub> mixed. The lower half is for inert gas mixes.

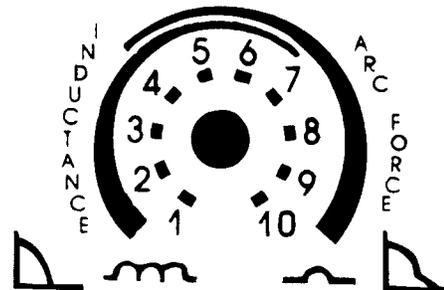

**Recommended Arc Force / Inductance Settings For Selected Applications**


**Full Range Is 1-10,  
1 Is Very Soft, 10 Is Very Crisp**

Mode	Process	Nominal Setting	Recommended Adjustment Range
CC SMAW 1	EXX18 thru EXX28 stick	5	1 (gentle, may stick) to 9 (forceful, more spatter)
CC SMAW 2	EXX10 thru EXX14 stick	6	3 to 10
	Air Carbon Arc Cutting	1	None
CV FCAW	Innershield or Outershield	10	None
	Air Carbon Arc Cutting	1	None
CV GMAW*	CO <sub>2</sub> or 25% CO <sub>2</sub> or similar gas mixes	7.5	5 to 10
	98% Ar-2% O <sub>2</sub> Ar, 90% He-7.5% Ar 2.5% CO <sub>2</sub> and other predominantly inert gases	5	1 to 10

\* 1 = Lowest pinch, highest inductance and least spatter.  
10 = Highest pinch, lowest inductance and most spatter.

## Meter Polarity Switch

The wire feeder polarity switch is located at the rear of the machine. The switch provides a work connection for wire feeder voltmeters. Place the switch in the position of the electrode polarity indicated by the decal. The switch does not change the welding polarity.

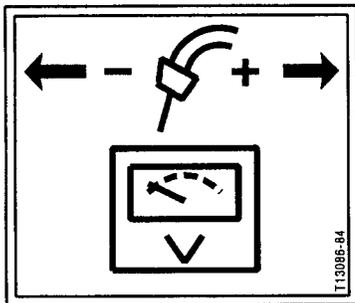

## Auxiliary Power

A 24 VAC @ 1 amp supply is included for use with the LN-25 wire feeder (24 volts needed for K431 and K432 options). This supply is protected by a self-resetting current limiter.

A 42 VAC @ 5.5 amp supply is included for use with other wire feeders. This supply is protected by a 6 amp breaker located on the rear of the machine.

A 110/115 VAC @ 2 amp supply is included for use with the LN-7 or LN-9 GMA wire feeders. This supply is protected by a 2.5 amp breaker located on the rear of the machine. It is **NOT** available on IEC units.

All three supplies are not to be loaded simultaneously.

## MAINTENANCE

### ⚠ WARNING



**ELECTRIC SHOCK** can kill.

- Have an electrician install and service this equipment.
- Turn the input power off at the fuse box before working on equipment.
- Do not touch electrically hot parts.




**EXPLODING PARTS** can cause injury.

- Failed parts can explode or cause other parts to explode when power is applied.
- Always wear a face shield and long sleeves when servicing.

## Capacitor Discharge Procedure

1. Obtain a power resistor (25 ohms, 25 watts).
2. Hold resistor body with electrically insulated glove. **DO NOT TOUCH TERMINALS.** Connect the resistor terminals across the two hex head cap screws in the position shown. Hold in each position for 1 second. For 575 VAC only, repeat for second capacitor. Repeat for the capacitor(s) on the other side of the machine

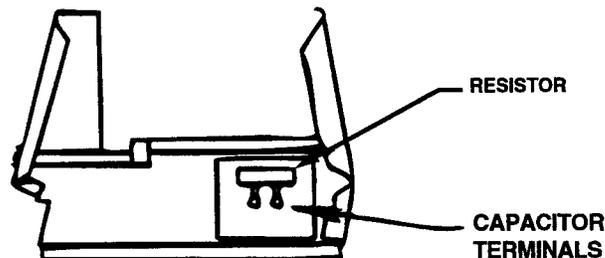

3. Use a DC voltmeter to check that voltage is not present across either capacitor.

## Routine Maintenance

1. Every 6 months or so the machine should be cleaned with a low pressure airstream. Keeping the machine clean will result in cooler operation and higher reliability. Be sure to clean these areas:
  - Power, switch, driver, protection and control printed circuit boards.
  - Power switch
  - Main transformer
  - Input rectifier (located in front of fan blade)
  - Heat sink fins
2. Examine the sheet metal case for dents or breakage. Repair the case as required. Keep the case in good condition to insure that high voltage parts are protected and correct spacings are maintained. All external sheet metal screws must be in place to insure case strength and electrical ground continuity.

## PERIODIC MAINTENANCE

### Overload Protection

The machine is electrically protected from producing high output currents. Should the output current exceed 340-360A, an electronic protection circuit will reduce the current to approximately 150A. The machine will continue to produce this low current until the protection circuit is reset. Reset occurs when the output load is removed.

### Thermal Protection

Thermostats protect the machine from excessive operating temperatures. Excessive temperatures may be caused by a lack of cooling air or operating the machine beyond the duty cycle and output rating. If excessive operating temperature should occur, the thermostat will prevent output voltage or current. The meter will remain energized during this time.

Thermostats are self-resetting once the machine cools sufficiently. If the thermostat shutdown was caused by excessive output or duty cycle and the fan is operating normally, the Power Switch may be left on and the reset should occur within a 15 minute period. If the fan is not turning or the air intake louvers were obstructed, then the power must be switched off for 15 minutes in order to reset. The fan problem or air obstruction must also be corrected.

### Filter Capacitor Conditioning

A protection circuit is included to monitor the voltage across filter capacitors C1 and C2 (also C14 and C15 on 575 VAC units). In the event that the capacitor voltage is too high, the protection circuit will prevent output. The protection circuit may prevent output providing all these circumstances are met:

1. Machine is internally connected for 380 VAC, or higher input voltage.
2. Machine did not have power applied for many months.
3. Machine did not produce output when power was first switched on.

If these circumstances apply, the proper action is to switch the machine on and let it idle for up to 30 minutes. This is required to condition the filter capacitors after an extended storage time. The protection circuit will automatically reset once the capacitor conditioning and resultant voltage levels are acceptable. It may be necessary to turn the power switch off and back on again after this period.

## TROUBLESHOOTING

### ⚠ WARNING



**ELECTRIC SHOCK** can kill.

- Have an electrician install and service this equipment.
- Turn the input power off at the fuse box before working on equipment.
- Do not touch electrically hot parts.



**EXPLODING PARTS** can cause injury.

- Failed parts can explode or cause other parts to explode when power is applied.
- Always wear a face shield and long sleeves when servicing.

### Visual Inspection

Clean interior of machine with a low pressure airstream. Make a thorough inspection of all components. Look for signs of overheating, broken leads or other obvious problems. Many problems can be uncovered with a good visual inspection.

### Open Circuit Voltage

The open circuit voltage of the Invertec V300-I is 60 to 75 VDC and cannot be adjusted by the output control.

### Test Conditions

Perform all testing at the lowest input voltage available, except where a higher voltage is required by a test step. Make ohmmeter checks only after power has been disconnected from machine and after capacitors have been discharged.

Certain high voltage connections have been insulated with RTV sealant. It is necessary to break through the sealant with a sharp probe in order to make voltage or resistance checks.

Disconnect any control cables from remote control receptacle.

## TROUBLESHOOTING GUIDE

Trouble	What To Do
Not output but fan operates and meter is on.	Perform test steps 1A and 1B.
Poor welding, weld settings drift, or output power is low.	<ol style="list-style-type: none"> <li>1. Check front panel wiring and controls.</li> <li>2. Replace Control PC Board.</li> </ol>
Main fuses open or Switch PC boards overheated.	Perform test steps 4 and 5 for both Switch PC Boards and 7.
Output turns on momentarily then switches off and repeats. Machine is connected for 380 VAC or higher input voltage.	Perform test steps 3B, 4 and 5.
OCV is normal (approx. 65-75V) but output power is low (less than 20V and 100A). Machine makes squealing noise while under load. Machine is connected for 230 VAC, or lower, input voltage.	Perform test steps 4 and 5 for both Switch PC Boards.
Open circuit voltage is 1-2 volts.	Perform test step 6.
Output control not functioning on remote control. Local control OK.	<ol style="list-style-type: none"> <li>1. Check remote control assembly.</li> <li>2. Check S3, Local/Remote switch.</li> </ol>
Machine does not produce more than 250A output when connected to 3 phase supply.	<ol style="list-style-type: none"> <li>1. Replace main fuse if blown.</li> <li>2. Replace Protection PC Board.</li> <li>3. Replace Control PC Board.</li> <li>4. Perform test step 7.</li> </ol>
Machine does not produce more than 200 A output while connected to 1 phase supply.	Normal operation.
Machine operates OK at 230 VAC or lower. No output at 380 VAC or higher.	Perform test step 2.
Poor EXX10 stick electrode (5P) performance. Arc "pops out".	Check D6 and D12, L1 and L2.
No output or reduced output the first time power is applied to the machine.	Check reconnect panel - connections and fuse.

### CAUTION

If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact your local Authorized Field Service Facility for technical troubleshooting assistance before you proceed.

## TEST PROCEDURES

Step	Test	Check	Test Result	Conclusion	Next Test Step	Repair Action
1A	Output pilot circuit (set S4 on)	223A to 210	24 VAC	Fan thermostat, choke thermostat, T1 transformer and S4 all OK.	1B	
			0 VAC	Check above components.		
1B		302 (pos) to 275D (neg)	15 VDC	T1 and 15V power supply OK.	2	
			0 VDC	Check T1 and Power PC Board.		
2	Protection PC board output (set S4 on)	313 (neg) to 311 (pos)	<1 VDC	Protection PC Board OK		Replace Power and Control PC Boards
			>5 VDC		3A	
3A	Static capacitor balance (set S4 off)  380 VAC input and higher test	Compare voltage across terminals 9 & 12 of each Switch PC Board. 575 VAC -- 407 VDC 460 VAC -- 325 VDC 440 VAC -- 311 VDC 415 VAC -- 293 VDC 380 VAC -- 269 VDC 575 VAC only - compare voltage across 9A & 13 and 13 & 12A; then, 9B & 15 and 15 & 12B	<25 VDC difference between readings	C1, C2, R1, R9 - OK (575 VAC machine C14, C15 - OK)	3B	Replace Protection PC Board
			>25 VDC difference	Check above components.		
3B	Dynamic capacitor balance (set S4 on)  380 VAC input and higher test	Connect as in step 3A. Same voltages as above.	<25 VDC	OK		
			>25 VDC	Power PC Board or Switch PC Boards are damaged.	4 and 5	

### CAUTION

If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact your local Authorized Field Service Facility for technical troubleshooting assistance before you proceed.

Step	Test	Check	Test Result	Conclusion	Next Test Step	Repair Action
4	Switch PC Board resistance test.  No dynamic test is possible.  Remove leads 401/403, 1/8, 9, 12, 4/5 and 402/404.	Terminals on Switch PC Board: 1/8 (pos) to 12 (neg)	>1K ohms	OK	cont	
			<100 ohms	Short	5	Replace Switch PC Board
		1/8 (neg) to 12 (pos)	<100 ohms	OK	cont	
			>1K ohms	Open	5	Replace Switch PC Board
		9 (pos) to 4/5 (neg)	>1K ohms	OK	cont	
			<100 ohms	Short	5	Replace Switch PC Board
		9 (neg) to 4/5 (pos)	<100 ohms	OK	cont	
			>1K ohms	Open	5	Replace Switch PC Board
		1/8 (pos) to 9 (neg)	<100 ohms	OK	cont	
			>1K ohms	Open	5	Replace Switch PC Board
		1/8 (neg) to 9 (pos)	>1K ohms	OK	cont	
			<100 ohms	Short	5	Replace Switch PC Board
		12 (pos) to 4/5 (neg)	<100 ohms	OK	cont	
			>1K ohms	Open	5	Replace Switch PC Board
		12 (neg) to 4/5 (pos)	>1K ohms	OK	cont	
			<100 ohms	Short	5	Replace Switch PC Board
		12 (pos) to 401/403 (neg)	>1K ohms	OK	cont	
			<100 ohms	Short	5	Replace Switch PC Board
		12 (neg) to 401/403 (pos)	<100 ohms	OK	cont	
			>1K ohms	Open	5	Replace Switch PC Board
		9 (pos) to 402/404 (neg)	<100 ohms	OK	cont	
			>1K ohms	Open	5	Replace Switch PC Board
		9 (neg) to 402/404 (pos)	>1K ohms	OK	cont	
			<100 ohms	Short	5	Replace Switch PC Board

**⚠ CAUTION**

If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact your local Authorized Field Service Facility for technical troubleshooting assistance before you proceed.

Step	Test	Check	Test Result	Conclusion	Next Test Step	Repair Action		
5	Snubber Resistors  Disconnect leads 401, 402, 403 and 404 from Switch PC Board	Lead 401 to terminal 12	25 ohms	OK	cont			
			>30 ohms <20 ohms	R4 open R4 shorted		Replace R4		
		Lead 402 to terminal 9	25 ohms	OK	cont			
			>30 ohms <20 ohms	R5 open R5 shorted		Replace R5		
		Lead 403 to terminal 12	25 ohms	OK	cont			
			>30 ohms <20 ohms	R6 open R6 shorted		Replace R6		
		Lead 404 to terminal 9	25 ohms	OK	cont			
			>30 ohms <20 ohms	R7 open R7 shorted		Replace R7		
		6	Output diodes  Remove output load	+ output plug (pos) to - output plug (neg)	<100 ohms	Shorted output diode D1 thru D12		Test individually
					>200 ohms	Output diodes OK		

**⚠ CAUTION**

If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact your local Authorized Field Service Facility for technical troubleshooting assistance before you proceed.

Step	Test	Check	Test Result	Conclusion	Next Test Step	Repair Action
7	D13 Input Rectifier	9 (pos) to H1 (neg)	>1K ohms	OK	cont	
			<100 ohms	Shorted	4-5	Replace D13, inspect S1, test C1 and C2
		9 (pos) to A (neg)	>1K ohms	OK	cont	
			<100 ohms	Shorted	4-5	Replace D13, inspect S1, test C1 and C2
		9 (pos) to H5 (neg)	>1K ohms	OK	cont	
			<100 ohms	Shorted	4-5	Replace D13, inspect S1, test C1 and C2
		12 (neg) to H1 (pos)	>1K ohms	OK	cont	
			<100 ohms	Shorted	4-5	Replace D13, inspect S1, test C1 and C2
		12 (neg) to A (pos)	>1K ohms	OK	cont	
			<100 ohms	Shorted	4-5	Replace D13, inspect S1, test C1 and C2
		12 (neg) to H5 (pos)	>1K ohms	OK	cont	
			<100 ohms	Shorted	4-5	Replace D13, inspect S1, test C1 and C2
		9 (neg) to H1 (pos)	<100 ohms	OK	cont	
			>1K ohms	Open	4-5	Replace D13, inspect S1, test C1 and C2
		9 (neg) to A (pos)	<100 ohms	OK	cont	
			>1K ohms	Open	4-5	Replace D13, inspect S1, test C1 and C2
		9 (neg) to H5 (pos)	<100 ohms	OK	cont	
			>1K ohms	Open	4-5	Replace D13, inspect S1, test C1 and C2
		12 (pos) to H1 (neg)	<100 ohms	OK	cont	
			>1K ohms	Open	4-5	Replace D13, inspect S1, test C1 and C2
12 (pos) to A (neg)	<100 ohms	OK	cont			
	>1K ohms	Open	4-5	Replace D13, inspect S1, test C1 and C2		
12 ( pos) to H5 (neg)	<100 ohms	OK	cont			
	>1K ohms	Open	4-5	Replace D13, inspect S1, test C1 and C2		

## Matched Parts

Certain parts must be replaced in matched sets. Matched sets are required in the following areas:

Output diodes: D1, D2, D3, D4 and D5  
Output diodes: D7, D8, D9, D10 and D11  
Capacitor bleeder resistors: R1 and D9  
Capacitors: C1 and C2  
Capacitors: C1, C2, C14 and C15 (575 VAC only)

## Switch PC Board Repairs

If a test indicates that a Switch PC Board is defective, both Switch PC Boards must be replaced.

Replacement boards must have completely identical part numbers. A defective module is likely to damage other devices in the power circuitry. The defect may be subtle and not detectable by an ohmmeter measurement. Unknown defective parts may cause newly replaced parts to fail.

In addition to replacing the Switch PC Boards, replace C1 and C2 (also C14 and C15 of the 575 VAC V300-I) if the following conditions are met:

1. Machine was operating from 380 VAC or higher supply when failure occurred.
2. Switch PC Boards have burned areas.

## Switch PC Board Replacement Procedure

### WARNING



**ELECTRIC SHOCK** can kill.

- Have an electrician install and service this equipment.
- Turn the input power off at the fuse box before working on equipment.
- Do not touch electrically hot parts.



**EXPLODING PARTS** can cause injury.

- Failed parts can explode or cause other parts to explode when power is applied.
- Always wear a face shield and long sleeves when servicing.

1. Carefully disconnect the leads at the top of the Switch PC Board.
2. Remove the four socket head cap screws with a 3/16" hex key wrench.
3. While holding the Switch PC Board, remove the hex head cap screws from the center area of the board.
4. Remove the board.

5. Thoroughly clean the heat sink surface.
6. Apply a thin layer (ideally .005-.010") of Dow 340 Heat Sink Compound to the module mounting surfaces of the new Switch PC Board and a thinner layer (.002") to the capacitor terminals. Keep the heat sink compound away from the screw threads since this compound will affect the torque specifications.
7. Carefully place the Switch PC Board onto the heat sink. Be sure the mounting holes are lined up before making full contact with the heat sink.
8. Caution: The heat sink and the capacitor terminals are relatively soft material and it is very easy to cross-thread the mounting screws. Holding the Switch PC Board, install the 4 socket head cap screws, finger tight only. Then install the hex head cap screws into the capacitor, finger tight only.
9. Torque the 4 socket head cap screws to 44 inch-lbs force (5 N - m). Then torque the capacitor hex head cap screws to 55 inch-lbs force (6 N - m).
10. Reconnect all the leads to the board.

Before applying input power to the machine, check all electrical connections. An incorrect connection will result in machine damage when the power is switched on.

## Test After Repair

1. Short terminals 14 and 53 of the Protection PC Board. Connect an ohmmeter, set for X1000 range, to terminals 9 (+) and 12 (-) of the Switch PC Board. The meter will show the capacitors charging up. The meter may take a minute or so to stabilize. The value must not exceed 8600 ohms. Test both boards. For 575V only units - measure across each power capacitor, 2 per switch board; All four readings should be approximately 5,000 ohms.
2. If OK, remove the short and proceed with the power test.
3. Fuse input supply with 5 amp fuses.
4. Check output open circuit voltages. Do not apply output load.
5. Connect machine for 460 (V300-I), or 575 (V300-I, 575V), or 380, 415 or 440 (V300-I) VAC input.
6. Check output open circuit voltages. Do not apply output load.
7. Fuse for 20 amps and test under load.

**Replacement of Input Rectifier and Output Diodes**

Input rectifier, D13, is a power module. When mounting power modules, the heat sink and module mounting surface should be clean and free of burrs and foreign material. Apply heatsink compound (Dow 340) as a uniform layer ideally .010" thick, to eliminate all air pockets. This may be verified by mounting and then removing the module. When removed, the compound on both surfaces will appear textured as if a vacuum had created veinlike ridges when the parts were separated. If the compound does not have this appearance, apply more heatsink compound and recheck.

Replacement of output diodes D1 thru D12 is similar. Clean and brighten mounting surface with fine steel wool. Compound should be used on surface between diode and heat sink when mounting individual diodes.

The compound should be applied to the heat sink in a very thin layer, less than 0.001 in. DO NOT apply on diode stud and mounting nut threads.

Components must have proper torque applied to mounting screws and to electrical terminals. Torque the modules according to the following:

<b>Component</b>	<b>Component to Heat Sink Torque ±10%</b>	<b>Terminal Torque ±10%</b>
Switch Board		
Module	44 Inch - Lbs. <sup>(1)</sup> (5N - m)	N.A.
Capacitor	N.A.	55 Inch - Lbs. (6.3 N - m)
Input Rectifier (M15454-1)	6 Inch - Lbs. <sup>(2)</sup> (0.7 N - m)	26 Inch - Lbs. 3 (N - m)
Output Diode (M15482-2)	25 Inch - Lbs. (3 N - m)	N.A.

<sup>(1)</sup> Retorque after 3 hours to allow for spread of compound.

<sup>(2)</sup> Tighten in staggered fashion one quarter turn at a time.

**Environment Protection**

High voltage connections are covered with an RTV sealant to prevent malfunction in severe environments. Sealant must be applied to connections which have been opened or otherwise lost their protection. A noncorrosive electronic grade sealant such as Dow Corning 3140, 3145, 738, Columbus Adhesives 0172 or GE RTV-162 is recommended. Sealant may also be purchased from Lincoln Electric (order E2519 Silicone Rubber RTV Coating). Apply sealant after machine is repaired and tested.

High voltage areas which require sealant are as listed:  
- Input rectifier D13, all 5 terminals.

**Printed Circuit Board Replacement**

1. Handle PC Boards by edges only.
2. Store PC Boards only in the bags that disperse static charges.
3. Inspect PC Board for burned conductors or components. If damage is visible, inspect the machine wiring for grounds or shorts to avoid damaging a new PC Board.
4. If there is no visible damage to the PC Board, install a new PC Board and see if the problem is fixed. If the problem is fixed by the new board, reinstall the old board and see if the problem reoccurs. If the problem does not reoccur, check the wiring harness and plugs for loose connections.

# REMOTE CONTROL ADAPTERS


**▲ WARNING:**

**ELECTRIC SHOCK CAN KILL**




TURN THE POWER SWITCH OF THE WELDING POWER SOURCE "OFF" BEFORE INSTALLING PLUGS ON CABLES OR WHEN CONNECTING OR DISCONNECTING PLUGS TO WELDING POWER SOURCE.

STRAIGHT PLUG (14 PIN)  
TO POWER SOURCE

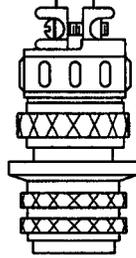


K864

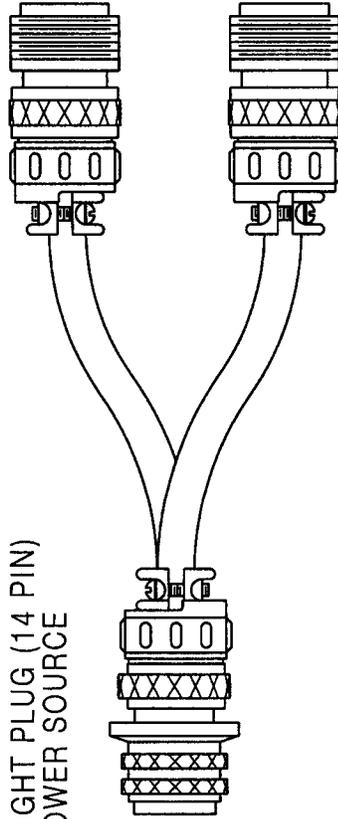


CABLE RECEPTACLE (6 SOCKET)  
TO: 1) K857 REMOTE CONTROL  
2) K963 HAND AMPTRON  
3) K870 FOOT AMPTRON

STRAIGHT PLUG (14 PIN)  
TO POWER SOURCE

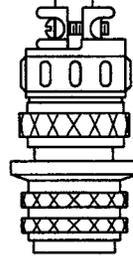

K876

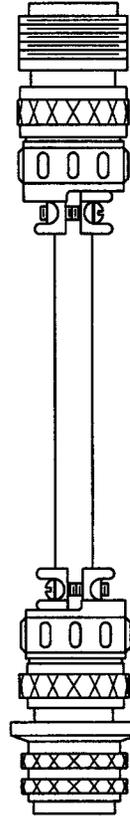

CABLE RECEPTACLE (6 SOCKET)  
TO: 1) LN-25 WIRE FEEDERS

CABLE RECEPTACLE (14 SOCKET)  
TO: 1) LN-7 WIRE FEEDERS

# K867 UNIVERSAL ADAPTER FOR 14-PIN WIRE FEEDER RECEPTACLE

## INSTALLATION INSTRUCTIONS

THIS CONNECTOR IS MEANT TO BE USED WITH LINCOLN POWER SOURCES WHICH HAVE A 14-PIN WIRE FEEDER RECEPTACLE. IT IS DESIGNED TO ALLOW THE USER TO MAKE CONNECTIONS TO ANY OF THE 14 CIRCUITS PRESENT IN THE WIRE FEEDER RECEPTACLE.

CONSULT THE WIRING DIAGRAM OF THE POWER SOURCE AND WIRE FEEDER THIS ADAPTER WILL BE USED WITH.

NOT ALL CIRCUITS ARE PRESENT IN EVERY POWER SOURCE, NOR ARE THEY REQUIRED FOR PROPER WIRE FEEDER OPERATION.


1. TURN THE POWER SWITCH OF THE WELDING POWER SOURCE OFF BEFORE INSTALLING THIS ADAPTER TO WIRE FEEDER CABLE.
2. CONSULT THE APPROPRIATE EQUIPMENT WIRING DIAGRAMS FOR THE CONNECTIONS TO UNIVERSAL ADAPTER. THE STANDARD CONNECTOR PIN DESIGNATIONS AND FUNCTIONS ARE SHOWN BELOW.

NOTE: 115V AC (31, 32), 42V AC (41, 42), 24V AC (SPARE) AND TRIGGER CIRCUIT (2, 4)


3. USE LUG, CRIMP SPLICE OR SOLDER CONNECTIONS AS REQUIRED AND INSULATE EACH USED AND UNUSED LEAD IN THE UNIVERSAL ADAPTER. THE INSULATING METHOD MUST BE RATED FOR 120V AC OR GREATER.

(SEE APPROPRIATE WIRING DIAGRAM) THESE FUNCTIONS ARE LISTED FOR REFERENCE ONLY AND EACH MAY OR MAY NOT BE PRESENT IN YOUR EQUIPMENT.

PIN	LEAD	STANDARD FUNCTION
A	32	115V AC
B	GND	CHASSIS CONNECTION
C	2	TRIGGER CIRCUIT
D	4	TRIGGER CIRCUIT
E	77	OUTPUT CONTROL
F	76	OUTPUT CONTROL
G	75	OUTPUT CONTROL
H	21	WORK
I	41	42V AC
J	31	115V AC
K	42	42V AC
L	82	WELDING MODE CONTROL
M	81	WELDING MODE CONTROL
N	SPARE	24V AC

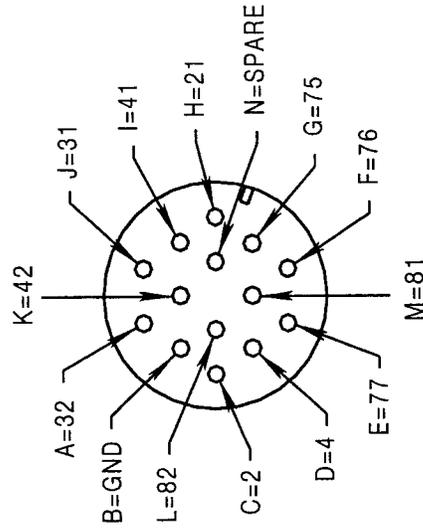


14-PIN BOX RECEPTACLE, FRONT VIEW  
AND 14-PIN CABLE PLUG, REAR VIEW

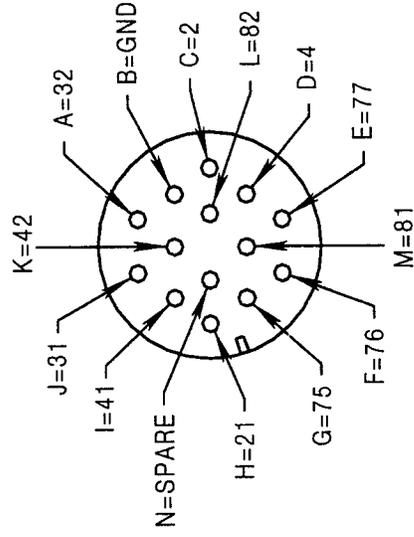

14-PIN BOX RECEPTACLE, REAR VIEW  
AND 14-PIN CABLE PLUG, FRONT VIEW

# K867 PLUG TO LN-7 - CONNECTION DIAGRAM

<b>WARNING</b> 	<ul style="list-style-type: none"> <li>• Turn off input power to the Welding Power Source using the disconnect switch at the fuse box Before connecting the wire feeder.</li> <li>• Only qualified persons should install, use or service this machine.</li> </ul>
<b>ELECTRIC SHOCK CAN KILL</b>	

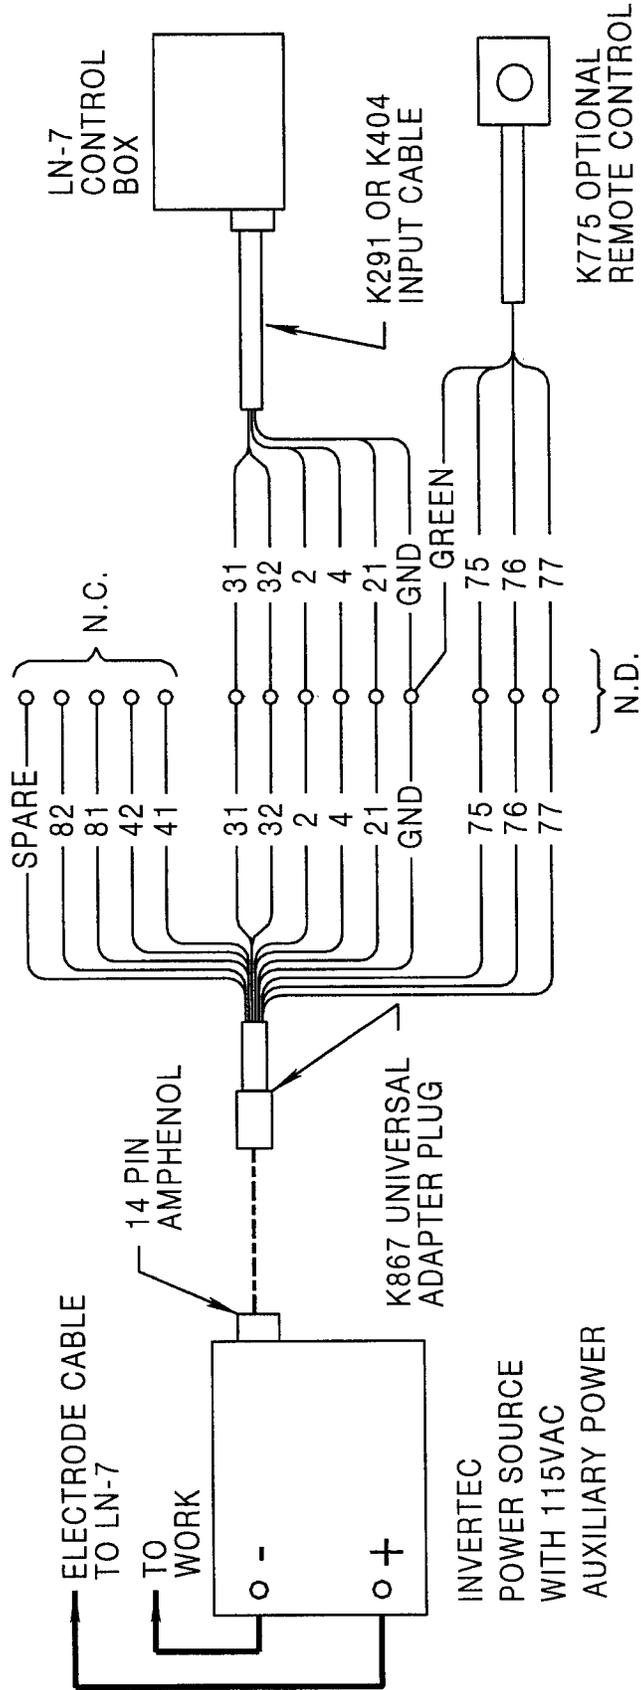


N.A. WELDING CABLE MUST BE SIZED FOR CURRENT AND DUTY CYCLE OF APPLICATION.  
 N.B. DIAGRAM SHOWS ELECTRODE POSITIVE. TO CHANGE POLARITY, TURN POWER "OFF", REVERSE ELECTRODE AND WORK CABLE AT POWER SOURCE.

N.C. INSULATE EACH UNUSED LEAD INDIVIDUALLY.  
 N.D. SPLICE LEADS AND INSULATE.

# K867 PLUG TO LN-25 - CONNECTION DIAGRAM

 <p><b>WARNING</b></p>	<ul style="list-style-type: none"> <li>• Turn off input power to the Welding Power Source using the disconnect switch at the fuse box Before connecting the wire feeder.</li> <li>• Only qualified persons should install, use or service this machine.</li> </ul>
<p><b>ELECTRIC SHOCK CAN KILL</b></p>	

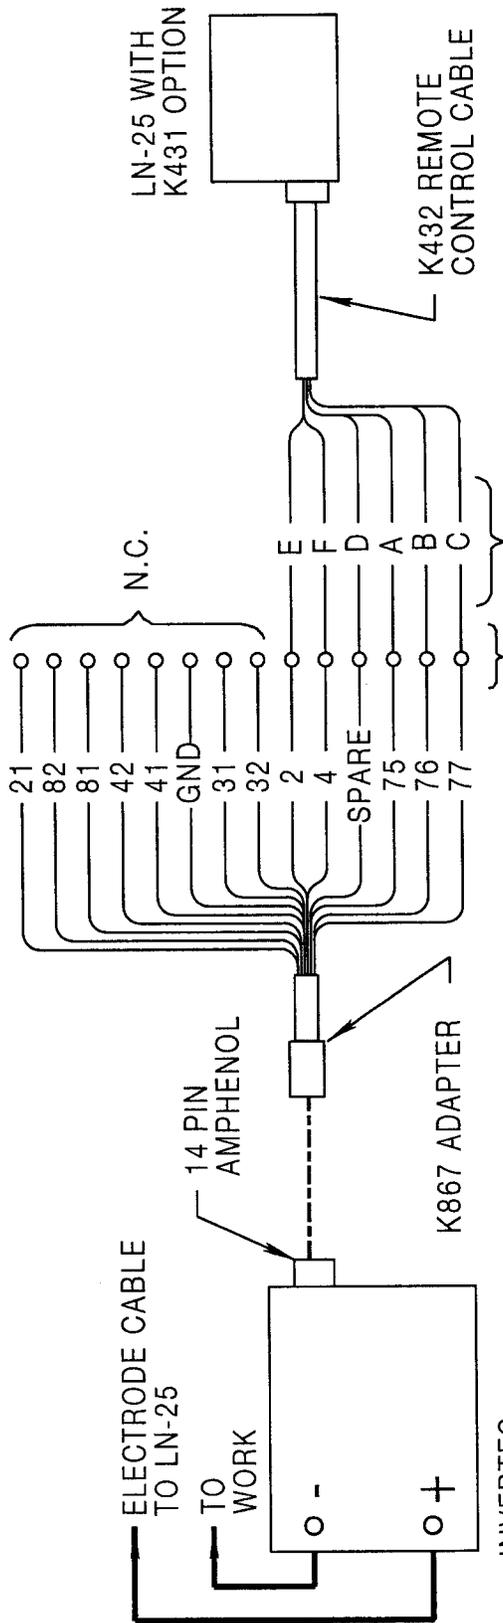

INVERTEC  
POWER SOURCE

N.A. WELDING CABLE MUST BE SIZED FOR CURRENT AND DUTY CYCLE OF APPLICATION.  
 N.B. DIAGRAM SHOWS ELECTRODE POSITIVE. TO CHANGE POLARITY, TURN POWER "OFF",  
 REVERSE ELECTRODE AND WORK CABLE AT POWER SOURCE.


N.C. INSULATE EACH UNUSED LEAD INDIVIDUALLY.

N.D. REMOVE 6 PIN PLUG FROM K432 CABLE IN ORDER TO CONNECT K867 PLUG.  
 LABEL EACH LEAD (A THRU F) AS THEY ARE REMOVED FROM 6 PIN PLUG.

N.E. SPlice LEADS AND INSULATE.

# K867 UNIVERSAL ADAPTER / INVERTEC - CONNECTION DIAGRAM


<b>WARNING</b> 	<ul style="list-style-type: none"> <li>Turn off input power to the Welding Power Source using the disconnect switch at the fuse box Before connecting the wire feeder.</li> <li>Only qualified persons should install, use or service this machine.</li> </ul>
<b>ELECTRIC SHOCK CAN KILL</b>	

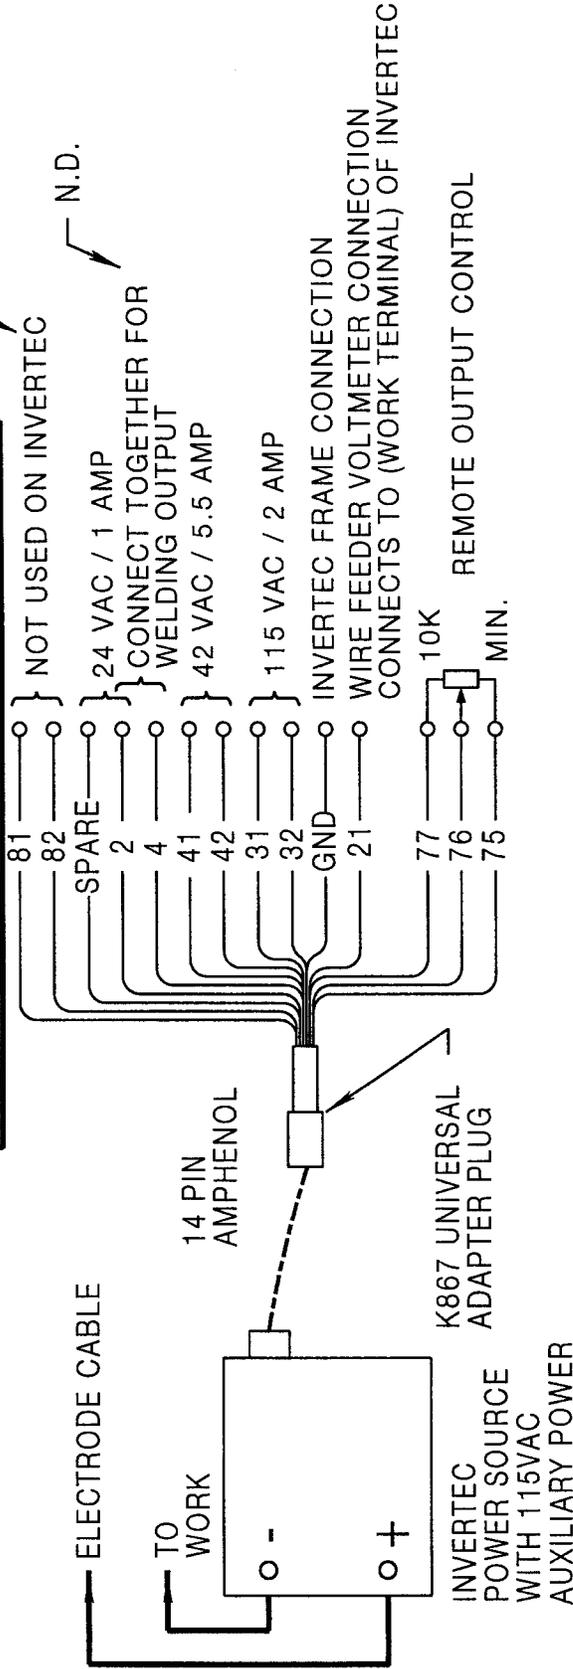

- N.A. WELDING CABLE MUST BE SIZED FOR CURRENT AND DUTY CYCLE OF APPLICATION.
- N.B. DIAGRAM SHOWS ELECTRODE POSITIVE. TO CHANGE POLARITY, TURN POWER "OFF", REVERSE ELECTRODE AND WORK CABLE AT POWER SOURCE.
- N.C. INSULATE EACH UNUSED LEAD INDIVIDUALLY.
- N.D. FOR WIRE FEEDERS THAT RETURN A SIGNAL FOR WELDING OUTPUT, USE ISOLATION RELAY TO CLOSE LEADS 2 & 4.

# K876 ADAPTER TO LN-25 - CONNECTION DIAGRAM


<p><b>WARNING</b></p> 	<ul style="list-style-type: none"> <li>• Turn off input power to the Welding Power Source using the disconnect switch at the fuse box Before connecting the wire feeder.</li> <li>• Only qualified persons should install, use or service this machine.</li> </ul>
<p><b>ELECTRIC SHOCK CAN KILL</b></p>	

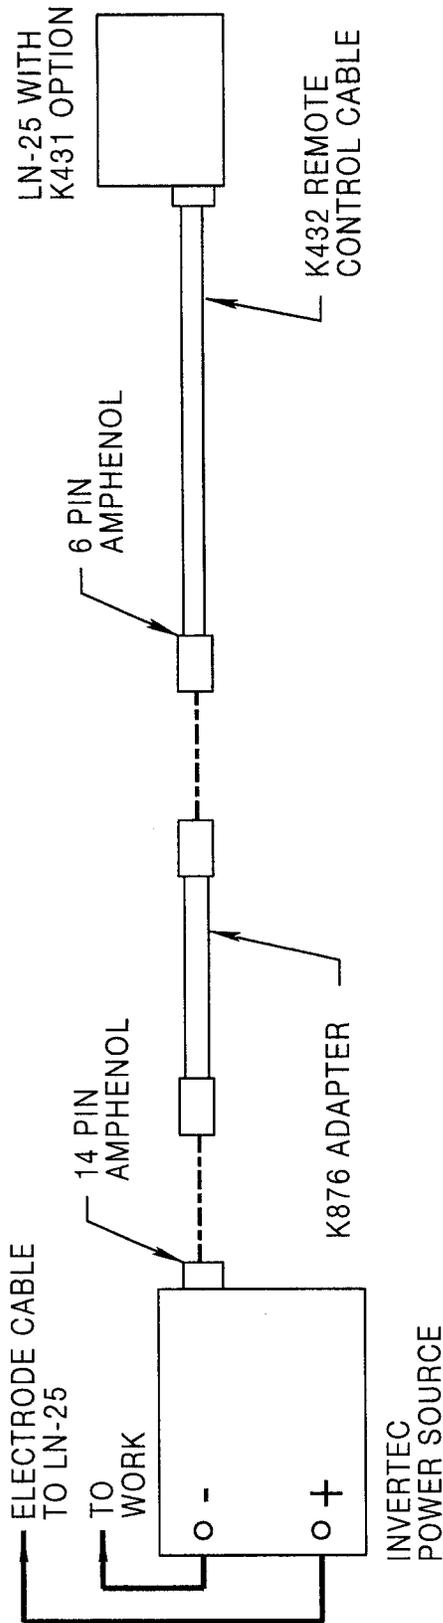

- N.A. WELDING CABLE MUST BE SIZED FOR CURRENT AND DUTY CYCLE OF APPLICATION.
- N.B. DIAGRAM SHOWS ELECTRODE POSITIVE. TO CHANGE POLARITY, TURN POWER "OFF", REVERSE ELECTRODE AND WORK CABLE AT POWER SOURCE.
- N.C. FOR INVERTECS WITH 6 PIN AMPHENOL, K432 CABLE CAN BE CONNECTED DIRECTLY.

# K864 ADAPTER TO LN-7 & REMOTE CONTROL - CONNECTION DIAGRAM

<b>WARNING</b> 	<ul style="list-style-type: none"> <li>• Turn off input power to the Welding Power Source using the disconnect switch at the fuse box Before connecting the wire feeder.</li> <li>• Only qualified persons should install, use or service this machine.</li> </ul>
<b>ELECTRIC SHOCK CAN KILL</b>	

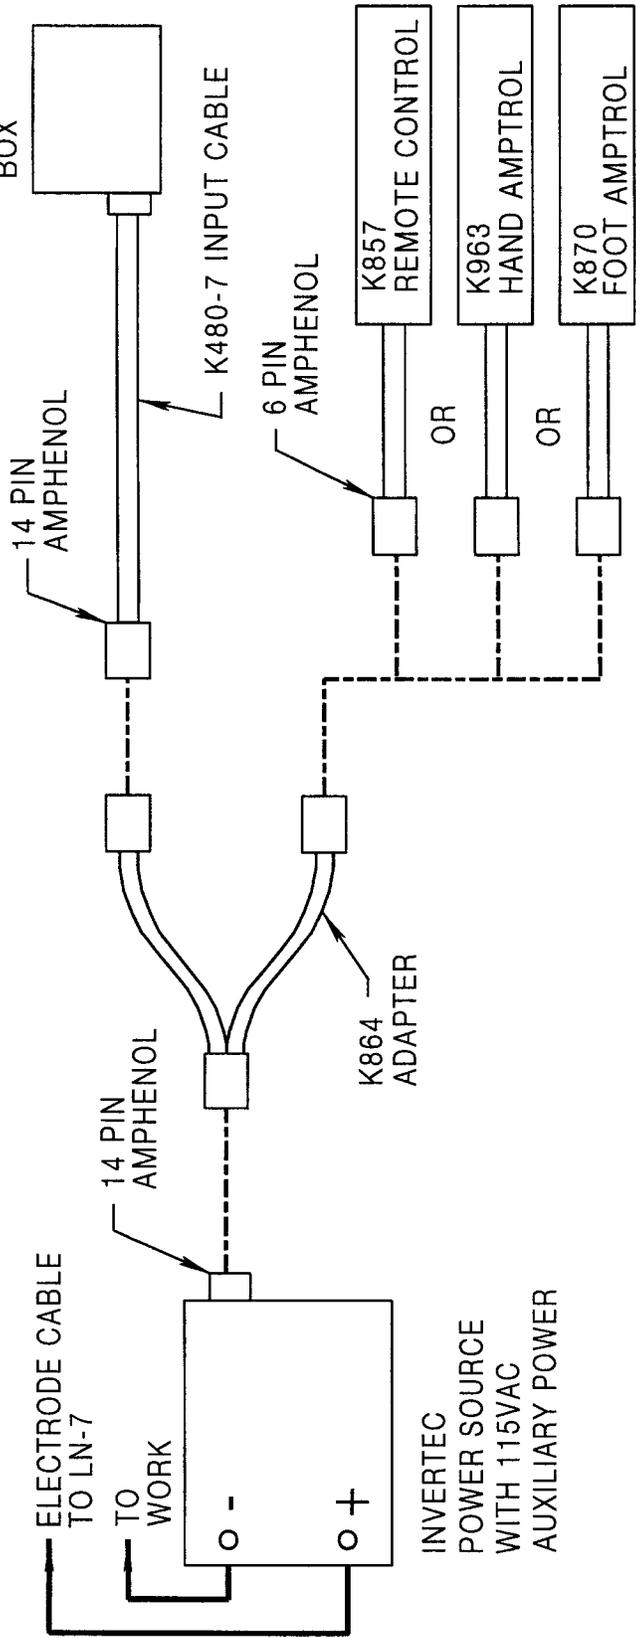


N.A. WELDING CABLE MUST BE SIZED FOR CURRENT AND DUTY CYCLE OF APPLICATION.  
 N.B. DIAGRAM SHOWS ELECTRODE POSITIVE. TO CHANGE POLARITY, TURN POWER "OFF", REVERSE ELECTRODE AND WORK CABLE AT POWER SOURCE.  
 N.C. K480-7 INPUT CABLE CAN BE CONNECTED DIRECTLY IF REMOTE CONTROL IS NOT REQUIRED.  
 N.D. K864 ADAPTER CANNOT BE USED WITH AN LN-25.

# K900-1 DC TIG STARTER - CONNECTION DIAGRAM

<b>WARNING</b>

<b>ELECTRIC SHOCK CAN KILL</b>

- Turn off input power to the Welding Power Source using the disconnect switch at the fuse box before connecting the DC Tig Starter to the power source, or the Ampctrl or Wire Feeder to the DC Tig Starter.
- Only qualified persons should install, use or service this machine.

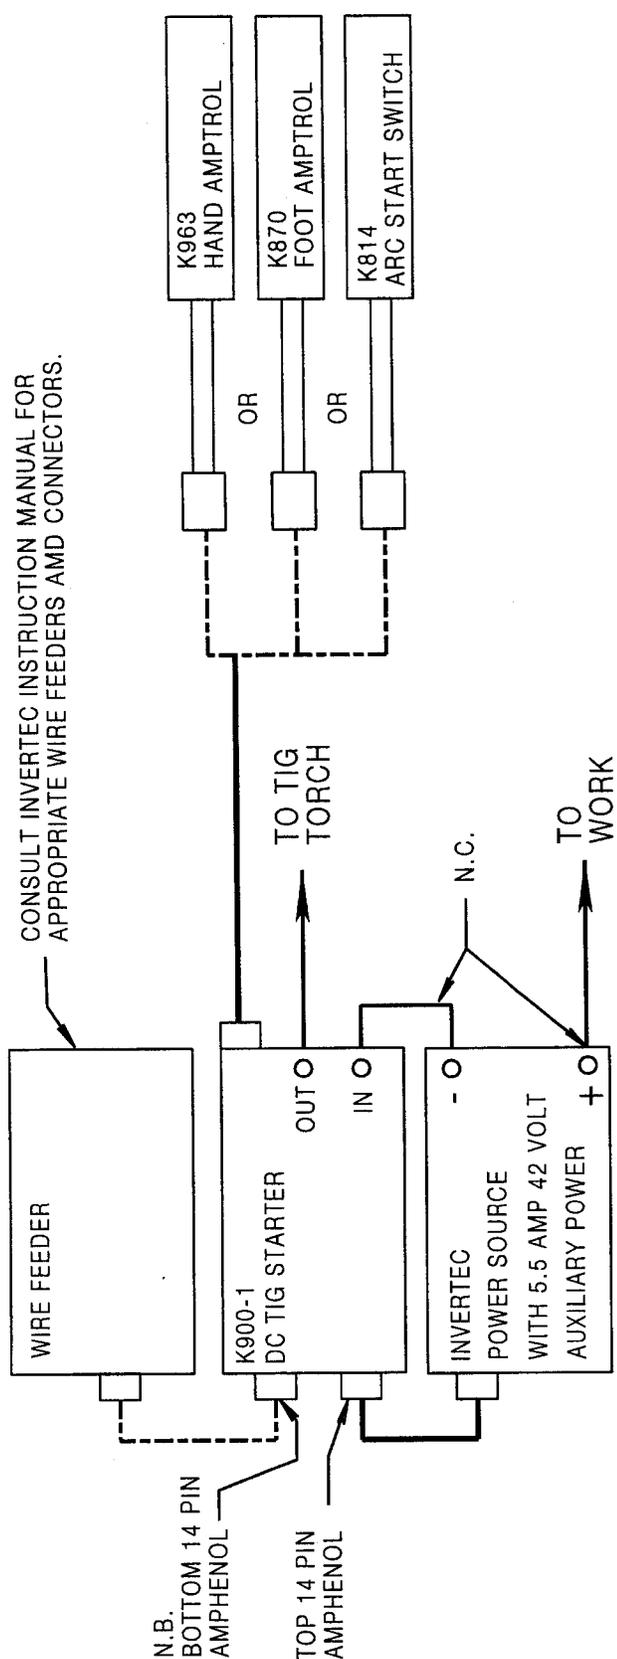



N.B. BOTTOM 14 PIN AMPHENOL

TOP 14 PIN AMPHENOL

- N.A. WELDING CABLE MUST BE SIZED FOR CURRENT AND DUTY CYCLE OF APPLICATION.
- N.B. A WIRE FEEDER CAN BE PLUGGED INTO THE DC TIG STARTER TO REDUCE PROCESS CONVERSION TIME.
- N.C. SET UP SHOWN IS FOR DC NEGATIVE TIG WELDING. DC POSITIVE WELDING IS OBTAINED BY REVERSING THE OUTPUT CONNECTIONS ON THE INVERTEC AND SETTING THE INVERTEC'S ELECTRODE POLARITY SWITCH TO POSITIVE.

# LN-9 GMA WITH K596 CABLE TO INVERTEC - CONNECTION DIAGRAM

<b>WARNING</b> 	<ul style="list-style-type: none"> <li>• Turn off input power to the Welding Power Source using the disconnect switch at the fuse box Before connecting the wire feeder.</li> <li>• Only qualified persons should install, use or service this machine.</li> </ul>
<b>ELECTRIC SHOCK CAN KILL</b>	

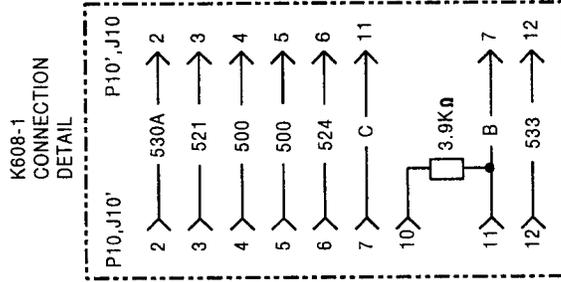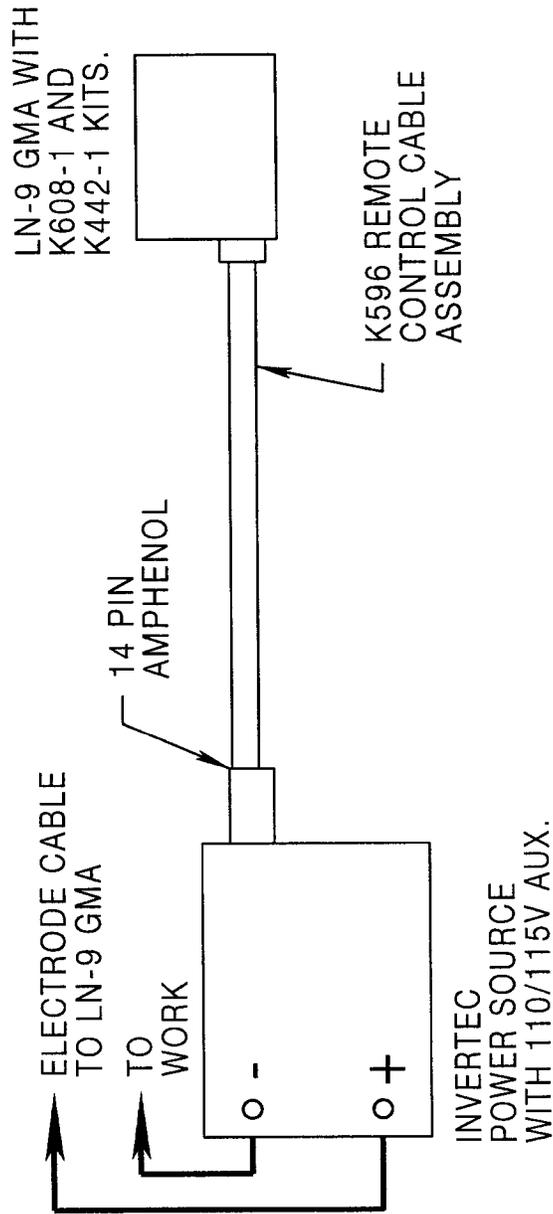

- N.A. WELDING CABLE MUST BE SIZED FOR CURRENT AND DUTY CYCLE OF APPLICATION.
- N.B. DIAGRAM SHOWS ELECTRODE POSITIVE. TO CHANGE POLARITY, TURN POWER "OFF", REVERSE ELECTRODE AND WORK CABLE AT POWER SOURCE. SET METER POLARITY SWITCH ON REAR OF INVERTEC TO COINCIDE WITH POLARITY USED. SET LN-9 GMA POLARITY SWITCH ALSO.
- N.C. INSTALL K608-1 ADAPTER IN LINE WITH P10 TO LN-9 GMA VOLTAGE BOARD PER INSTRUCTIONS IN V300 MANUAL.
- N.D. FOR GMAW WELDING, INSTALL PULSE POWER FILTER KIT K442-1 IN LN-9 GMA.

# LN-9 GMA WITH K196 CABLE AND K867 PLUG TO INVERTEC - CONNECTION DIAGRAM


## WARNING




- Turn off input power to the Welding Power Source using the disconnect switch at the fuse box Before connecting the wire feeder.

**ELECTRIC SHOCK CAN KILL**

- Only qualified persons should install, use or service this machine.



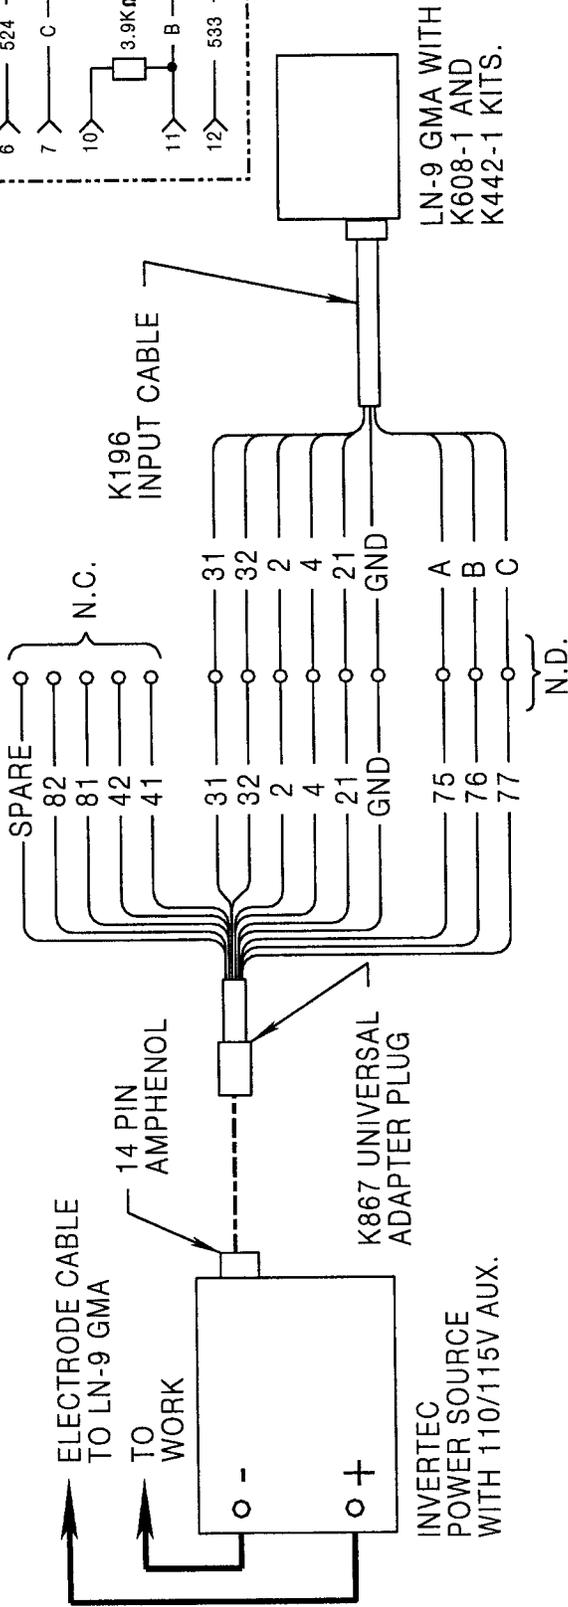


## K608-1 CONNECTION DETAIL

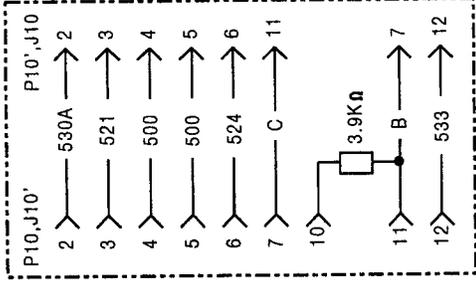

- N.A. WELDING CABLE MUST BE SIZED FOR CURRENT AND DUTY CYCLE OF APPLICATION.
- N.B. DIAGRAM SHOWS ELECTRODE POSITIVE. TO CHANGE POLARITY, TURN POWER "OFF". REVERSE ELECTRODE AND WORK CABLE AT POWER SOURCE. SET METER POLARITY SWITCH ON REAR OF INVERTEC TO COINCIDE WITH POLARITY USED. SET LN-9 GMA POLARITY SWITCH ALSO.
- N.C. INSULATE EACH UNUSED LEAD INDIVIDUALLY.
- N.D. SPLICE LEADS AND INSULATE.
- N.E. INSTALL K608-1 ADAPTER IN LINE WITH P10 TO LN-9 GMA VOLTAGE BOARD AND SECURE TO ADJACENT HARNESS WITH WIRE TIE PROVIDED. TURN "START" TRIMMER ON VOLTAGE BOARD FULLY "CCW".
- N.F. FOR GMAW WELDING, INSTALL PULSE POWER FILTER KIT K442-1 IN LN-9 GMA.

# WIRING DIAGRAM V300 PRO Code 10256 V300-I Code 10258

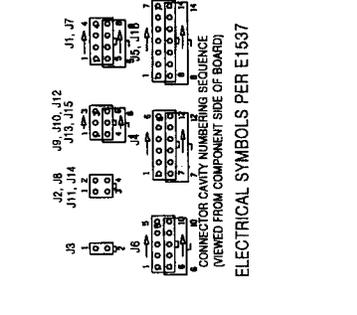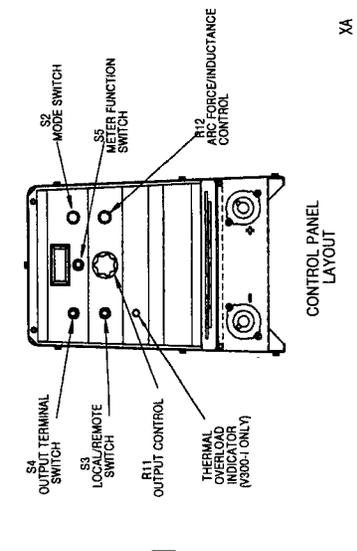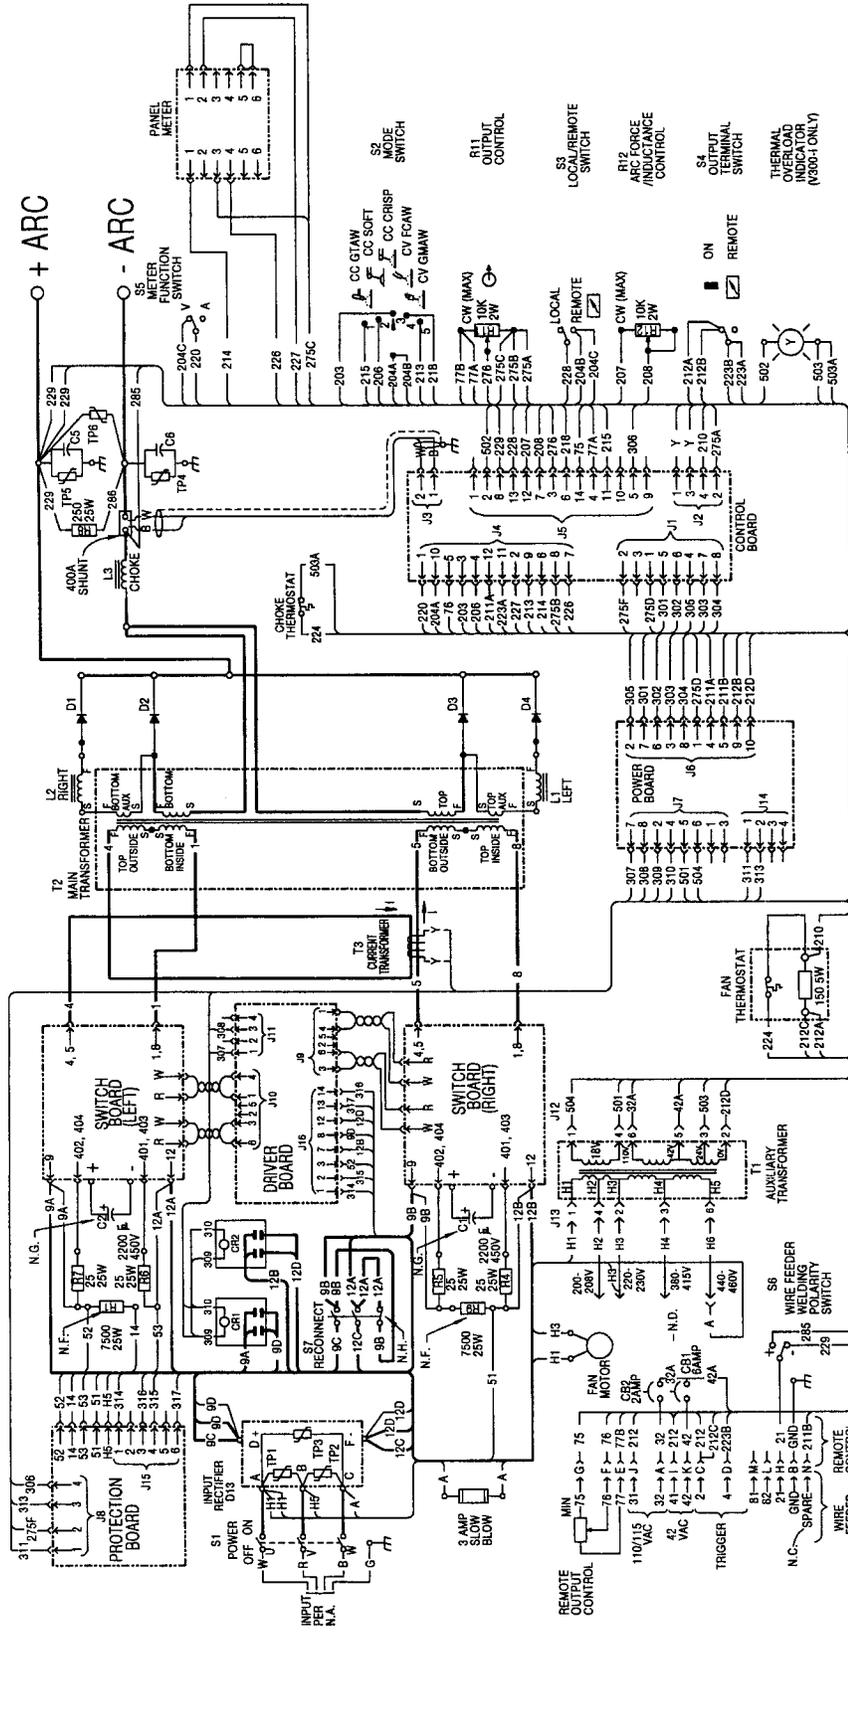

**COLOR CODE:**  
 B = BLACK  
 G = GREEN  
 W = WHITE  
 Y = YELLOW


- NOTES:**
- N.A. FOR MACHINES SUPPLIED WITH INPUT CABLE (N300-PRO). CONNECT BLACK & WHITE LEADS TO SUPPLY CIRCUIT. FOR MACHINES NOT SUPPLIED WITH INPUT CABLE, CONNECT BLACK & WHITE LEADS TO SUPPLY CIRCUIT. CONNECT GREEN LEAD TO GROUND PER NATIONAL ELECTRIC CODE.
  - FOR MACHINES NOT SUPPLIED WITH INPUT CABLE (N300-I). FOR SINGLE PHASE INPUT, CONNECT BLACK & WHITE LEADS TO SUPPLY CIRCUIT. FOR THREE PHASE INPUT, GROUND MACHINE PER NATIONAL AND LOCAL ELECTRICAL CODES. CONNECT TERMINALS U, V & W TO SUPPLY CIRCUIT.
  - N.B. SINCE COMPONENTS OR CIRCUITRY OF A PRINTED CIRCUIT BOARD MAY CHANGE WITHOUT AFFECTING THE INTERCHANGEABILITY OF A COMPLETE BOARD, THIS DIAGRAM MAY NOT SHOW THE EXACT COMPONENTS OR CIRCUITRY HAVING A COMMON CODE NUMBER.
  - N.C. WIRE FEEDERS REQUIRING 28VAC, USE PINS 'X' & 'Y'.
  - N.D. PLAGE 'A' LEAD ON APPROPRIATE CONNECTION FOR INPUT VOLTAGE.
  - N.F. R1, R9 BLEEDER RESISTORS ARE A MATCHED SET.
  - N.G. C1, C2 CAPACITORS ARE A MATCHED SET.
  - N.H. PLAGE SWITCH IN APPROPRIATE POSITION FOR INPUT VOLTAGE.
  - CONNECTION SHOWN IS FOR 380-480V OPERATION.

XA

L10189

**NOTE: This diagram is for reference only. It may not be accurate for all machines covered by this manual. The specific diagram for a particular code is pasted inside the machine on one of the enclosure panels. If the diagram is illegible, write to the Service Department for a replacement. Give the equipment code number.**

# V300-1 WIRING DIAGRAM (EUROPEAN) Code 10336 & 10450

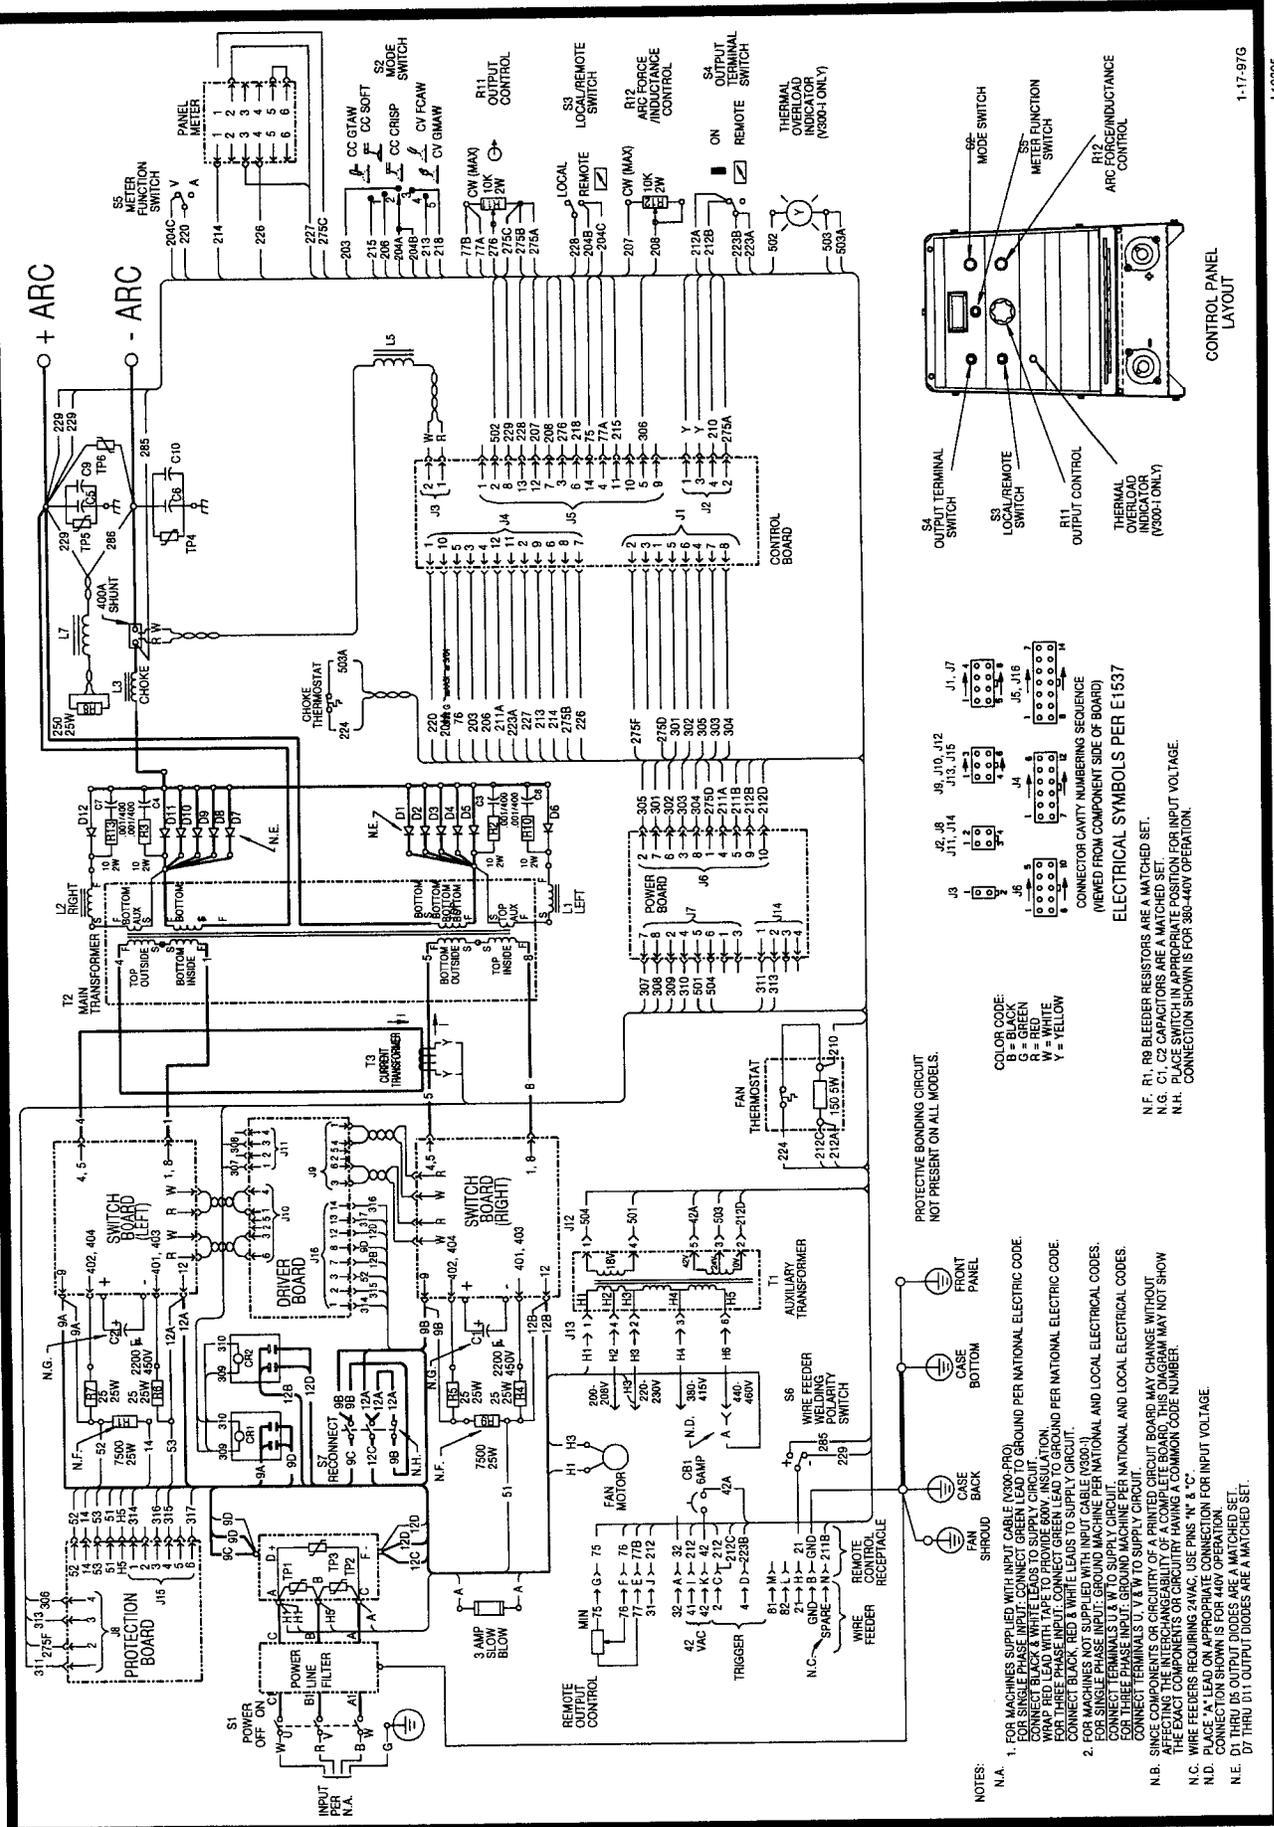

**NOTES:**

N.A. 1. FOR MACHINES SUPPLIED WITH INPUT CABLE (V300-PRO), FOR SINGLE PHASE INPUT, CONNECT GREEN LEAD TO GROUND PER NATIONAL ELECTRIC CODE. CONNECT BLACK AND WHITE LEADS TO SUPPLY MAIN INSULATION. FOR THREE PHASE INPUT, CONNECT GREEN LEAD TO GROUND. CONNECT BLACK, RED & WHITE LEADS TO SUPPLY CIRCUIT.

2. FOR MACHINES NOT SUPPLIED WITH INPUT CABLE (V300-1), CONNECT BLUE, BLACK & RED PER NATIONAL AND LOCAL ELECTRICAL CODES. CONNECT TERMINALS U, V & W TO SUPPLY CIRCUIT.

N.B. SINCE COMPONENTS OR CIRCUITRY OF A PRINTED CIRCUIT BOARD MAY CHANGE WITHOUT AFFECTING THE INTERCHANGABILITY OF A COMPLETE BOARD, THIS DIAGRAM MAY NOT SHOW THE EXACT COMPONENTS OR CIRCUITRY HAVING A COMMON CODE NUMBER.

N.C. WIRE FEEDERS REQUIRING 24VAC, USE 24VAC WIRE FEEDER CONNECTION FOR INPUT VOLTAGE.

N.D. CONNECTION SHOWN IS FOR 44W OPERATION.

N.E. D1, D2, D3, D4, D5, D6, D7, D8, D9, D10, D11, D12, D13, D14, D15, D16, D17, D18, D19, D20, D21, D22, D23, D24, D25, D26, D27, D28, D29, D30, D31, D32, D33, D34, D35, D36, D37, D38, D39, D40, D41, D42, D43, D44, D45, D46, D47, D48, D49, D50, D51, D52, D53, D54, D55, D56, D57, D58, D59, D60, D61, D62, D63, D64, D65, D66, D67, D68, D69, D70, D71, D72, D73, D74, D75, D76, D77, D78, D79, D80, D81, D82, D83, D84, D85, D86, D87, D88, D89, D90, D91, D92, D93, D94, D95, D96, D97, D98, D99, D100, D101, D102, D103, D104, D105, D106, D107, D108, D109, D110, D111, D112, D113, D114, D115, D116, D117, D118, D119, D120, D121, D122, D123, D124, D125, D126, D127, D128, D129, D130, D131, D132, D133, D134, D135, D136, D137, D138, D139, D140, D141, D142, D143, D144, D145, D146, D147, D148, D149, D150, D151, D152, D153, D154, D155, D156, D157, D158, D159, D160, D161, D162, D163, D164, D165, D166, D167, D168, D169, D170, D171, D172, D173, D174, D175, D176, D177, D178, D179, D180, D181, D182, D183, D184, D185, D186, D187, D188, D189, D190, D191, D192, D193, D194, D195, D196, D197, D198, D199, D200, D201, D202, D203, D204, D205, D206, D207, D208, D209, D210, D211, D212, D213, D214, D215, D216, D217, D218, D219, D220, D221, D222, D223, D224, D225, D226, D227, D228, D229, D230, D231, D232, D233, D234, D235, D236, D237, D238, D239, D240, D241, D242, D243, D244, D245, D246, D247, D248, D249, D250, D251, D252, D253, D254, D255, D256, D257, D258, D259, D260, D261, D262, D263, D264, D265, D266, D267, D268, D269, D270, D271, D272, D273, D274, D275, D276, D277, D278, D279, D280, D281, D282, D283, D284, D285, D286, D287, D288, D289, D290, D291, D292, D293, D294, D295, D296, D297, D298, D299, D300, D301, D302, D303, D304, D305, D306, D307, D308, D309, D310, D311, D312, D313, D314, D315, D316, D317, D318, D319, D320, D321, D322, D323, D324, D325, D326, D327, D328, D329, D330, D331, D332, D333, D334, D335, D336, D337, D338, D339, D340, D341, D342, D343, D344, D345, D346, D347, D348, D349, D350, D351, D352, D353, D354, D355, D356, D357, D358, D359, D360, D361, D362, D363, D364, D365, D366, D367, D368, D369, D370, D371, D372, D373, D374, D375, D376, D377, D378, D379, D380, D381, D382, D383, D384, D385, D386, D387, D388, D389, D390, D391, D392, D393, D394, D395, D396, D397, D398, D399, D400, D401, D402, D403, D404, D405, D406, D407, D408, D409, D410, D411, D412, D413, D414, D415, D416, D417, D418, D419, D420, D421, D422, D423, D424, D425, D426, D427, D428, D429, D430, D431, D432, D433, D434, D435, D436, D437, D438, D439, D440, D441, D442, D443, D444, D445, D446, D447, D448, D449, D450, D451, D452, D453, D454, D455, D456, D457, D458, D459, D460, D461, D462, D463, D464, D465, D466, D467, D468, D469, D470, D471, D472, D473, D474, D475, D476, D477, D478, D479, D480, D481, D482, D483, D484, D485, D486, D487, D488, D489, D490, D491, D492, D493, D494, D495, D496, D497, D498, D499, D500, D501, D502, D503, D504, D505, D506, D507, D508, D509, D510, D511, D512, D513, D514, D515, D516, D517, D518, D519, D520, D521, D522, D523, D524, D525, D526, D527, D528, D529, D530, D531, D532, D533, D534, D535, D536, D537, D538, D539, D540, D541, D542, D543, D544, D545, D546, D547, D548, D549, D550, D551, D552, D553, D554, D555, D556, D557, D558, D559, D560, D561, D562, D563, D564, D565, D566, D567, D568, D569, D570, D571, D572, D573, D574, D575, D576, D577, D578, D579, D580, D581, D582, D583, D584, D585, D586, D587, D588, D589, D590, D591, D592, D593, D594, D595, D596, D597, D598, D599, D600, D601, D602, D603, D604, D605, D606, D607, D608, D609, D610, D611, D612, D613, D614, D615, D616, D617, D618, D619, D620, D621, D622, D623, D624, D625, D626, D627, D628, D629, D630, D631, D632, D633, D634, D635, D636, D637, D638, D639, D640, D641, D642, D643, D644, D645, D646, D647, D648, D649, D650, D651, D652, D653, D654, D655, D656, D657, D658, D659, D660, D661, D662, D663, D664, D665, D666, D667, D668, D669, D670, D671, D672, D673, D674, D675, D676, D677, D678, D679, D680, D681, D682, D683, D684, D685, D686, D687, D688, D689, D690, D691, D692, D693, D694, D695, D696, D697, D698, D699, D700, D701, D702, D703, D704, D705, D706, D707, D708, D709, D710, D711, D712, D713, D714, D715, D716, D717, D718, D719, D720, D721, D722, D723, D724, D725, D726, D727, D728, D729, D730, D731, D732, D733, D734, D735, D736, D737, D738, D739, D740, D741, D742, D743, D744, D745, D746, D747, D748, D749, D750, D751, D752, D753, D754, D755, D756, D757, D758, D759, D760, D761, D762, D763, D764, D765, D766, D767, D768, D769, D770, D771, D772, D773, D774, D775, D776, D777, D778, D779, D780, D781, D782, D783, D784, D785, D786, D787, D788, D789, D790, D791, D792, D793, D794, D795, D796, D797, D798, D799, D800, D801, D802, D803, D804, D805, D806, D807, D808, D809, D810, D811, D812, D813, D814, D815, D816, D817, D818, D819, D820, D821, D822, D823, D824, D825, D826, D827, D828, D829, D830, D831, D832, D833, D834, D835, D836, D837, D838, D839, D840, D841, D842, D843, D844, D845, D846, D847, D848, D849, D850, D851, D852, D853, D854, D855, D856, D857, D858, D859, D860, D861, D862, D863, D864, D865, D866, D867, D868, D869, D870, D871, D872, D873, D874, D875, D876, D877, D878, D879, D880, D881, D882, D883, D884, D885, D886, D887, D888, D889, D890, D891, D892, D893, D894, D895, D896, D897, D898, D899, D900, D901, D902, D903, D904, D905, D906, D907, D908, D909, D910, D911, D912, D913, D914, D915, D916, D917, D918, D919, D920, D921, D922, D923, D924, D925, D926, D927, D928, D929, D930, D931, D932, D933, D934, D935, D936, D937, D938, D939, D940, D941, D942, D943, D944, D945, D946, D947, D948, D949, D950, D951, D952, D953, D954, D955, D956, D957, D958, D959, D960, D961, D962, D963, D964, D965, D966, D967, D968, D969, D970, D971, D972, D973, D974, D975, D976, D977, D978, D979, D980, D981, D982, D983, D984, D985, D986, D987, D988, D989, D990, D991, D992, D993, D994, D995, D996, D997, D998, D999, D1000.

**NOTE:** This diagram is for reference only. It may not be accurate for all machines covered by this manual. The specific diagram for a particular code is pasted inside the machine on one of the enclosure panels. If the diagram is illegible, write to the Service Department for a replacement. Give the equipment code number.

## Now Available ...The following Service Manuals

These are comprehensive single sources of information relative to Installation, Operation, Maintenance, Accessories, Theory of Operation, Replacement Parts, Electrical Diagrams and Extensive Troubleshooting.

**ORDER FROM: Technical Service Group-Customer Service Dept.  
Lincoln Electric Company  
22801 St. Clair Ave.  
Cleveland, Ohio 44117-1199**

**All orders must be pre-paid (US Funds Only): Please allow up to 4 weeks for delivery.**

### Make checks or Money Orders payable to the Lincoln Electric Company

Qty.	Titles	Machine Codes	Manual #	Unit Price	Total Price
	Square Wave Tig 255	(Codes 10022-10134)	SVM100-A	\$45.00	
	V300I	(Codes 9826-10133)	SVM101-A	\$45.00	
	SP100	(Codes 9284-10050)	SVM102-A	\$45.00	
	Power Arc 4000	(Codes 10083)	SVM103-A	\$45.00	
	Power Arc 4000	(Codes 10200-10244)	SVM103-B	\$45.00	
	ProCut 60 Single Phase	(Codes 9819-10118)	SVM104-A	\$45.00	
	V300 PRO	(Codes 9934-10131)	SVM105-A	\$45.00	
	LN 7 GMA	(Codes 9168-9931)	SVM106-A	\$45.00	
	RANGER 8	(Codes 9972-10110)	SVM107-A	\$45.00	
	DC600	(Codes 9773-9910)	SVM108-A	\$45.00	
	POWER WAVE 350/500	(Codes 10104-10155)	SVM109-A	\$65.00	
	RANGER 9	(Codes 9975-9976)	SVM110-A	\$45.00	
	SP250	(Codes 9402-10002)	SVM111-A	\$45.00	
	POWER WAVE 450	(Codes 10105-10195)	SVM112-A	\$65.00	
	WELDAN POWER 125	(Codes 10158-10160)	SVM113-A	\$45.00	
	LN25	(Codes 9218-10150)	SVM114-A	\$45.00	
	SP255	(Codes 10164-10165)	SVM115-A	\$45.00	
	Idealarc CV-300	(Codes 9456-10181)	SVM116-A	\$45.00	
	Wire-matic 250	(Codes 9799-10004)	SVM117-A	\$45.00	
	Square Wave TIG 355	(Codes 9951-9955)	SVM118-A	\$45.00	
	Wire-matic 255	(Codes 10166,10167)	SVM119-A	\$45.00	
	Ranger 10-LX	(Codes 9975, 9976)	SVM120-A	\$45.00	
				<b>TOTAL</b>	

SHIP MANUALS TO:

Name: \_\_\_\_\_

Address: \_\_\_\_\_

Phone: \_\_\_\_\_

# PARTS LIST FOR


# INVERTEC

# V300-PRO & V300-I

**This parts list is provided as an informative guide only.**

**This information was accurate at the time of printing. However, since these pages are regularly updated in Lincoln Electric's official Parts Book (BK-34), always check with your Lincoln parts supplier for the latest parts information.**

# ILLUSTRATION OF SUB ASSEMBLIES

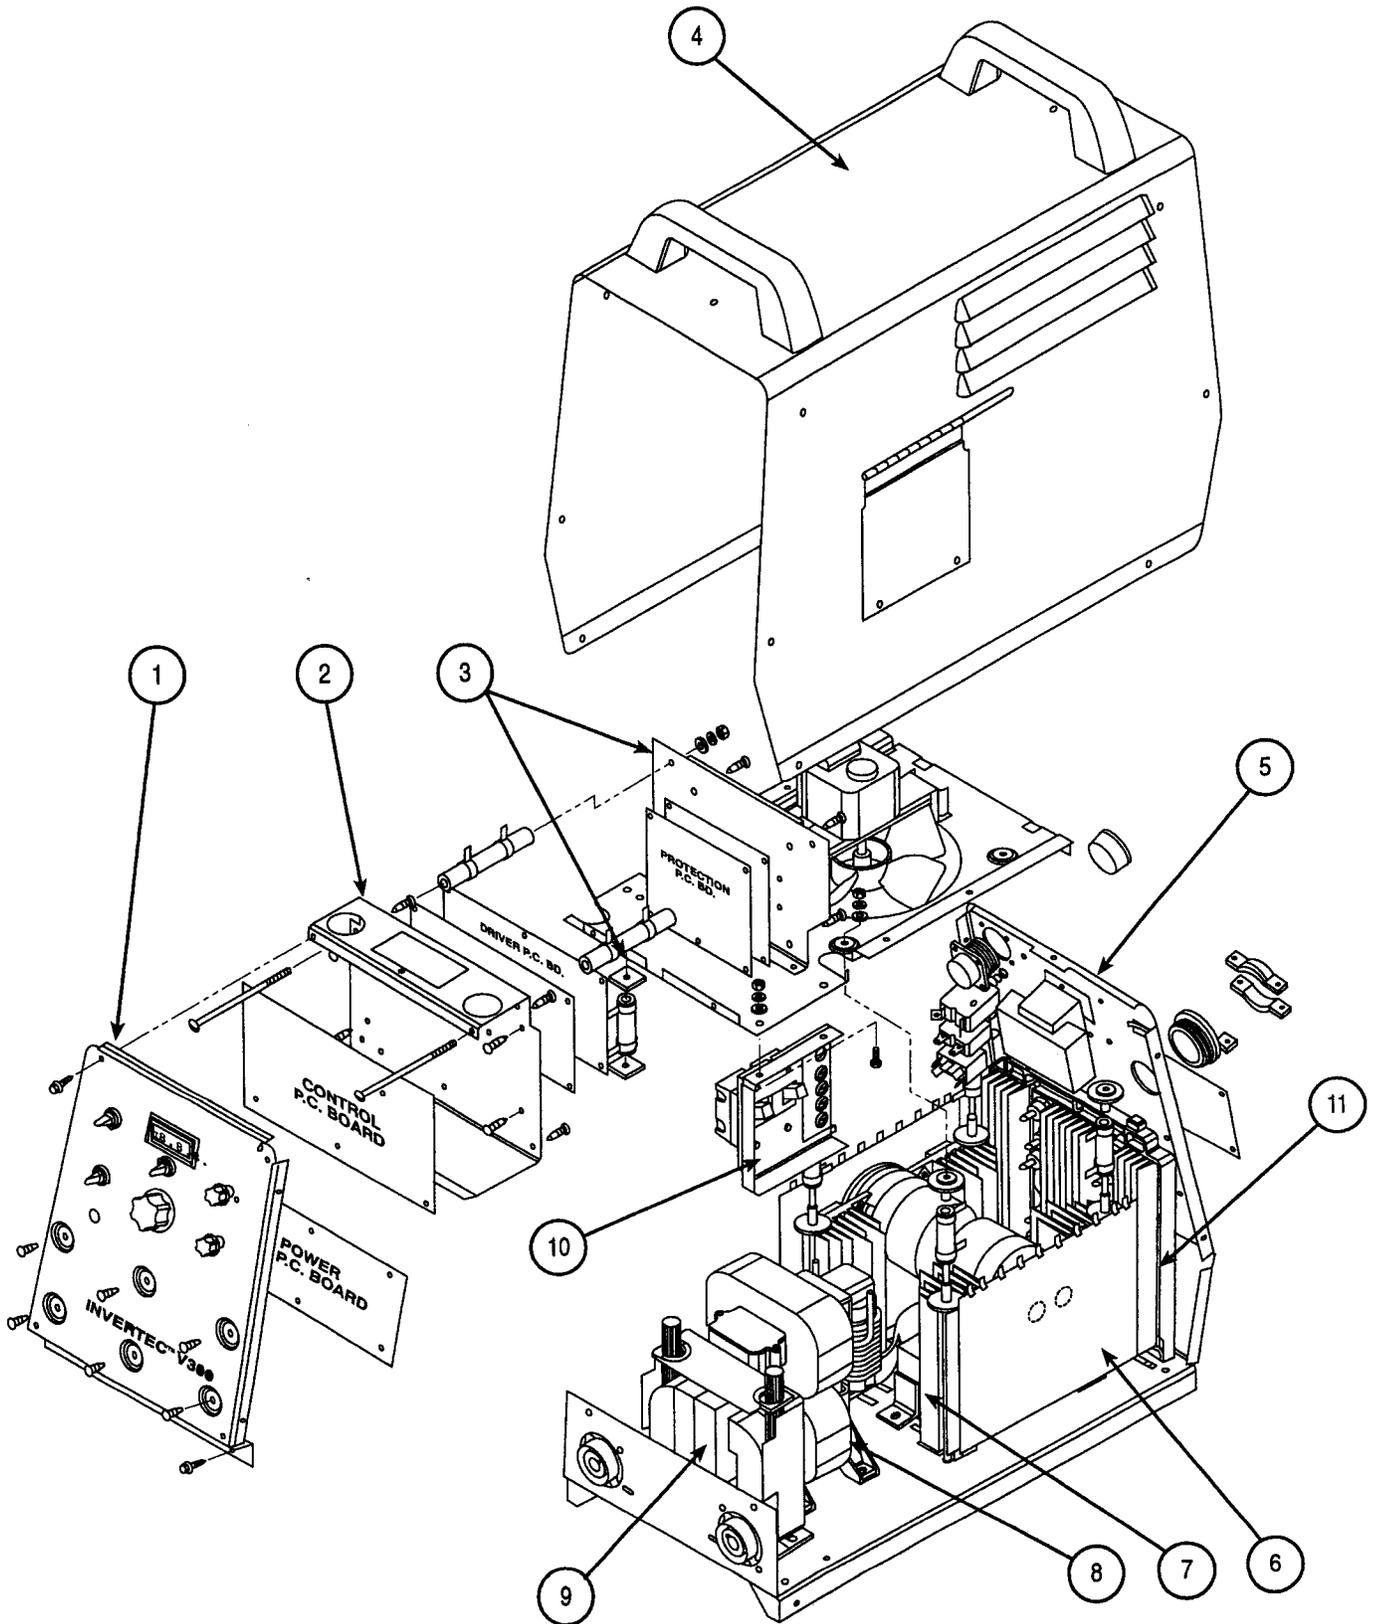

# INVERTEC

## V300-PRO & V300-I

### For Codes: 9826 to 10450

Do Not use this Parts List for a machine if its code number is not listed. Contact the Service Department for any code numbers not listed.

Use the Main Assembly drawing on the left hand page and the table below to determine which sub assembly page and column the desired part is located on for your particular code machine.

Sub Assembly Item No.			1	2	3	4	5	6	7
SUB ASSEMBLY PAGE NAME	Optional Equipment	Miscellaneous Items	Case Front Assembly	Control Box Assembly	Fan Shroud Assembly	Wrap-Around Assembly	Case Back & Bottom Assembly	FET Heat Sink Assembly #	Output Choke Assembly
PAGE NO.	P243-B.1	P243-B.2	P-243-C	P-243-D	P-243-E	P-243-F	P-243-G	P-243-H	P-243-J
CODE NO.									
9826		2	2	2	2	2	2	2	1
9827		2	2	2	2	2	2	2	1
9934		1	1	1	1	1	1	1	1
9965		1	1	1	1	1	1	1	1
10034		1	1	1	1	1	1	1	1
10035		1	1	1	1	1	1	1	1
10036		2	2	2	2	2	2	2	1
10037		2	2	2	2	2	2	2	1
10130		1	1	1	1	1	1	1	1
10131		1	1	1	1	1	1	1	1
10132		2	2	2	2	2	2	2	1
10133		2	2	2	2	2	2	2	1
10256		1	1	1	1	1	1	•	1
10257		1	1	1	1	1	1	•	1
10258		2	2	2	2	2	2	•	1
10336		2	2	2	2	2	2	2	1
10450		2	2	2	2	2	2	2	1

#

# INVERTEC

## V300-PRO & V300-I

### For Codes: 9826 to 10450

Do Not use this Parts List for a machine if its code number is not listed. Contact the Service Department for any code numbers not listed.

Use the Main Assembly drawing on the left hand page and the table below to determine which sub assembly page and column the desired part is located on for your particular code machine.

Sub Assembly Item No.	8	9	10	11	11				
SUB ASSEMBLY PAGE NAME	Main Transformer Assembly	Auxiliary Transformer Assembly	Reconnect Panel Assembly	Output Rectifier Assembly (Above Code 10200)	Output Rectifier Assembly (Below Code 10200)				
PAGE NO.	P-243-K	P-243-L	P-243-M	P-243-N	P-243-P				
CODE NO.				#	#				
9826	1	2	1	•	1				
9827	1	2	1	•	1				
9934	1	1	1	•	1				
9965	1	1	1	•	1				
10034	1	1	1	•	1				
10035	1	1	1	•	1				
10036	1	2	1	•	1				
10037	1	2	1	•	1				
10130	1	1	1	•	1				
10131	1	1	1	•	1				
10132	1	2	1	•	1				
10133	1	2	1	•	1				
10256	1	1	1	1	•				
10257	1	1	1	1	•				
10258	1	2	1	1	•				
10336	1	2	1	1	•				
10450	1	2	1	1	•				#
									#



# NOTES

---

INVERTEC V300-PRO & V300-I



# OPTIONAL EQUIPMENT LISTING

Miscellaneous Options Available for you machine are listed below:

# Indicates a change this printing.

DESCRIPTION .....	PART NUMBER
High Frequency Kit .....	.Order K799
Hand Amptrol .....	.Order K963
Cart .....	.Order K837-1
Twist Mate Cable Plug (1/0-2/0) .....	.Order K852-70
Twist Mate Cable Plug (2/0-3/0) .....	.Order K852-95
Remote Output Control .....	.Order K857
Remote Control Adapter .....	.Order K864
Universal Adapter for 14 Pin Cable Connector .....	.Order K867
Foot Amptrol .....	.Order K870
Remote Control Adapter .....	.Order K876
DC Tig Starter .....	.Order K900-1
Twist Mate Torch Adapter Kit .....	.Order K960-1
Hand Amptrol (for LA-9, LA-17 & LW-20 Tig Torches) .....	.Order K963-1
Hand Amptrol (for LA-26 & LA-18 Tig Torches) .....	.Order K963-2
Arc Start Switch .....	.Order K814

#  
#  
#  
#




# Indicates a change this printing.

Use only the parts marked "X" in the column under the heading number called for in the model index page.

\* Recommended Spare Part


ITEM	DESCRIPTION	PART NO.	QTY.	1	2	3	4	5	6	7	8	9
	Ground Screw Assembly	S18922	1	X	X							
	Primary Harness, Code 9934	G2461	1	X	•							
	Primary Harness (575 Volt) (10035, 10131, 10257)	G2703	1	X	•							#
	Primary Harness, Codes 10034, 10036, 10037, 10130, 10132, 10133, 10256, 10258	G2702	1	X	X							#
	Primary Harness, Code 10336, 10450	G3081	1	•	X							
	Secondary Harness, Codes 9826, 9934, 9965	G2360	1	X	X							
	Secondary Harness, Code 9827	G2360-1	1	•	X							
	Secondary Harness, Codes 10034, 10035, 10036, 10037	G2701	1	X	X							
	Secondary Harness, Codes 10132, 10133, 10336, 10258, 10450	G2746	1	X	X							
	Secondary Harness, Codes, 10130, 10131, 10256, 10257	G2746-1	1	X	X							#

# CASE FRONT ASSEMBLY

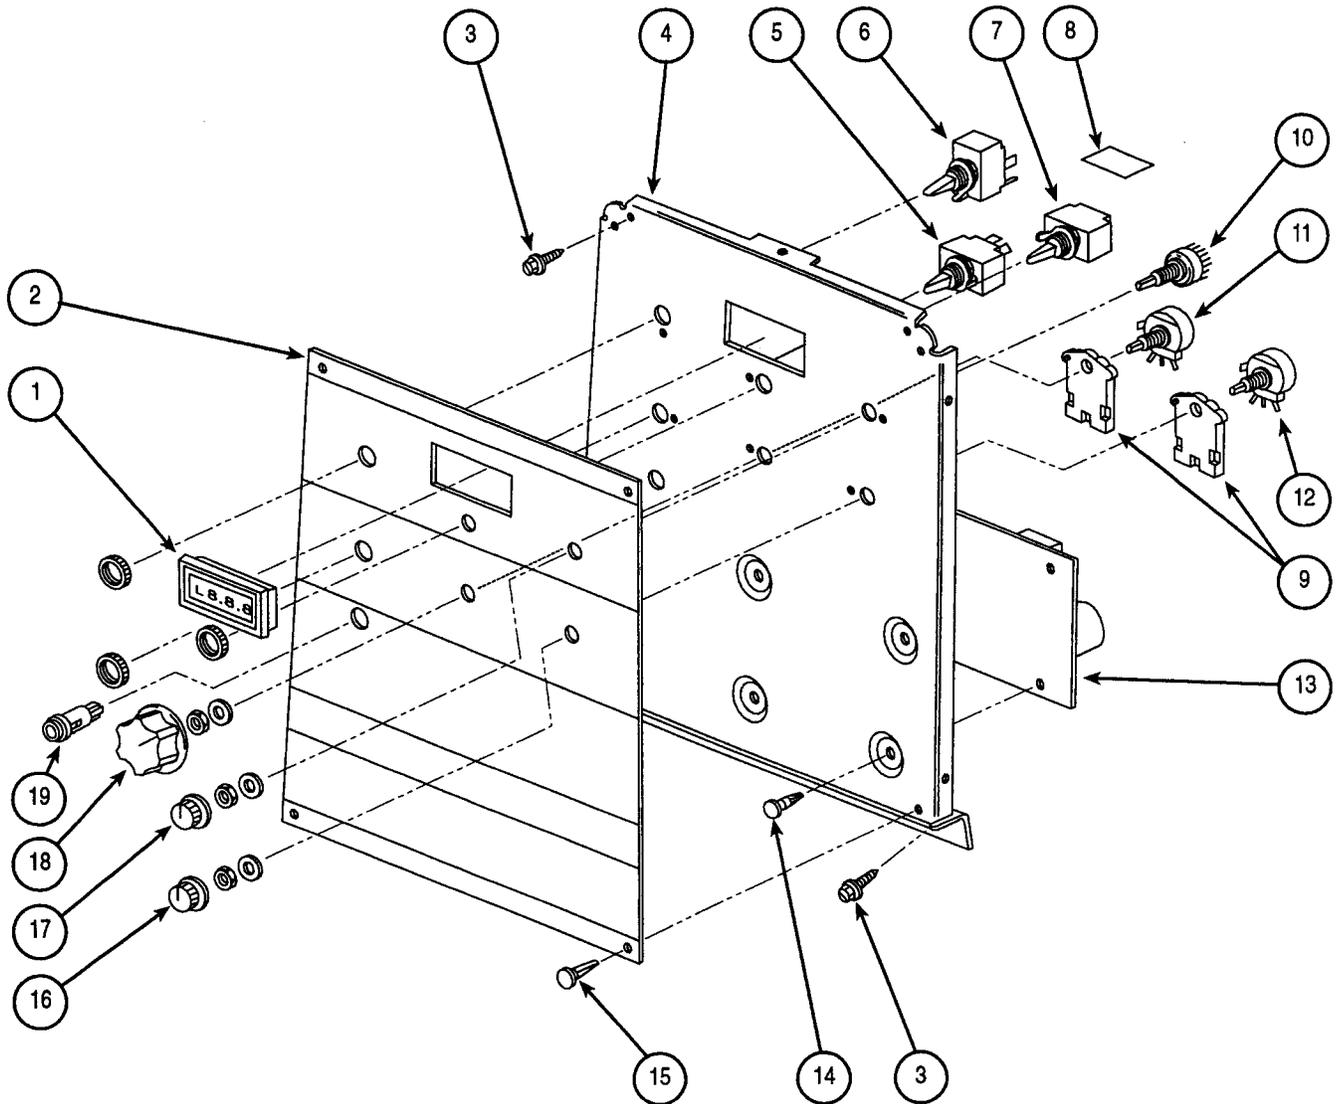



# Control Box Assembly

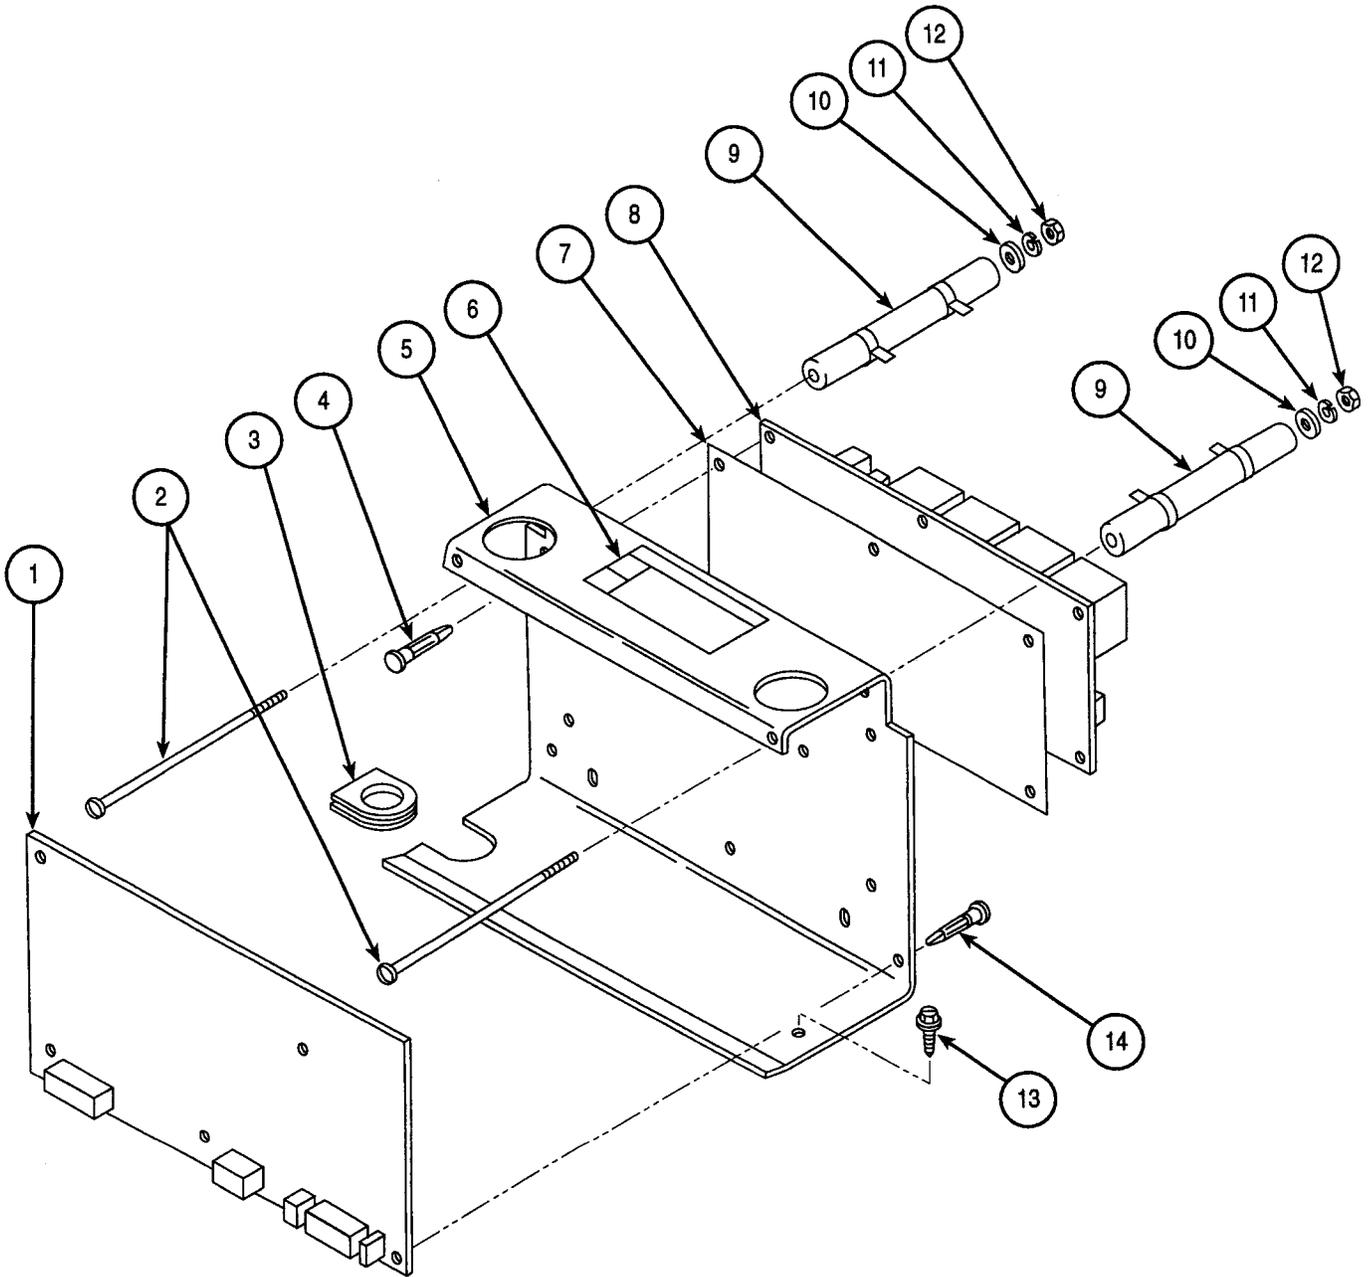

# Indicates a change this printing.

Use only the parts marked "x" in the column under the heading number called for in the model index page.


\* Recommended Spare Part

ITEM	DESCRIPTION	PART NO.	QTY.	1	2	3	4	5	6	7	8	9
1	Control Board, Codes 9965, 10035,10034,10130 9826, 9827,10036, 10037, 10132, 10133, 10336	G2527-[ ]	1	X	X							
1	Control Board, Codes 9934, 10131, 10258 (575V Machines)	G2812-[ ]	1	X	•							
2	Bleeder Resistor Mounting Screw	CF000239	2	X	X							
3	Wiring Harness Grommet	S18543-4	1	X	X							
4	Driver PC Board Supports	S19300-2	5	X	X							
5	Control Box Aluminum	L8537	1	X	X							
6	Decal	S18469	1	X	X							
7	Driver Board Insulation	S19274-3	1	X	X							
8	Driver Board Codes 9865, 9934 9826, 9827	L8660-[ ]	1	X	X							
8	Driver Board Codes 10034, 10035, 10130, 10131, 10036, 10037, 10132,10133, 10256, 10257, 10258 10336, 10450	L9134-[ ]	1	X	X							
9	Bleeder Resistor	S10404-108	2	X	X							
9	Bleeder Resistor Bracket 575 Volt Bracket	S10404-116	2	X	•							
10	Washer	S9262-27	2	X	X							
11	Lock washers	E106A-1	2	X	X							
12	Hex Nut	CF000010	2	X	X							
13	Shield Shunt Lead Ground	S8025-76	1	X	X							
14	Control Board Supports	S19300-2	5	X	X							

#

#  
#

# Fan Shroud Assembly

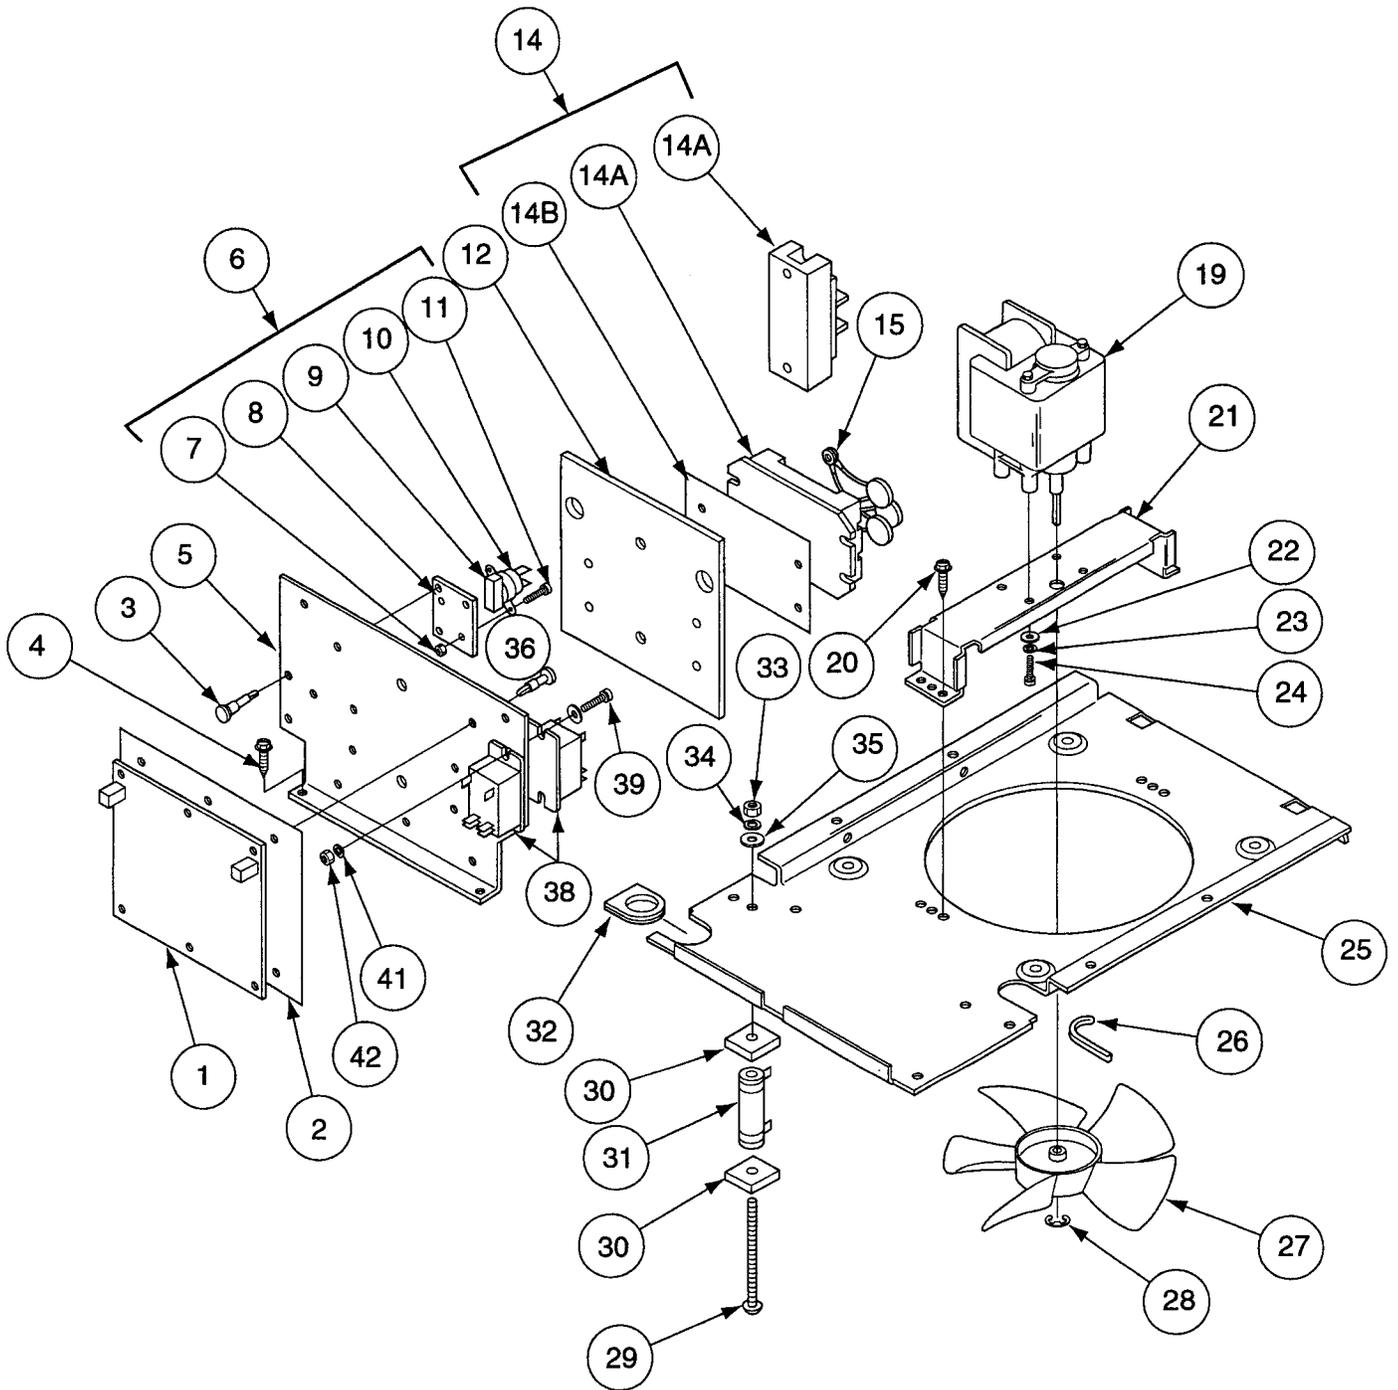

# Indicates a change this printing.


Use only the parts marked "x" in the column under the heading number called for in the model index page.

\* Recommended Spare Part

ITEM	DESCRIPTION	PART NO.	QTY.	1	2	3	4	5	6	7	8	9
1	Protection Board	L7915-[ ]	1	X	X							
2	Protection Board Insulation	S19031-1	1	X	X							
3	Mounting Tabs, (snap-in 1/2")	S19300-2	1	X	X							
4	Input Rectifier Bracket Mounting Screw (#10 slotted hex head 1/2 " long)	S8025-91	2	X	X							
5	Input Rectifier Bracket	M16644	1	X	X							
6	Fan Thermostat Assembly (includes items 7 thru 11)	S18676-2	1	X	X							
7	Hex Nut (#6-32)	CF000005	2	X	X							
8	Laminate Assembly	S18671-1	1	X	X							
9	Resistor	T14648-20	1	X	X							
10	Thermostat	T13359-15	1	X	X							
11	Thermostat Mounting Screw (#6-32 round head 3/4" long)	CF000137	2	X	X							
12	Input Rectifier Heatsink	M16714	1	X	X							
14	Rectifier Module Assembly, Includes: (2 Mounting Holes)	M17282	1	X	X							
14A	Rectifier Module	M15454-6	1	X	X							
14	Rectifier Module Assembly, Includes: (4 Mounting Holes)	M16643	1	X	X							
14A	Rectifier Module	M15454-1	1	X	X							
14B	Insulation	S18947	1	X	X							
15	MOV Assembly	S18491	1	X	X							
19	Cooling Fan Motor (Below Code 10200)	S21018	1	X	X							
19	Cooling Fan Motor (Above Code 10200)	M17235-2	1	X	X							#
20	Fan Bracket Mounting Screws (#10 slotted hex head 1/2" long)	S8025-91	4	X	X							
21	Fan Bracket (Below Code 10200)	M17212	1	X	X							
21	Fan Bracket (Above Code 10200)	M17575	1	X	X							
21A	Insulator (Above Code 10200) (Not Shown)	T11267-A	4	X	X							
21B	Insulator (Above Code 10200) (Not Shown)	T11267-B	4	X	X							
21C	Plain Washer (Above Code 10200) (Not Shown)	S9262-98	4	X	X							
21D	Lock Washer (Above Code 10200) (Not Shown)	E106A-2	4	X	X							
21E	1/4-20 x 1.25 Hex Head Cap Screw (Above Code 10200) (Not Shown)	CF000069	4	X	X							
22	Washer	S9262-3	2	X	X							
23	Lock washers	T4291-A	2	X	X							
24	Fan Mounting Hex Nut (#8-32 hex nut)	CF000042	2	X	X							
25	Fan Shroud (Below Code 10200)	G2306	1	X	X							#
25	Fan Shroud & Rivnut Assembly (Above Code 10200)	S22904	1	X	X							
25	Fan Shroud (Code 10450)	G3069	1	•	X							
26	Wiring Harness Protector	T12823-11	1	X	X							
27	Fan Blade (Below Code 10200)	M15843	1	X	X							#
27	Fan Blade (Above Code 10200)	M15843-2	1	X	X							#
28	Fan Blade Retaining Ring (Below Code 10200)	S9776-58	1	X	X							#
29	Resistor Mounting Screw (#10-24 round head 3" long)	CF000009	1	X	X							
30	Resistor Insulator	T4479-A	2	X	X							
31	Resistor	S10404-76	1	X	X							
32	Grommet	S18543-4	1	X	X							
33	Hex Nut (#10-24)	CF000010	1	X	X							
34	Lock washers	E106A-1	1	X	X							
35	Washer	S9262-27	1	X	X							
36	PC Board Mounting Tabs	S19300-2	5	X	X							
38	DC Relay	S14293-17	2	X	X							
39	#6-32-50 Round Head Screw	CF000004	2	X	X							
41	Lock washers	E106A-13	2	X	X							
42	#6-32 Hex Nut	CF000005	2	X	X							
43	Switch Board Barrier (Code 10450)	S23891	1	•	X							



# Wrap-Around Assembly

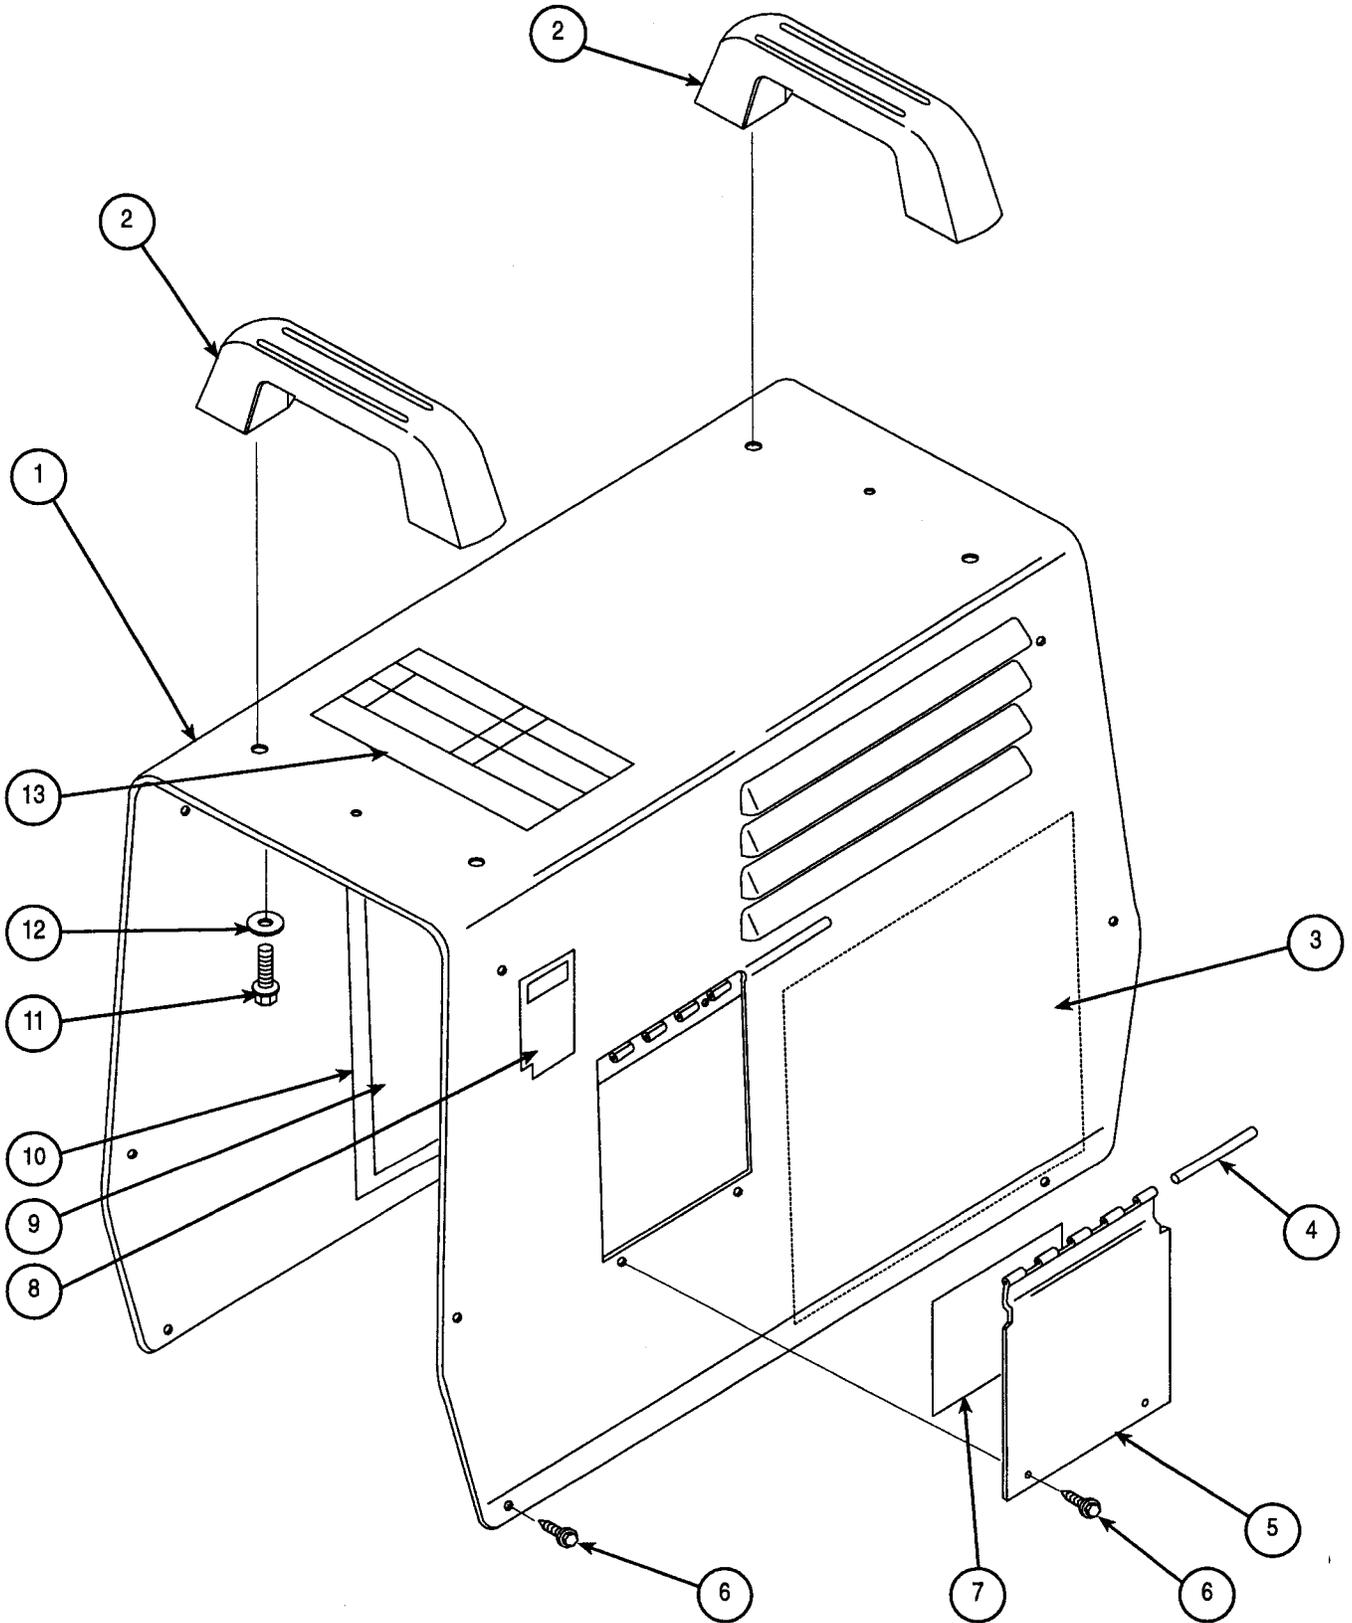

# Indicates a change this printing.


Use only the parts marked "x" in the column under the heading number called for in the model index page.

\* Recommended Spare Part

ITEM	DESCRIPTION	PART NO.	QTY.	1	2	3	4	5	6	7	8	9
	Wrap-Around Assembly, Code 9934	L8613-4	1	X	•							
	Wrap-Around Assembly, Code 9965	L8613-1	1	X	•							
	Wrap-Around Assembly, Code 10034	L8613-8	1	X	•							
	Wrap-Around Assembly, Code 10035	L8613-11	1	X	•							
	Wrap-Around Assembly, Code 10130, 10256	L9566-1	1	X	•							#
	Wrap-Around Assembly, Code 10131, 10257	L9566-4	1	X	•							#
	Wrap-Around Assembly, Code 9826	L8613-2	1	•	X							
	Wrap-Around Assembly, Code 9827	L8613-3	1	•	X							
	Wrap-Around Assembly, Code 10036	L8613-9	1	•	X							
	Wrap-Around Assembly, Code 10037	L8613-10	1	•	X							
	Wrap-Around Assembly, Code 10132, 10258	L9566-2	1	•	X							#
	Wrap-Around Assembly, Code 10133	L9566-3	1	•	X							
	Wrap-Around Assembly, Code 10336, 10450	L9566-9	1	•	X							#
1	Wrap-Around Sheet Metal	G2304	1	X	X							
2	Carrying Handles	M15446	2	X	X							
3	Insulation, 9"x 9" .010" thick	CI001191	1	X	X							
4	Reconnect Panel Door Pin	M8809-133	1	X	X							
5	Reconnect Panel Door	M16642	1	X	X							
6	Wrap-Around Mounting and Reconnect Panel Door Screws	S8025-91	16	X	X							
7	Print (Reconnect Instructions)	S20324	1	X	X							
8	Decal (3-year warranty)	S19633-1	1	X	X							
9	Wiring Diagram Print, Code 9965	L8657	1	X	•							
	Wiring Diagram Print, Code 9934	L8841	1	X	•							
	Wiring Diagram Print, Code 10034	L9299	1	X	•							
	Wiring Diagram Print, Code 10035	L9301	1	X	•							
	Wiring Diagram Print, Code 10130	L9567	1	X	•							
	Wiring Diagram Print, Code 10131	L9569	1	X	•							
	Wiring Diagram (Code 10256, 10257)	L10189	1	X	•							#
	Wiring Diagram Print, Code 9826	L8657	1	•	X							
	Wiring Diagram Print, Code 9827	L8938	1	•	X							
	Wiring Diagram Print, Code 10036	L9299	1	•	X							
	Wiring Diagram Print, Code 10037	L9300	1	•	X							
	Wiring Diagram Print, Code 10132	L9567	1	•	X							
	Wiring Diagram Print, Code 10133	L9568	1	•	X							
	Wiring Diagram (Code 10258)	L10191	1	•	X							#
	Wiring Diagram (Code 10336, 10450)	L10250	1	•	X							#
10	Insulation, 9"x 12 x .010" thick	CI001190	1	X	X							
11	Screw (Mounts Handle)	S9225-53	4	X	X							
12	Washer	S9262-53	4	X	X							
13	Warning Decal	L8064-1	1	X	X							



# Case Back and Bottom Assembly

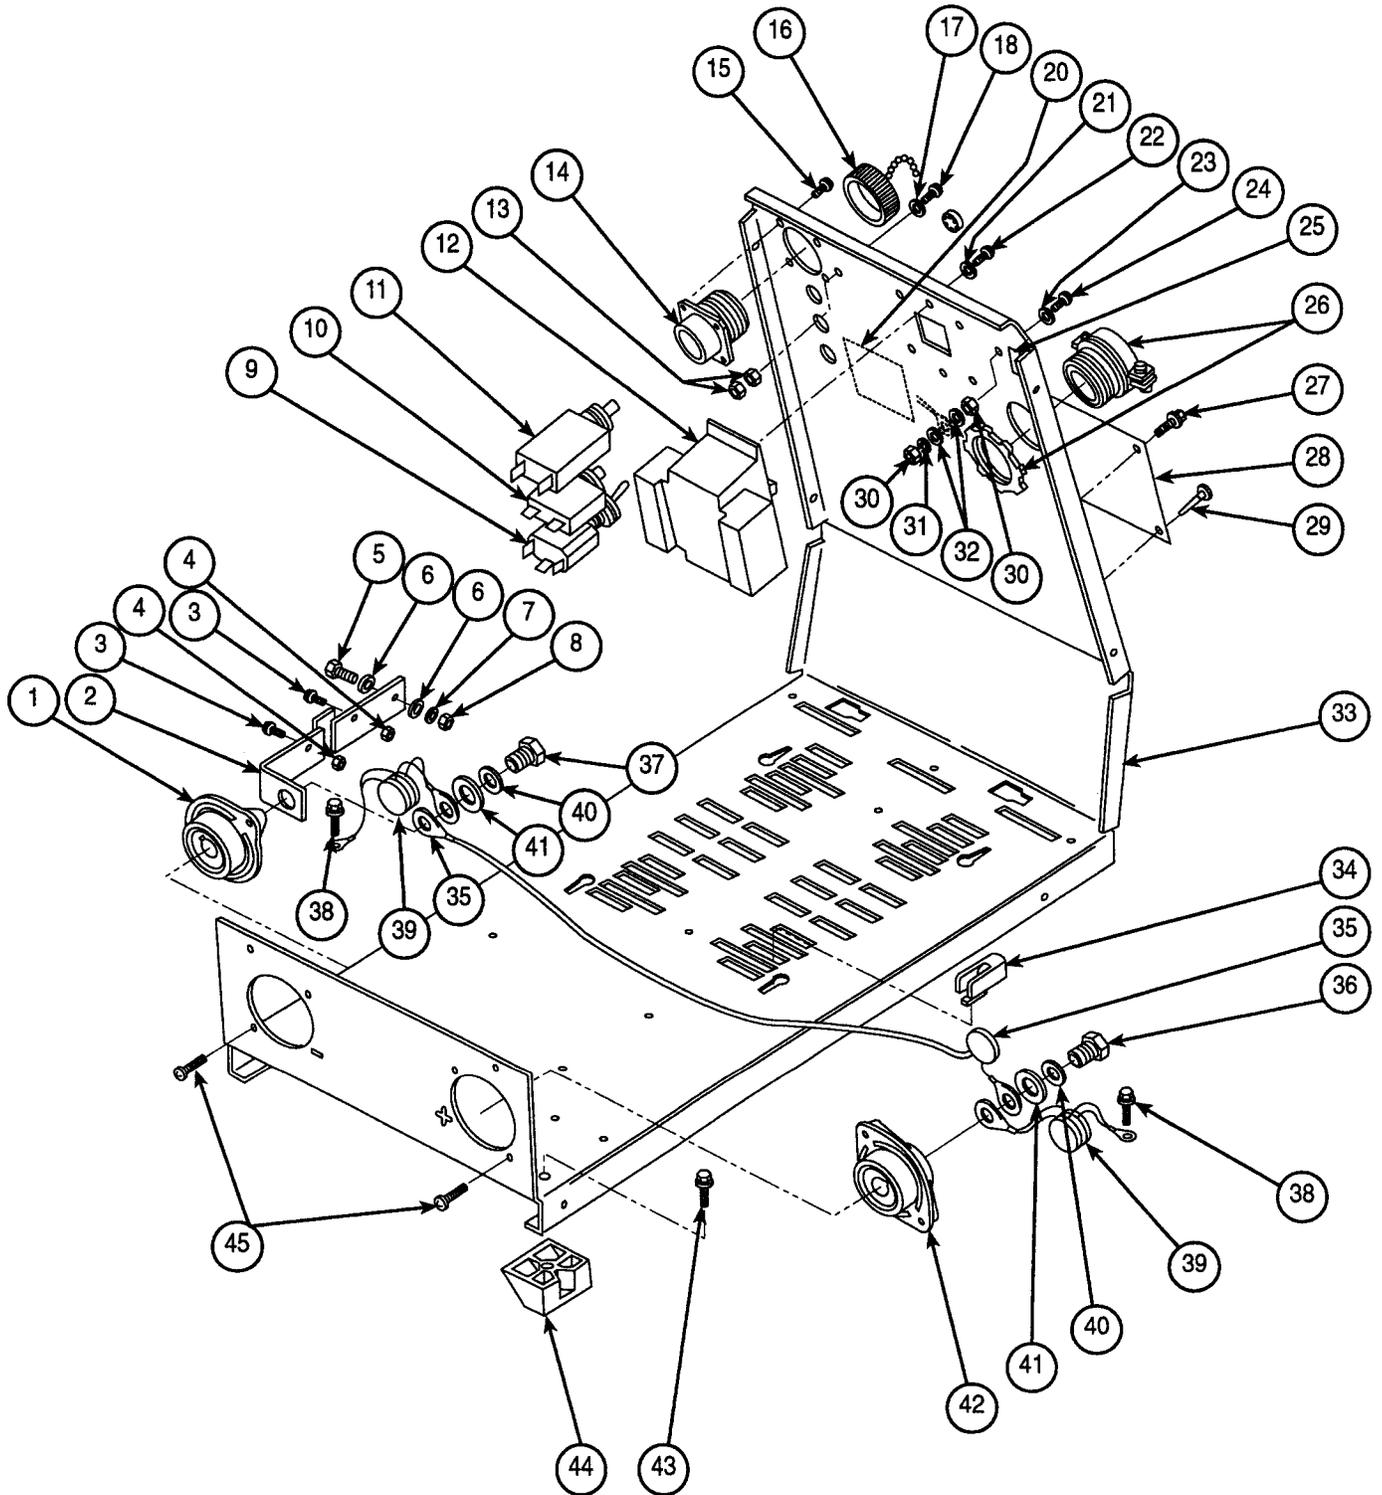

# Indicates a change this printing.

Use only the parts marked "x" in the column under the heading number called for in the model index page.

\* Recommended Spare Part

ITEM	DESCRIPTION	PART NO.	QTY.	1	2	3	4	5	6	7	8	9	
1	Negative Output Receptacle (Above Code 10300)	M15859-8	1	X	X								#
1	Negative Output Receptacle (Below Code 10300)	M15859-6	1	X	X								#
	Shunt Assembly, (Below Code 10300)	S20039-1	1	X	X								#
	Shunt Assembly, (Above Code 10300)	S20039-3	1	X	X								#
3	Screw, shunt lead mounting screw, Pan Head #10-24x .38 long	T10082-4	2	X	X								
4	Hex Nut, #10-24	CF000010	2	X	X								
5	Screw, 1/4-20 Hex Head 3/4" Long	CF000014	1	X	X								
6	Washer	S9262-98	2	X	X								
7	Lock Washer, Kantink Type	E106A-2	1	X	X								
8	Hex Nut, 1/4-20	CF000017	1	X	X								
9	Wire Feeder Voltmeter Polarity Switch	T13562	1	X	X								
10	110/115 Vac Auxiliary Output Circuit Breaker, 250 Vac	T12287-14	1	X	X								
11	42 Vac Auxiliary Output Circuit Breaker, 250 Vac	T12287-1	1	X	X								
12	Line Switch, 3 PST, 600V., 60A (S1)	S20030-1	1	X	X								
13	Hex Nut, #10-24	CF000010	2	X	X								
14	Remote Connector	S12021-40	1	X	X								
15	Remote Connector Mounting Screw, Phillips Head #6 3/8" long	S8025-73	4	X	X								
16	Remote Connector Screw-on Cap	S17062-3	1	X	X								
17	Lock Washer	T9695-1	1	X	X								
18	Remote Harness Ground	S9225-36	1	X	X								
20	Decal, Wire Feeder Voltmeter Polarity Switch	T13086-84	1	X	X								
21	Line Switch Lock Washer	T9695-1	2	X	X								
22	Line Switch Mounting Screw, #10-32 Round Head 1/2" long	CF000254	2	X	X								
23	Lock Washer	T9695-1	1	X	X								
24	Grounding Screw, Phillips Head #10-24 x 3/4 long	S9225-36	1	X	X								
25	Decal, Earth Ground	T13260-4	1	X	X								
26	Box Connector, 1-11 1/2" Pipe Thread	T9639-3	1	X	X								
26	Cord Grip Connector (Code 10450)	S19999	1	•	X								#
26A	Input Lead Assembly (Not Shown)	S18573-2	1	X	•								#
27	Mounting Screw	S8025-91	2	X	X								#
28	Rear Nameplate, Codes 9965, 10034, 10130, 10256	S20586	1	X	•								#
28	Rear Nameplate, Codes 9934, 10035, 10131, 10257	S20480	1	X	•								#
28	Rear Nameplate, Codes 9826, 10036, 10132, 10258, 10450	S20214	1	•	X								#
28	Rear Nameplate, Codes 9827, 10037, 10133	S20479	1	•	X								#
29	Nameplate Fastener Button	T14659-1	2	X	X								
30	Hex Head, #10-24	CF000010	2	X	X								
31	Lock Washer, Kantink Type	E106A-1	1	X	X								
32	Washer	S9262-27	2	X	X								
33	Case Back And Bottom (Below Code 10300)	G2303	1	X	X								
33	Case Back And Bottom (Above Code 10300)	G3082	1	X	X								#
34	Fet HeatSink Assembly, Mounting Spacer	S19207	4	X	X								
35	MOV Assembly, 150V RMS, 80J, 20mm	S19457-1	1	X	X								
36	Lug Screw, 1/2"-13 Hex Head Cap 1/2" long	CF000021	1	X	X								
37	Lug Screw, 1/2"-13 Hex Head Cap 3/4" long	CF000020	1	X	X								
38	MOV Assembly and Supressor Mounting Screw, Hex Head Slotted #8 3/8" long	S8025-76	2	X	X								
39	Suppressor Assembly, Capacitor CD .05uf, 600Volt +80/-20% MOV 150 VRMS, 80J, 20mm	S18858	2	X	X								
40	Lock Washer, Kantink Type	E106A-15	2	X	X								



# Indicates a change this printing.

Use only the parts marked "x" in the column under the heading number called for in the model index page.

\* Recommended Spare Part

ITEM	DESCRIPTION	PART NO.	QTY.	1	2	3	4	5	6	7	8	9
41	Washer, 16GA 1/2" ID, 1"OD	S9262-1	2	X	X							
42	Positive Output Receptacle (Below Code 10300)	M15859-3	1	X	X							
42	Positive Output Receptacle (Above Code 10300)	M15859-7	1	X	X							
43	Foot Mounting Screws, 1/4"-20 Hex Head 1/2" long	S9225-8	4	X	X							
44	Foot	M15849	4	X	X							
45	Negative And Positive Output Receptacle Mounting Screws	S9225-63	4	X	X							
46A	Power Line Filter Assembly, Includes: (Above Code 10300) (Not Shown)	M18281-2	1	•	X							
	Power Line Filter (Above Code 10300) (Not Shown)	M18185-1	1	•	X							
46B	Self Tapping Screw (Above Code 10300) (Not Shown)	S8025-12	4	•	X							
47A	Power Line Filter Cover (Above Code 10300) (Not Shown)	M18162	1	•	X							
47B	Self Tapping Screw (Above Code 10300) (Not Shown)	S8025-12	4	•	X							
47C	Sems Screw (Above Code 10300) (Not Shown)	T10082-3	2	•	X							
47D	Lock Washer (Above Code 10300) (Not Shown)	E106A-1	2	•	X							
47E	#10-24 Hex Nut (Above Code 10300) (Not Shown)	CF000010	2	•	X							
48A	Support Angle, (Not Shown) (Attach transformer leads to bracket)	S19448	1	X	X							
48B	Self Tapping Screw (Not Shown) (Mounts support angle to base)	S8025-70	2	X	X							

#

#  
#  
#  
#


# NOTES

---

INVERTEC V300-PRO & V300-I



# FET HEATSINK ASSEMBLY

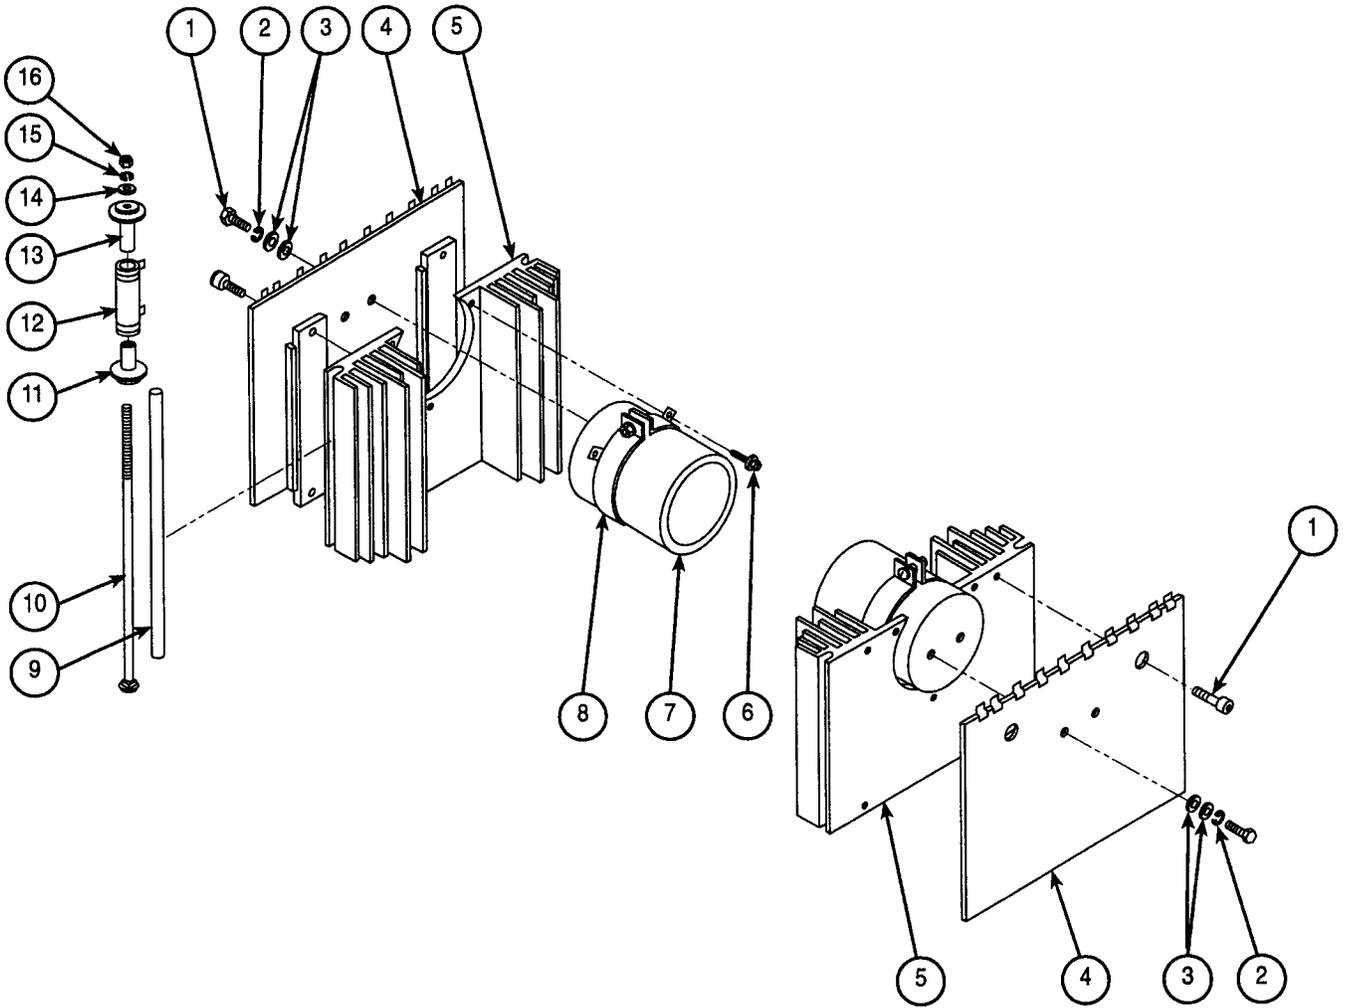


# Indicates a change this printing.

Use only the parts marked "x" in the column under the heading number called for in the model index page.

\* Recommended Spare Part

ITEM	DESCRIPTION	PART NO.	QTY.	1	2	3	4	5	6	7	8	9	
1	Mounting Screw, 14"20, 1/2" long Socket Head Cap Screw (4 required per assembly)	T9447-28	8	X	X								
2	Lock Washer, 1/4" Kantink type	E106A-2	4	X	X								
3	Washer, 0.30" ID 0.56"OD .043 thick Stl (4 required per capacitor)	S9262-23	8	X	X								
4	Switch Board Assembly	L8441-[ ]	2	X	X								
4	Switch Board Assembly (Codes 9934,10034,575V.)	L8982-[ ]	2	X	•								#
	Fet Heatsink Assembly, Includes:	M16635	2	X	X								#
	Fet Heatsink Assembly, Includes: (575 Volt) (Items 4, 5, 18, 19)	M16834	2	X	•								#
5	FET Heatsink	L8605	2	X	X								
5	FET Heatsink (Codes 9934, 10131, 10257,575V.)	L8605-1	2	X	•								#
5A	Screw (Codes 9934, 10131,575V.)	S8025-76	8	X	•								
5B	Heat Sink Bracket	S20522	4	X	•								
6	Heat Sink Mounting Screws (3 required per assembly, #8 slotted hex head 3/8" long)	S8025-7	6	X	•								#
6	Heat Sink Mounting Screws (Codes 9934, 10131, 10257,575V)	S8025-87	8	X	•								#
7	Capacitor Assembly (1/4"-28 Hex Head Cap Screw 5/8 long included)	S19221-1	2	X	X								#
7	Capacitor Assembly (Codes 9934, 10131,10257,575V)	S19221-2	2	X	•								#
8	Capacitor Bracket	S18434-1	2	X	X								#
8	Capacitor Bracket (Codes 9934, 10131, 10257, 575V)	S18434-3	2	X	X								#
9	Mounting Bolt Slewing	CS001317	4	X	X								#
10	FET Assembly Mounting Bolts (2 required per assembly #10-24 8"long)	T11827-47	4	X	X								#
11	Resistor Molded Insulator (bottom)	S20005-1	4	X	X								#
12	Switch Board Resistors, 25 OHM 25W 10% (R4, R5, R6, R7)	S10404-114	4	X	X								#
13	Resistor Molded Insulator (top)	S200005	4	X	X								#
14	Washer, 0.218"ID 0.50"OD .052" thick STL	S9262-27	4	X	X								#
15	Lock Washer, #10 Kantlink type	E106A-1	4	X	X								#
16	Hex Nut, #10-24	CF000010	4	X	X								#

# OUTPUT CHOKE ASSEMBLY

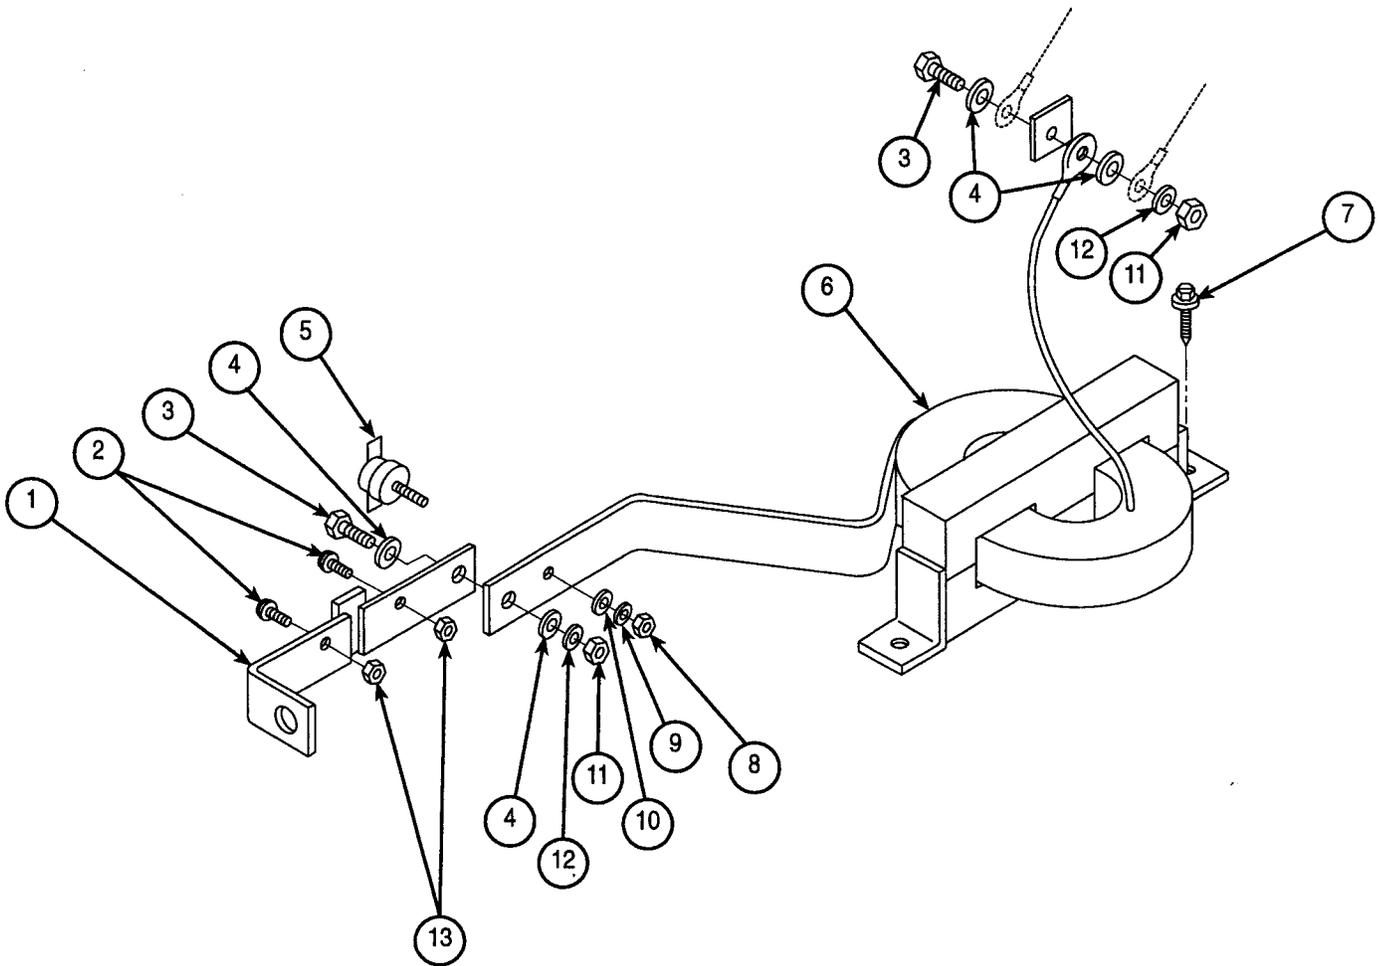

# Indicates a change this printing.

Use only the parts marked "x" in the column under the heading number called for in the model index page.


\* Recommended Spare Part

ITEM	DESCRIPTION	PART NO.	QTY.	1	2	3	4	5	6	7	8	9
1	Shunt Assembly (Below Code 10300)	S20039-1	1	X								
1	Shunt Assembly (Above Code 10300)	S20039-3	1	X								
2	Screw, shunt lead mounting	T10082-4	2	X								
3	Screw, 1/4"-20 Hex Head Cap 3/4" long	CF000014	2	X								
4	Washer	S9262-98	4	X								
5	Thermostat Assembly, contacts open 203°F, contacts close 143°F	T13359-4	1	X								
5	Thermostat Assembly, (Code 10450)	T13359-2	1	X								
6	Choke Assembly	M16637	1	X								
6	Choke Assembly (Code 10256, 10257, 10258)	M16637-1	1	X								
7	Mounting Screw, 1/4"-20 Slotted Hex Head 1/2 long	S9225-8	2	X								
8	Hex Nut, #6-32	CF000005	1	X								
9	Washer, #6 Kantlink type	E106A-13	1	X								
10	Washer, 17"ID .38"OD .033" thick STL	S9262-3	1	X								
11	Nut, 1/4"-20	CF000017	2	X								
12	Lock Washer, 1/4" Kantlink type	E106A-2	4	X								
13	Hex Nut, #10-24	CF000010	2	X								

#  
#  
#  
#




# MAIN TRANSFORMER ASSEMBLY

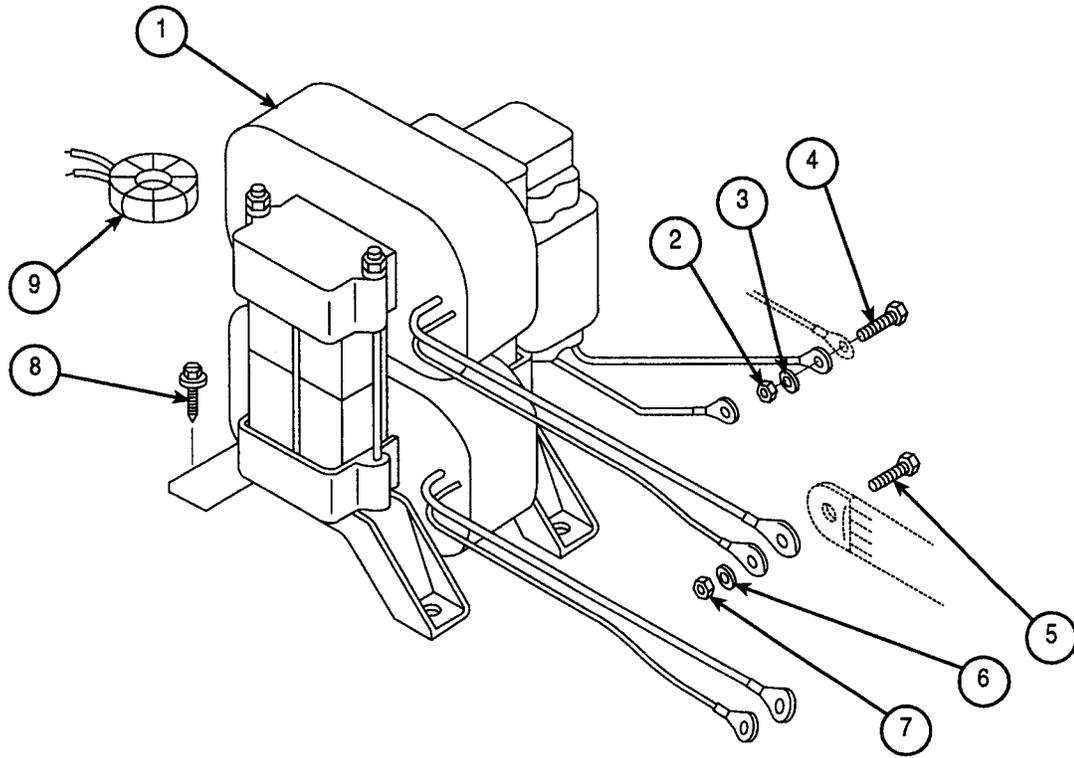



# AUXILIARY TRANSFORMER ASSEMBLY

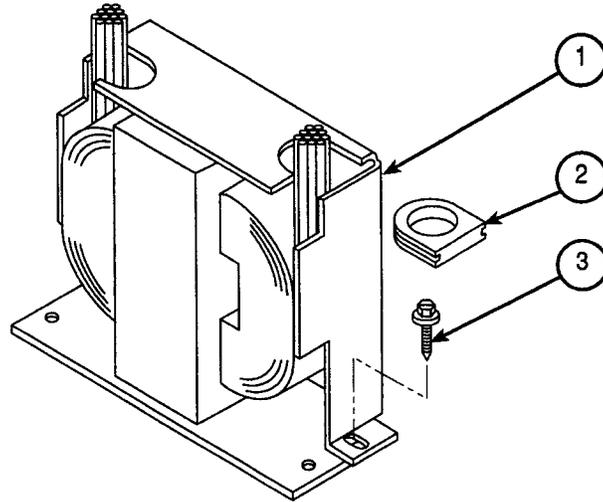

# Indicates a change this printing.


Use only the parts marked "x" in the column under the heading number called for in the model index page.

\* Recommended Spare Part

ITEM	DESCRIPTION	PART NO.	QTY.	1	2	3	4	5	6	7	8	9	
	Auxiliary Transformer Assembly, Codes 9826, 9965, 10034, 10036, 10130, 10132, 10256, and 10258	L8496	1	X									#
	Auxiliary Transformer Assembly, Codes 9827, 9934, 10035, 10037, 10131, and 10257	L8496-1	1	X									#
	Auxiliary Transformer Assembly, Codes 10037, 10133, 10259, 10336, 10450	L8496-3	1	X									#
1	Auxiliary Transformer Bracket	M16532-1	1	X									
2	Cable Grommet	S18543-4	1	X									
3	Mounting Screw, 1/4"-20 Slotted Hex Head 1/2" long	S9225-8	4	X									



# RECONNECT PANEL ASSEMBLY

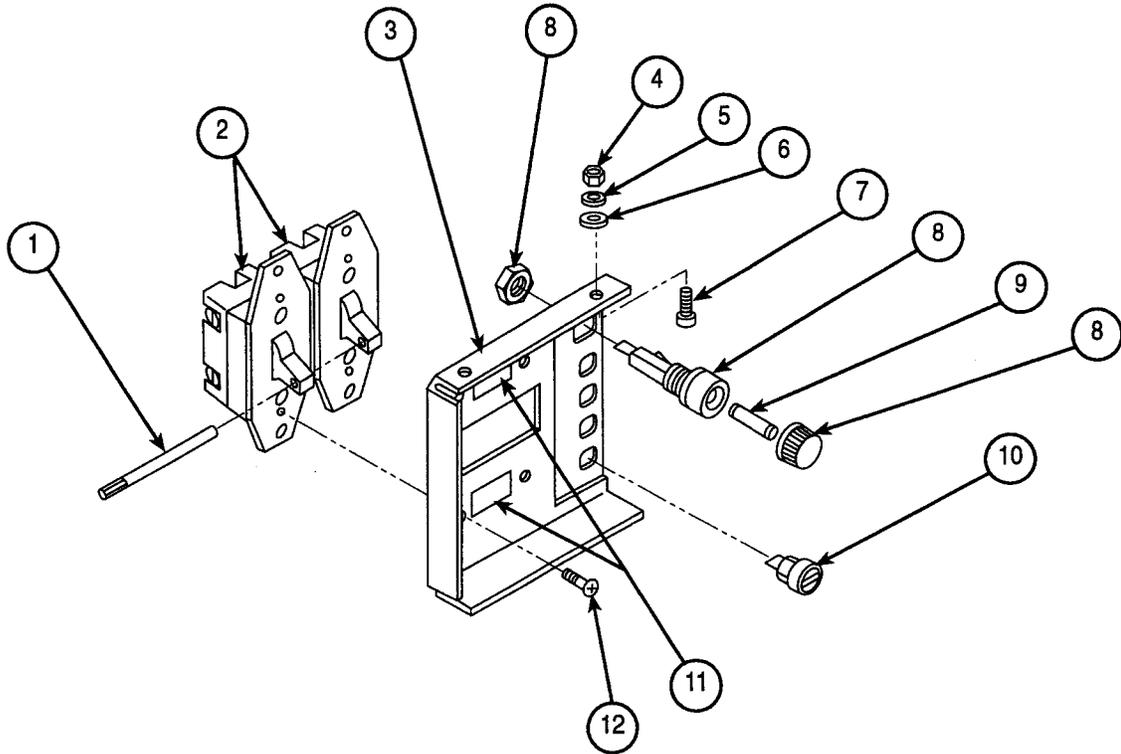

# Indicates a change this printing.




Use only the parts marked "x" in the column under the heading number called for in the model index page.

\* Recommended Spare Part

ITEM	DESCRIPTION	PART NO.	QTY.	1	2	3	4	5	6	7	8	9
	Reconnect Panel Assembly, Includes:											
1	Switch Pin	S20322	1	X								
2	Reconnect Switch	S20456	2	X								
3	Reconnect Panel Mounting	M16716A	1	X								
4	Hex Nut, #10-24	CF000010	2	X								
5	Lock Washer, #10 kantlink type	E106A-1	2	X								
6	Washer, 0.218"ID 0.500"STL	S9262-27	2	X								
7	Reconnect Panel Mounting Screw	T10082-3	2	X								
8	Fuse Holder, 250A 15A	S10433-1	1	X								
9	Fuse, 250V slow blow 3A	T10728-41	1	X								
10	Receptacle	T14530-1	4	X								
11	Label	S15994	2	X								
12	Reconnect Switch Mounting Screw, Phillips Head #8 3/4" long	S8025-73	1	X								



# Output Rectifier Assembly (Above Code 10200)

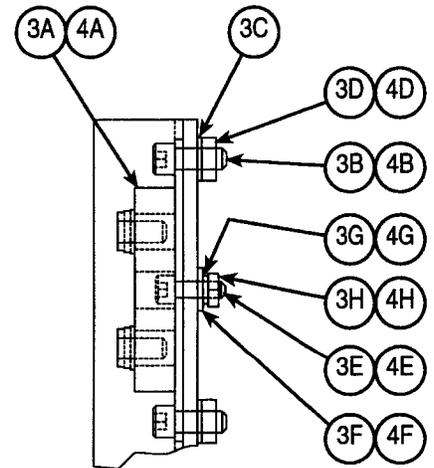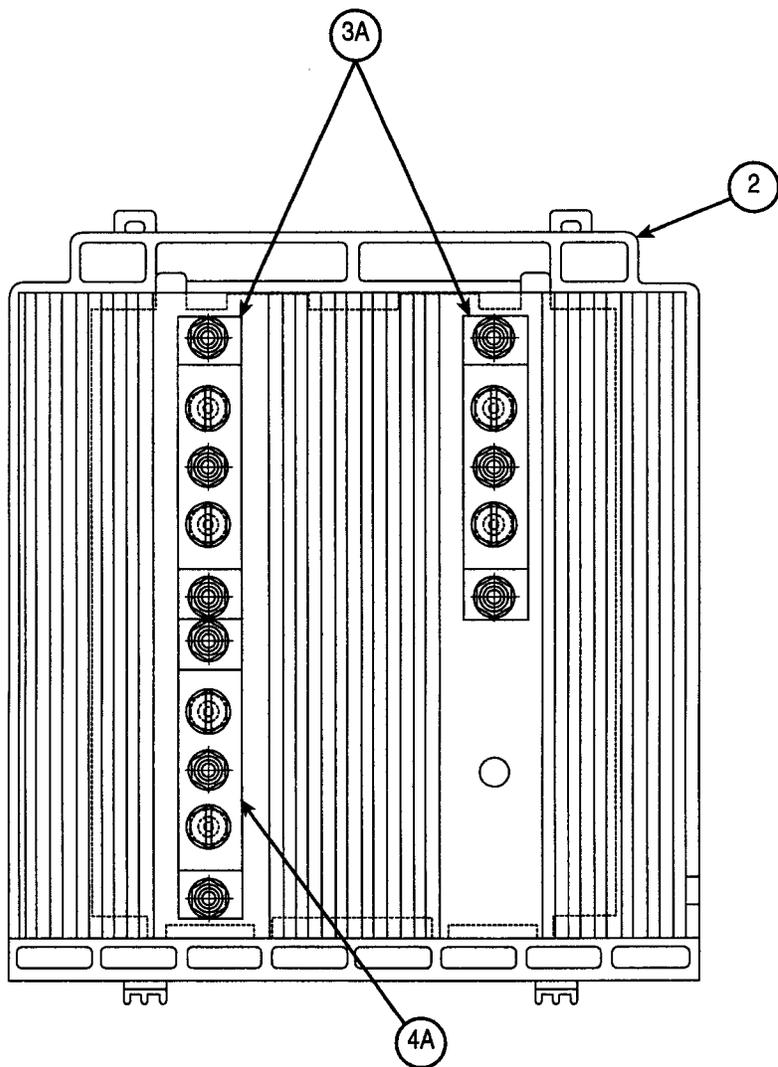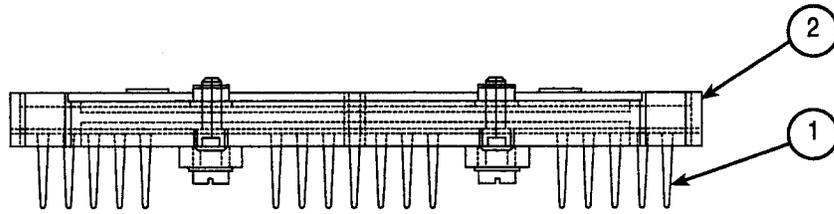

# Indicates a change this printing.

Use only the parts marked "x" in the column under the heading number called for in the model index page.


\* Recommended Spare Part

ITEM	DESCRIPTION	PART NO.	QTY.	1	2	3	4	5	6	7	8	9
1	Heatsink Machining	L10188	1	X								
2	Mounting Bracket	L8013	1	X								
3A	Diode Module	M15454-11	2	X								
3B	Socket Head Cap Screw	T9447-9	4	X								
3C	Spring Washer	T12735-4	4	X								
3D	1/4 x 20 Hex Nut	CF000017	4	X								
3E	10-24 x .625 Round Head Screw	CF000080	2	X								
3F	Plain Washer	S9262-27	2	X								
3G	Lock Washer	E106A-1	2	X								
3H	#10-24 Hex Nut	CF000010	2	X								
4A	Diode Module	M15454-10	1	X								
4B	Socket Head Cap Screw	T9447-7	2	X								
4C	Plain Washer (Not Shown)	S9262-98	2	X								
4D	1/4 x 20 Hex Nut	CF000017	2	X								
4E	#10-24 x .625 Round Head Screw	CF000080	1	X								
4F	Plain Washer	S9262-27	1	X								
4G	Lock Washer	E106A-1	1	X								
4H	#10-24 Hex Nut	CF000010	1	X								



# Output Rectifier Assembly (Below Code 10200)

#

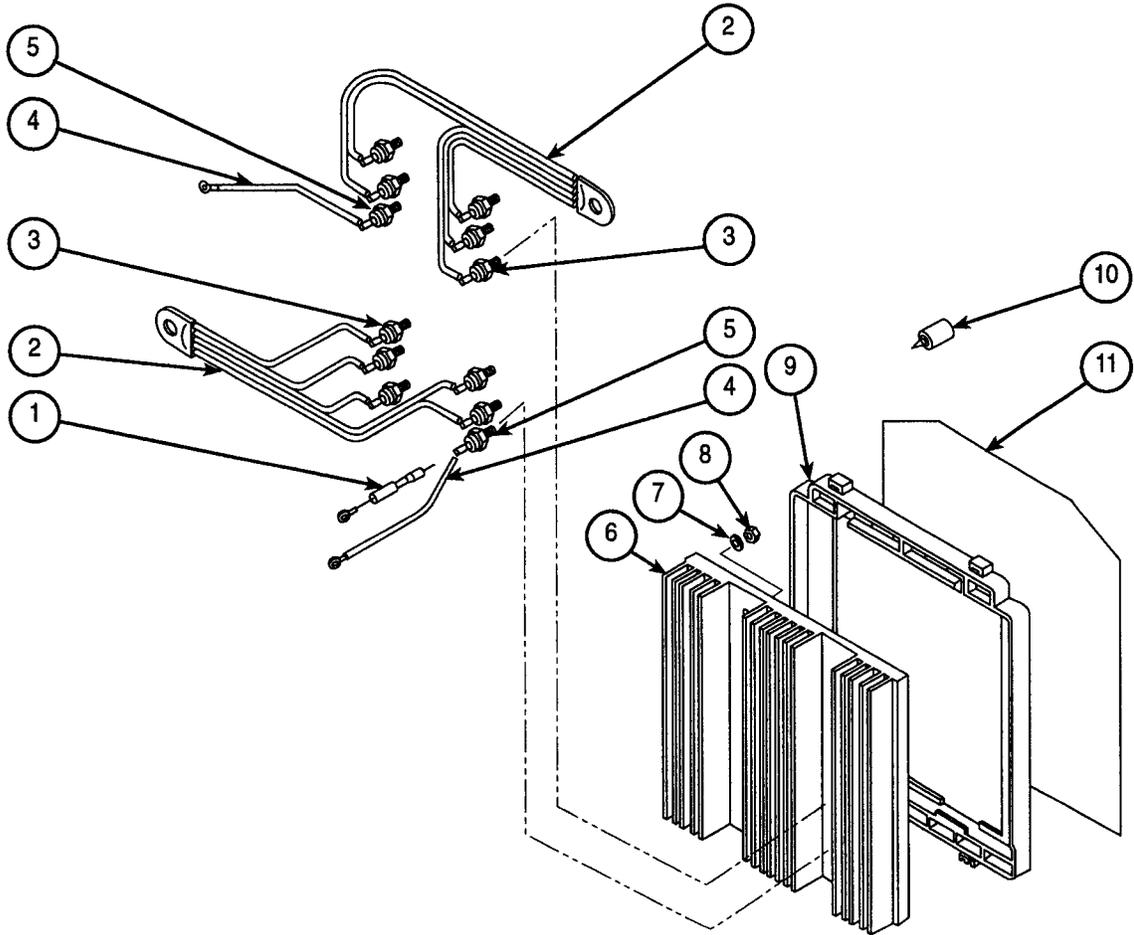

# Indicates a change this printing.

Use only the parts marked "x" in the column under the heading number called for in the model index page.

\* Recommended Spare Part

ITEM	DESCRIPTION	PART NO.	QTY.	1	2	3	4	5	6	7	8	9
1	Snubber Assembly, Resistor CC, 2W,10Ω, 10%PEF, .001uf, 10% (R13, C7; R3, C4; R2, C3; R10,C8)	S19030-3	4	X								
2	Main Output Rectifier Lead Assembly	S20035-1	1	X								
3	Diode, 85A 600V anode stud (D1, D2,D3,D5,D7,D8, D9, D10,D11) (5 required per assembly)(includes item 15)	M15482-2	5	X								
4	Output Rectifier Lead Assembly	CL009680	1	X								
5	Diode, 85A 600V anode stud (D6,D12) (includes item 15)	M15482-2	1	X								
6	Diode Heatsink	M15999	1	X								
7	Spring Washer, 255" ID .%00" OD	T12735-4	5	X								
8	Hex Nut, 1/4"-28	CF000198	1	X								
9	Diode Heat Sink Mounting Bracket	L8013	1	X								
10	Joint Compound, 2 gram pipette (included with items 8 and 10)	T12837	1	X								
11	Diode Heatsink Insulation	S19248	1	X								

# NOTES

NOTES

<b>WARNING</b>	<ul style="list-style-type: none"> <li>● Do not touch electrically live parts or electrode with skin or wet clothing.</li> <li>● Insulate yourself from work and ground.</li> </ul>	<ul style="list-style-type: none"> <li>● Keep flammable materials away.</li> </ul>	<ul style="list-style-type: none"> <li>● Wear eye, ear and body protection.</li> </ul>
Spanish <b>AVISO DE PRECAUCION</b>	<ul style="list-style-type: none"> <li>● No toque las partes o los electrodos bajo carga con la piel o ropa mojada.</li> <li>● Aislense del trabajo y de la tierra.</li> </ul>	<ul style="list-style-type: none"> <li>● Mantenga el material combustible fuera del área de trabajo.</li> </ul>	<ul style="list-style-type: none"> <li>● Protéjase los ojos, los oídos y el cuerpo.</li> </ul>
French <b>ATTENTION</b>	<ul style="list-style-type: none"> <li>● Ne laissez ni la peau ni des vêtements mouillés entrer en contact avec des pièces sous tension.</li> <li>● Isolez-vous du travail et de la terre.</li> </ul>	<ul style="list-style-type: none"> <li>● Gardez à l'écart de tout matériel inflammable.</li> </ul>	<ul style="list-style-type: none"> <li>● Protégez vos yeux, vos oreilles et votre corps.</li> </ul>
German <b>WARNUNG</b>	<ul style="list-style-type: none"> <li>● Berühren Sie keine stromführenden Teile oder Elektroden mit Ihrem Körper oder feuchter Kleidung!</li> <li>● Isolieren Sie sich von den Elektroden und dem Erdboden!</li> </ul>	<ul style="list-style-type: none"> <li>● Entfernen Sie brennbares Material!</li> </ul>	<ul style="list-style-type: none"> <li>● Tragen Sie Augen-, Ohren- und Körperschutz!</li> </ul>
Portuguese <b>ATENÇÃO</b>	<ul style="list-style-type: none"> <li>● Não toque partes elétricas e electrodos com a pele ou roupa molhada.</li> <li>● Isole-se da peça e terra.</li> </ul>	<ul style="list-style-type: none"> <li>● Mantenha inflamáveis bem guardados.</li> </ul>	<ul style="list-style-type: none"> <li>● Use proteção para a vista, ouvido e corpo.</li> </ul>
Japanese <b>注意事項</b>	<ul style="list-style-type: none"> <li>● 通電中の電気部品、又は溶材にヒフやぬれた布で触れないこと。</li> <li>● 施工物やアースから身体が絶縁されている様にして下さい。</li> </ul>	<ul style="list-style-type: none"> <li>● 燃えやすいものの側での溶接作業は絶対にしてはなりません。</li> </ul>	<ul style="list-style-type: none"> <li>● 目、耳及び身体に保護具をして下さい。</li> </ul>
Chinese <b>警告</b>	<ul style="list-style-type: none"> <li>● 皮肤或湿衣物切勿接觸帶電部件及綽條。</li> <li>● 使你自已與地面和工件絕緣。</li> </ul>	<ul style="list-style-type: none"> <li>● 把一切易燃物品移離工作場所。</li> </ul>	<ul style="list-style-type: none"> <li>● 佩戴眼、耳及身體勞動保護用具。</li> </ul>
Korean <b>위험</b>	<ul style="list-style-type: none"> <li>● 전도체나 용접봉을 젖은 헝겊 또는 피부로 절대 접촉치 마십시오.</li> <li>● 모재와 접지를 접촉치 마십시오.</li> </ul>	<ul style="list-style-type: none"> <li>● 인화성 물질을 접근 시키지 마십시오.</li> </ul>	<ul style="list-style-type: none"> <li>● 눈, 귀와 몸에 보호장구를 착용하십시오.</li> </ul>
Arabic <b>تحذير</b>	<ul style="list-style-type: none"> <li>● لا تلمس الاجزاء التي يسري فيها التيار الكهربائي أو الألكترود بجند الجسم أو بالملايس المبللة بالماء.</li> <li>● ضع عازلا على جسمك خلال العمل.</li> </ul>	<ul style="list-style-type: none"> <li>● ضع المواد القابلة للاشتعال في مكان بعيد.</li> </ul>	<ul style="list-style-type: none"> <li>● ضع أدوات وملابس واقية على عينيك وأذنيك وجسمك.</li> </ul>

**READ AND UNDERSTAND THE MANUFACTURER'S INSTRUCTION FOR THIS EQUIPMENT AND THE CONSUMABLES TO BE USED AND FOLLOW YOUR EMPLOYER'S SAFETY PRACTICES.**

**SE RECOMIENDA LEER Y ENTENDER LAS INSTRUCCIONES DEL FABRICANTE PARA EL USO DE ESTE EQUIPO Y LOS CONSUMIBLES QUE VA A UTILIZAR, SIGA LAS MEDIDAS DE SEGURIDAD DE SU SUPERVISOR.**

**LISEZ ET COMPRENEZ LES INSTRUCTIONS DU FABRICANT EN CE QUI REGARDE CET EQUIPMENT ET LES PRODUITS A ETRE EMPLOYES ET SUIVEZ LES PROCEDURES DE SECURITE DE VOTRE EMPLOYEUR.**

**LESEN SIE UND BEFOLGEN SIE DIE BETRIEBSANLEITUNG DER ANLAGE UND DEN ELEKTRODENEINSATZ DES HERSTELLERS. DIE UNFALLVERHÜTUNGSVORSCHRIFTEN DES ARBEITGEBERS SIND EBENFALLS ZU BEACHTEN.**

			
<ul style="list-style-type: none"> <li>● Keep your head out of fumes.</li> <li>● Use ventilation or exhaust to remove fumes from breathing zone.</li> </ul>	<ul style="list-style-type: none"> <li>● Turn power off before servicing.</li> </ul>	<ul style="list-style-type: none"> <li>● Do not operate with panel open or guards off.</li> </ul>	<b>WARNING</b>
<ul style="list-style-type: none"> <li>● Los humos fuera de la zona de respiración.</li> <li>● Mantenga la cabeza fuera de los humos. Utilice ventilación o aspiración para gases.</li> </ul>	<ul style="list-style-type: none"> <li>● Desconectar el cable de alimentación de poder de la máquina antes de iniciar cualquier servicio.</li> </ul>	<ul style="list-style-type: none"> <li>● No operar con panel abierto o guardas quitadas.</li> </ul>	Spanish <b>AVISO DE PRECAUCION</b>
<ul style="list-style-type: none"> <li>● Gardez la tête à l'écart des fumées.</li> <li>● Utilisez un ventilateur ou un aspirateur pour ôter les fumées des zones de travail.</li> </ul>	<ul style="list-style-type: none"> <li>● Débranchez le courant avant l'entretien.</li> </ul>	<ul style="list-style-type: none"> <li>● N'opérez pas avec les panneaux ouverts ou avec les dispositifs de protection enlevés.</li> </ul>	French <b>ATTENTION</b>
<ul style="list-style-type: none"> <li>● Vermeiden Sie das Einatmen von Schweißrauch!</li> <li>● Sorgen Sie für gute Be- und Entlüftung des Arbeitsplatzes!</li> </ul>	<ul style="list-style-type: none"> <li>● Strom vor Wartungsarbeiten abschalten! (Netzstrom völlig öffnen; Maschine anhalten!)</li> </ul>	<ul style="list-style-type: none"> <li>● Anlage nie ohne Schutzgehäuse oder Innenschutzverkleidung in Betrieb setzen!</li> </ul>	German <b>WARNUNG</b>
<ul style="list-style-type: none"> <li>● Mantenha seu rosto da fumaça.</li> <li>● Use ventilação e exaustão para remover fumo da zona respiratória.</li> </ul>	<ul style="list-style-type: none"> <li>● Não opere com as tampas removidas.</li> <li>● Desligue a corrente antes de fazer serviço.</li> <li>● Não toque as partes elétricas nuas.</li> </ul>	<ul style="list-style-type: none"> <li>● Mantenha-se afastado das partes moventes.</li> <li>● Não opere com os painéis abertos ou guardas removidas.</li> </ul>	Portuguese <b>ATENÇÃO</b>
<ul style="list-style-type: none"> <li>● ヒュームから頭を離すようにして下さい。</li> <li>● 換気や排煙に十分留意して下さい。</li> </ul>	<ul style="list-style-type: none"> <li>● メンテナンス・サービスに取りかかる際には、まず電源スイッチを必ず切ってください。</li> </ul>	<ul style="list-style-type: none"> <li>● パネルやカバーを取り外したまま機械操作をしないで下さい。</li> </ul>	Japanese <b>注意事項</b>
<ul style="list-style-type: none"> <li>● 頭部遠離煙霧。</li> <li>● 在呼吸區使用通風或排風器除煙。</li> </ul>	<ul style="list-style-type: none"> <li>● 維修前切斷電源。</li> </ul>	<ul style="list-style-type: none"> <li>● 儀表板打開或沒有安全罩時不準作業。</li> </ul>	Chinese <b>警告</b>
<ul style="list-style-type: none"> <li>● 얼굴로부터 용접가스를 멀리하십시오.</li> <li>● 호흡지역으로부터 용접가스를 제거하기 위해 가스제거기나 통풍기를 사용하십시오.</li> </ul>	<ul style="list-style-type: none"> <li>● 보수전에 전원을 차단하십시오.</li> </ul>	<ul style="list-style-type: none"> <li>● 판넬이 열린 상태로 작동치 마십시오.</li> </ul>	Korean <b>위험</b>
<ul style="list-style-type: none"> <li>● بعد رأسك بعيداً عن الدخان.</li> <li>● استعمل التهوية أو جهاز ضغط الدخان للخارج لكي تبعد الدخان عن المنطقة التي تتنفس فيها.</li> </ul>	<ul style="list-style-type: none"> <li>● قطع التيار الكهربائي قبل القيام بأية صيانة.</li> </ul>	<ul style="list-style-type: none"> <li>● لا تشغيل هذا الجهاز إذا كانت الإغطية الحديدية الواقية ليست عليه.</li> </ul>	Arabic <b>تحذير</b>

**LEIA E COMPREENDA AS INSTRUÇÕES DO FABRICANTE PARA ESTE EQUIPAMENTO E AS PARTES DE USO, E SIGA AS PRÁTICAS DE SEGURANÇA DO EMPREGADOR.**

使う機械や溶材のメーカーの指示書をよく読み、まず理解して下さい。そして貴社の安全規定に従って下さい。

請詳細閱讀並理解製造廠提供的說明以及應該使用的銀焊材料，並請遵守貴方的有關勞動保護規定。

이 제품에 동봉된 작업지침서를 숙지하시고 귀사의 작업자 안전수칙을 준수하시기 바랍니다.

اقرأ بتمعن وافهم تعليمات المصنع المنتج لهذه المعدات والمواد قبل استعمالها واتبع تعليمات الوقاية لصاحب العمل.



## LIMITED WARRANTY

### STATEMENT OF WARRANTY:

The Lincoln Electric Company (Lincoln) warrants to the original purchaser (end-user) of new equipment that it will be free of defects in workmanship and material.

This warranty is void if Lincoln finds that the equipment has been subjected to improper care or abnormal operation.

### WARRANTY PERIOD:

All warranty periods date from the date of shipment to the original purchaser and are as follows:

#### Three Years:

Transformer Welders, Motor-generator Welders, Inverter Welders (except V100-S, V130-S and V200-T), Automatic Wire Feeders, Semiautomatic Wire Feeders, Plasma-cutting Power Sources (except PRO-CUT 20), Engine Driven Welders (except engine and engine accessories) with operating speed under 2,000 RPM, All Ranger Series Engine Welders with operating speed over 2,000 RPM

#### Two Years:

Engine Driven Welders with operating speed over 2,000 RPM (except engine, engine accessories, Power-Arc 4000 generator/welders and Ranger Series Engine Welders)

All engine and engine accessories are warranted by the engine or engine accessory manufacturer and are not covered by this warranty.

#### One Year:

Equipment not listed above such as gun and cable assemblies, water coolers, FAS TRAK or MIG-TRAK equipment, air compressor on the SAE400 WELD'N AIR, Power-Arc 4000 generator/welders, Invertec V100-S, V130-S and V200-T, PRO-CUT 20, Wire Feed Module (Factory Installed), Load Banks and field-installed optional equipment.

### TO OBTAIN WARRANTY COVERAGE:

You are required to notify Lincoln Electric, your Lincoln Distributor, Lincoln Service Center or Field Service Shop of any defect within the warranty period. Written notification is recommended.

### WARRANTY REPAIR:

If Lincoln's inspection of the equipment confirms the existence of a defect covered by this warranty, the defect will be corrected by repair or replacement at Lincoln's option.

### WARRANTY COSTS:

You must bear the cost of shipping the equipment to a Lincoln Service Center or Field Service Shop as well as return shipment to you from that location.

### IMPORTANT WARRANTY LIMITATIONS:

- Lincoln will not accept responsibility for repairs made without its authorization.
- Lincoln shall not be liable for consequential damages (such as loss of business, etc.) caused by the defect or reasonable delay in correcting the defect.
- Lincoln's liability under this warranty shall not exceed the cost of correcting the defect.
- This written warranty is the only express warranty provided by Lincoln with respect to its products. Warranties implied by law such as the Warranty of Merchantability are limited to the duration of this limited warranty for the equipment involved.

July, '97



World's Leader in Welding and Cutting Products

Premier Manufacturer of Industrial Motors

• Sales and Service through Subsidiaries and Distributors Worldwide  
22801 St. Clair Ave. Cleveland, Ohio 44117-1199 U.S.A. Tel. 216-481-8100