

# ***Hypertherm***<sup>®</sup>

## Powermax65<sup>®</sup>

## Powermax85<sup>®</sup>

Plasma Arc Cutting Systems



Operator Manual

806650 | Revision 4 | English

## Register your new Hypertherm system

Register your product on-line at [www.hypertherm.com/registration](http://www.hypertherm.com/registration) for easier technical and warranty support. You can also receive updates on new Hypertherm products and a free gift as a token of our appreciation.

### For your records

Serial number: \_\_\_\_\_

Purchase date: \_\_\_\_\_

Distributor: \_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

Maintenance notes:

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

# ***Powermax65***

# ***Powermax85***

## **Operator Manual**

**806650**

**Revision 4 – April 2018**

**Hypertherm Inc.**  
**Hanover, NH USA**  
[www.hypertherm.com](http://www.hypertherm.com)  
email: [info@hypertherm.com](mailto:info@hypertherm.com)

© 2018 Hypertherm Inc.  
All Rights Reserved

Hypertherm and Powermax are trademarks of Hypertherm Inc.  
and may be registered in the United States and/or other countries.

**Hypertherm Inc.**

Etna Road, P.O. Box 5010  
Hanover, NH 03755 USA  
603-643-3441 Tel (Main Office)  
603-643-5352 Fax (All Departments)  
info@hypertherm.com (Main Office Email)

**800-643-9878 Tel (Technical Service)**

technical.service@hypertherm.com (Technical Service Email)

**800-737-2978 Tel (Customer Service)**

customer.service@hypertherm.com (Customer Service Email)

**866-643-7711 Tel (Return Materials Authorization)****877-371-2876 Fax (Return Materials Authorization)**

return.materials@hypertherm.com (RMA email)

**Hypertherm México, S.A. de C.V.**

Avenida Toluca No. 444, Anexo 1,  
Colonia Olivar de los Padres  
Delegación Álvaro Obregón  
México, D.F. C.P. 01780  
52 55 5681 8109 Tel  
52 55 5683 2127 Fax  
Soporte.Tecnico@hypertherm.com (Technical Service Email)

**Hypertherm Plasmatechnik GmbH**

Sophie-Scholl-Platz 5  
63452 Hanau  
Germany  
00 800 33 24 97 37 Tel

00 800 49 73 73 29 Fax

**31 (0) 165 596900 Tel (Technical Service)****00 800 4973 7843 Tel (Technical Service)**

technicalservice.emea@hypertherm.com (Technical Service Email)

**Hypertherm (Singapore) Pte Ltd.**

82 Genting Lane  
Media Centre  
Annexe Block #A01-01  
Singapore 349567, Republic of Singapore  
65 6841 2489 Tel  
65 6841 2490 Fax  
Marketing.asia@hypertherm.com (Marketing Email)  
TechSupportAPAC@hypertherm.com (Technical Service Email)

**Hypertherm Japan Ltd.**

Level 9, Edobori Center Building  
2-1-1 Edobori, Nishi-ku  
Osaka 550-0002 Japan  
81 6 6225 1183 Tel  
81 6 6225 1184 Fax  
HTJapan.info@hypertherm.com (Main Office Email)  
TechSupportAPAC@hypertherm.com (Technical Service Email)

**Hypertherm Europe B.V.**

Vaartveld 9, 4704 SE  
Roosendaal, Nederland  
31 165 596907 Tel  
31 165 596901 Fax  
31 165 596908 Tel (Marketing)  
**31 (0) 165 596900 Tel (Technical Service)**  
**00 800 4973 7843 Tel (Technical Service)**  
technicalservice.emea@hypertherm.com  
(Technical Service Email)

**Hypertherm (Shanghai) Trading Co., Ltd.**

B301, 495 ShangZhong Road  
Shanghai, 200231  
PR China  
86-21-80231122 Tel  
86-21-80231120 Fax  
**86-21-80231128 Tel (Technical Service)**  
techsupport.china@hypertherm.com  
(Technical Service Email)

**South America & Central America: Hypertherm Brasil Ltda.**

Rua Bras Cubas, 231 – Jardim Maia  
Guarulhos, SP – Brasil  
CEP 07115-030  
55 11 2409 2636 Tel  
tecnico.sa@hypertherm.com (Technical Service Email)

**Hypertherm Korea Branch**

#3904. APEC-ro 17. Heaundae-gu. Busan.  
Korea 48060  
82 (0)51 747 0358 Tel  
82 (0)51 701 0358 Fax  
Marketing.korea@hypertherm.com (Marketing Email)  
TechSupportAPAC@hypertherm.com  
(Technical Service Email)

**Hypertherm Pty Limited**

GPO Box 4836  
Sydney NSW 2001, Australia  
61 (0) 437 606 995 Tel  
61 7 3219 9010 Fax  
au.sales@Hypertherm.com (Main Office Email)  
TechSupportAPAC@hypertherm.com  
(Technical Service Email)

**Hypertherm (India) Thermal Cutting Pvt. Ltd**

A-18 / B-1 Extension,  
Mohan Co-Operative Industrial Estate,  
Mathura Road, New Delhi 110044, India  
91-11-40521201/ 2/ 3 Tel  
91-11 40521204 Fax  
HTIndia.info@hypertherm.com (Main Office Email)  
TechSupportAPAC@hypertherm.com  
(Technical Service Email)

# ELECTROMAGNETIC COMPATIBILITY (EMC)

---

## Introduction

Hypertherm's CE-marked equipment is built in compliance with standard EN60974-10. The equipment should be installed and used in accordance with the information below to achieve electromagnetic compatibility.

The limits required by EN60974-10 may not be adequate to completely eliminate interference when the affected equipment is in close proximity or has a high degree of sensitivity. In such cases it may be necessary to use other measures to further reduce interference.

This cutting equipment is designed for use only in an industrial environment.

## Installation and use

The user is responsible for installing and using the plasma equipment according to the manufacturer's instructions.

If electromagnetic disturbances are detected then it shall be the responsibility of the user to resolve the situation with the technical assistance of the manufacturer. In some cases this remedial action may be as simple as earthing the cutting circuit, see *Earthing of the workpiece*. In other cases, it could involve constructing an electromagnetic screen enclosing the power source and the work complete with associated input filters. In all cases, electromagnetic disturbances must be reduced to the point where they are no longer troublesome.

## Assessment of area

Before installing the equipment, the user shall make an assessment of potential electromagnetic problems in the surrounding area. The following shall be taken into account:

- a. Other supply cables, control cables, signaling and telephone cables; above, below and adjacent to the cutting equipment.
- b. Radio and television transmitters and receivers.
- c. Computer and other control equipment.
- d. Safety critical equipment, for example guarding of industrial equipment.
- e. Health of the people around, for example the use of pacemakers and hearing aids.
- f. Equipment used for calibration or measurement.
- g. Immunity of other equipment in the environment. User shall ensure that other equipment being used in the environment is compatible. This may require additional protection measures.
- h. Time of day that cutting or other activities are to be carried out.

The size of the surrounding area to be considered will depend on the structure of the building and other activities that are taking place. The surrounding area may extend beyond the boundaries of the premises.

## Methods of reducing emissions

### Mains supply

Cutting equipment must be connected to the mains supply according to the manufacturer's recommendations. If interference occurs, it may be necessary to take additional precautions such as filtering of the mains supply.

Consideration should be given to shielding the supply cable of permanently installed cutting equipment, in metallic conduit or equivalent. Shielding should be electrically continuous throughout its length. The shielding should be connected to the cutting mains supply so that good electrical contact is maintained between the conduit and the cutting power source enclosure.

## Maintenance of cutting equipment

The cutting equipment must be routinely maintained according to the manufacturer's recommendations. All access and service doors and covers should be closed and properly fastened when the cutting equipment is in operation. The cutting equipment should not be modified in any way, except as set forth in and in accordance with the manufacturer's written instructions. For example, the spark gaps of arc striking and stabilizing devices should be adjusted and maintained according to the manufacturer's recommendations.

## Cutting cables

The cutting cables should be kept as short as possible and should be positioned close together, running at or close to the floor level.

## Equipotential bonding

Bonding of all metallic components in the cutting installation and adjacent to it should be considered.

However, metallic components bonded to the workpiece will increase the risk that the operator could receive a shock by touching these metallic components and the electrode (nozzle for laser heads) at the same time.

The operator should be insulated from all such bonded metallic components.

### **Earthing of the workpiece**

Where the workpiece is not bonded to earth for electrical safety, nor connected to earth because of its size and position, for example, ship's hull or building steel work, a connection bonding the workpiece to earth may reduce emissions in some, but not all instances. Care should be taken to prevent the earthing of the workpiece increasing the risk of injury to users, or damage to other electrical equipment. Where necessary, the connection of the workpiece to earth should be made by a direct connection to the workpiece, but in some countries where direct connection is not permitted, the bonding should be achieved by suitable capacitances selected according to national regulations.

Note: The cutting circuit may or may not be earthed for safety reasons. Changing the earthing arrangements should only be authorized by a person who is competent to assess whether the changes will increase the risk of injury, for example, by allowing parallel cutting current return paths which may damage the earth circuits of other equipment. Further guidance is provided in IEC 60974-9, Arc Welding Equipment, Part 9: Installation and Use.

### **Screening and shielding**

Selective screening and shielding of other cables and equipment in the surrounding area may alleviate problems of interference. Screening of the entire plasma cutting installation may be considered for special applications.

## Attention

Genuine Hypertherm parts are the factory-recommended replacement parts for your Hypertherm system. Any damage or injury caused by the use of other than genuine Hypertherm parts may not be covered by the Hypertherm warranty, and will constitute misuse of the Hypertherm Product.

You are solely responsible for the safe use of the Product. Hypertherm does not and cannot make any guarantee or warranty regarding the safe use of the product in your environment.

## General

Hypertherm Inc. warrants that its Products shall be free from defects in materials and workmanship for the specific periods of time set forth herein and as follows: if Hypertherm is notified of a defect (i) with respect to the plasma power supply within a period of two (2) years from the date of its delivery to you, with the exception of Powermax brand power supplies, which shall be within a period of three (3) years from the date of delivery to you, and (ii) with respect to the torch and leads within a period of one (1) year from its date of delivery to you, with the exception of the HPRXD short torch with integrated lead, which shall be within a period of six (6) months from the date of delivery to you, and with respect to torch lifter assemblies within a period of one (1) year from its date of delivery to you, and with respect to Automation products one (1) year from its date of delivery to you, with the exception of the EDGE Pro CNC, EDGE Pro Ti CNC, MicroEDGE Pro CNC, and ArcGlide THC, which shall be within a period of two (2) years from the date of delivery to you, and (iii) with respect to HyIntensity fiber laser components within a period of two (2) years from the date of its delivery to you, with the exception of laser heads and beam delivery cables, which shall be within a period of one (1) year from its date of delivery to you.

This warranty shall not apply to any Powermax brand power supplies that have been used with phase converters. In addition, Hypertherm does not warranty systems that have been damaged as a result of poor power quality, whether from phase converters or incoming line power. This warranty shall not apply to any product which has been incorrectly installed, modified, or otherwise damaged.

Hypertherm provides repair, replacement or adjustment of the Product as the sole and exclusive remedy, if and only if the warranty set forth herein properly is invoked and applies. Hypertherm, at its sole option, shall repair, replace, or adjust, free of charge, any defective Products covered by this warranty which shall be returned with Hypertherm's prior authorization (which shall not be unreasonably withheld), properly packed, to Hypertherm's place of business in Hanover, New Hampshire, or to an authorized Hypertherm repair facility, all costs, insurance and freight pre paid by the customer. Hypertherm shall not be liable for any repairs, replacement, or adjustments of Products covered by this warranty, except those made pursuant to this paragraph and with Hypertherm's prior written consent.

The warranty set forth above is exclusive and is in lieu of all other warranties, express, implied, statutory, or otherwise with respect to the Products or as to the results which may be obtained therefrom, and all implied warranties or conditions of quality or of merchantability or fitness for a particular purpose or against infringement. The foregoing shall constitute the sole and exclusive remedy for any breach by Hypertherm of its warranty.

Distributors/OEMs may offer different or additional warranties, but Distributors/OEMs are not authorized to give any additional warranty protection to you or make any representation to you purporting to be binding upon Hypertherm.

## Patent indemnity

Except only in cases of products not manufactured by Hypertherm or manufactured by a person other than Hypertherm not in strict conformity with Hypertherm's specifications and in cases of designs, processes, formulae, or combinations not developed or purported to be developed by Hypertherm, Hypertherm will have the right to defend or settle, at its own expense, any suit or proceeding brought against you alleging that the use of the Hypertherm product, alone and not in combination with any other product not supplied by Hypertherm, infringes any patent of any third party. You shall notify Hypertherm promptly upon learning of any action or threatened action in connection with any such alleged infringement (and in any event no longer than fourteen (14) days after learning of any action or threat of action), and Hypertherm's obligation to defend shall be conditioned upon Hypertherm's sole control of, and the indemnified party's cooperation and assistance in, the defense of the claim.

## Limitation of liability

**In no event shall Hypertherm be liable to any person or entity for any incidental, consequential direct, indirect, punitive or exemplary damages (including but not limited to lost profits) regardless of whether such liability is based on breach of contract, tort, strict liability, breach of warranty, failure of essential purpose, or otherwise, and even if advised of the possibility of such damages.**

## National and local codes

National and local codes governing plumbing and electrical installation shall take precedence over any instructions contained in this manual. In no event shall Hypertherm be liable for injury to persons or property damage by reason of any code violation or poor work practices.

# WARRANTY

---

## Liability cap

**In no event shall Hypertherm's liability, if any, whether such liability is based on breach of contract, tort, strict liability, breach of warranties, failure of essential purpose or otherwise, for any claim, action, suit or proceeding (whether in court, arbitration, regulatory proceeding or otherwise) arising out of or relating to the use of the Products exceed in the aggregate the amount paid for the Products that gave rise to such claim.**

## Insurance


At all times you will have and maintain insurance in such quantities and types, and with coverage sufficient and appropriate to defend and to hold Hypertherm harmless in the event of any cause of action arising from the use of the products.

## Transfer of rights

You may transfer any remaining rights you may have hereunder only in connection with the sale of all or substantially all of your assets or capital stock to a successor in interest who agrees to be bound by all of the terms and conditions of this Warranty. Within thirty (30) days before any such transfer occurs, you agree to notify in writing Hypertherm, which reserves the right of approval. Should you fail timely to notify Hypertherm and seek its approval as set forth herein, the Warranty set forth herein shall be null and void and you will have no further recourse against Hypertherm under the Warranty or otherwise.



## WARNING!

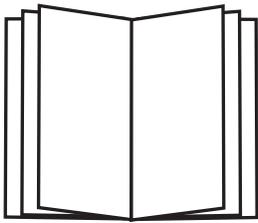

Before operating any Hypertherm equipment, read the safety instructions in your product's manual and in the *Safety and Compliance Manual* (80669C). Failure to follow safety instructions can result in personal injury or in damage to equipment.

Copies of the manuals may accompany the product in electronic and printed formats. You can also obtain copies of the manuals, in all languages available for each manual, from the "Documents library" at [www.hypertherm.com](http://www.hypertherm.com).



**Section 1**

**Specifications**

Safety information ..... 1-2

System description..... 1-2

Where to find information ..... 1-3

Power supply dimensions ..... 1-4

Component weights..... 1-5

Powermax65 power supply ratings ..... 1-6

Powermax85 power supply ratings ..... 1-8

Duramax 75° hand torch dimensions ..... 1-10

Duramax 15° hand torch dimensions ..... 1-10

Duramax 180° full-length machine torch dimensions..... 1-11

Duramax 180° mini machine torch dimensions..... 1-11

Powermax65 cutting specifications..... 1-12

Powermax85 cutting specifications..... 1-13

Symbols and marks ..... 1-14

IEC symbols ..... 1-15

**Section 2**

**Power Supply Setup**

Unpack the Powermax65 or Powermax85 system ..... 2-2

    Claims ..... 2-2

    Contents..... 2-3

Position the power supply..... 2-4

Prepare the electrical power ..... 2-4

    Install a line-disconnect switch ..... 2-5

    Requirements for grounding ..... 2-5

Power connection for the Powermax65 ..... 2-6

    Single-phase power cord (not for CE/CCC model)..... 2-7

    Three-phase power cord – plug installation ..... 2-7

Power connection for the Powermax85 ..... 2-8

    Single-phase power cord (not for CE/CCC model)..... 2-9

    Single-phase power cord installation ..... 2-10

Three-phase power cord – plug installation..... 2-11

Extension cord recommendations..... 2-11

    Extension cord specifications..... 2-12

    Engine-driven generator recommendations ..... 2-13

Prepare the gas supply..... 2-14

    Additional gas filtration..... 2-14

    Connect the gas supply..... 2-15

## TABLE OF CONTENTS

---

### Section 3

#### Torch Setup

Introduction .....	3-2
Consumable life.....	3-2
CopperPlus™ electrode for Duramax torches.....	3-2
Hand torch setup .....	3-3
Choose the hand torch consumables .....	3-4
Hand torch consumables .....	3-4
Install the hand torch consumables.....	3-6
Machine torch setup.....	3-7
Converting a full-length machine torch to a mini machine torch.....	3-8
Mount the torch.....	3-10
Choose the machine torch consumables .....	3-12
Machine torch consumables.....	3-12
Install the machine torch consumables .....	3-15
Aligning the torch .....	3-15
Connecting an optional remote-start pendant .....	3-16
Connecting an optional machine interface cable.....	3-17
Connecting the torch lead.....	3-22
Using the cut charts .....	3-23
Estimated kerf-width compensation.....	3-24
85 A shielded consumables .....	3-26
65 A shielded consumables .....	3-30
45 A shielded consumables .....	3-34
FineCut® consumables.....	3-38
85 A unshielded consumables.....	3-43
65 A unshielded consumables.....	3-47
45 A unshielded consumables.....	3-51

### Section 4

#### Operation

Controls and indicators .....	4-2
Rear controls .....	4-2
Front controls and LEDs.....	4-2
Status screen .....	4-4
Operating the Powermax65 or Powermax85 .....	4-6
Connect the electrical power, gas supply, and torch lead .....	4-6
Attach the work lead to the power supply.....	4-7
Attach the work clamp to the workpiece .....	4-8
Turn ON the system.....	4-9
Set the operating mode switch.....	4-9
Check the indicators.....	4-10
Manually adjusting the gas pressure.....	4-10
Adjusting the current (amperage).....	4-11
Understanding duty-cycle limitations.....	4-12

Using the hand torch.....	4-13
Operate the safety trigger .....	4-13
Hand torch cutting hints .....	4-14
Start a cut from the edge of the workpiece.....	4-15
Pierce a workpiece.....	4-16
Gouge a workpiece .....	4-17
Common hand-cutting faults .....	4-20
Using the machine torch .....	4-21
Ensure the torch and table are set up correctly .....	4-21
Understand and optimize cut quality.....	4-21
To pierce a workpiece using the machine torch .....	4-23
Common machine-cutting faults.....	4-24

**Section 5**

**Maintenance and Repair**

Perform routine maintenance .....	5-2
Inspect the consumables .....	5-3
Basic troubleshooting.....	5-4
Fault codes and solutions .....	5-6
Replace the air filter element and air filter bowl.....	5-10
Remove the air filter bowl .....	5-10
Identify air filter bowl model .....	5-11
Install the air filter element (for plastic or nylon bowl).....	5-12
Install the air filter element (for guarded metal bowl).....	5-13
Install the air filter bowl (metal guarded, plastic, or nylon).....	5-14

**Section 6**

**Parts**

Power supply parts.....	6-2
Duramax 75° hand torch replacement parts.....	6-6
Duramax 15° hand torch replacement parts.....	6-7
Hand torch consumables .....	6-8
Duramax 180° full-length machine torch replacement parts .....	6-9
Duramax 180° mini machine torch replacement parts .....	6-11
Machine torch consumables .....	6-13
Accessory parts.....	6-14
Powermax65/85 labels.....	6-15



## Section 1

# SPECIFICATIONS

---

*In this section:*

Safety information .....	1-2
System description.....	1-2
Where to find information .....	1-3
Power supply dimensions .....	1-4
Component weights.....	1-5
Powermax65 power supply ratings .....	1-6
Powermax85 power supply ratings .....	1-8
Duramax 75° hand torch dimensions .....	1-10
Duramax 15° hand torch dimensions .....	1-10
Duramax 180° full-length machine torch dimensions.....	1-11
Duramax 180° mini machine torch dimensions.....	1-11
Powermax65 cutting specifications.....	1-12
Powermax85 cutting specifications.....	1-13
Symbols and marks .....	1-14
IEC symbols .....	1-15

### Safety information

Before you set up and operate your Hypertherm system, read the separate *Safety and Compliance Manual* included with your system for important safety information.

### System description

The Powermax65 and Powermax85 are highly portable, 65-amp and 85-amp, handheld and mechanized plasma cutting systems appropriate for a wide range of applications. The Powermax systems use air or nitrogen to cut electrically conductive metals, such as mild steel, stainless steel, or aluminum. Smart Sense™ technology automatically adjusts the gas pressure according to cutting mode and torch lead length for optimum cutting.

The Powermax65 can cut thicknesses up to 1 inch (25 mm) with a handheld torch and pierce thicknesses up to 5/8 inch (16 mm). The Powermax85 can cut thicknesses up to 1-1/4 inches (32 mm) and pierce thicknesses up to 3/4 inch (19 mm). FastConnect™ provides a simple push-button torch connection to the power supply for quick torch changes.

The typical handheld Powermax system includes a Duramax™ series 75° hand torch with a consumables box and work lead cable. Reference materials include: operator manual, quick setup card, registration card, setup DVD, and safety manual.

The typical mechanized Powermax system includes a Duramax series 180° full-length machine torch with a consumables box, work lead cable, and remote-start pendant. Reference materials include: operator manual, quick setup card, registration card, setup DVD, and safety manual.

You can order additional styles of torches, consumables, and accessories – such as the plasma cutting guide – from any Hypertherm distributor. See the *Parts* section for a list of spare and optional parts.


Powermax65 and Powermax85 power supplies are shipped without a plug on the power cord. See Section 2 *Power Supply Setup* for more information.

## Where to find information

System specifications such as size, weight, detailed electrical specifications, and cut speeds can be found in this section. For information on:

- Setup requirements, including power requirements, grounding, power cord configurations, extension cord requirements, and generator recommendations – see Section 2, *Power Supply Setup*.
- Handheld and machine torch consumables, cut charts, and torch setup information – see Section 3, *Torch Setup*.
- Information about the controls and LEDs, steps for system operation, and hints for improving cut quality – see Section 4, *Operation*.
- Maintenance and repair – see the troubleshooting section.
- Replacing components – see the *Component replacement* section (Service Manual).
- Part numbers and ordering information for accessories, consumables, and replacement parts – see the *Parts* section.
- Timing and schematic diagrams – see the *Wiring diagrams* section (Service Manual).

**Power supply dimensions**

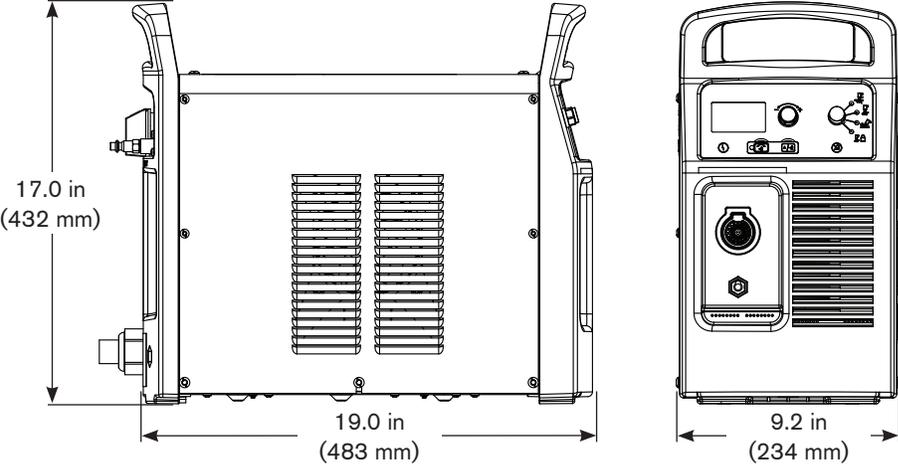

**Component weights**

	<b>65 A CSA</b>	<b>65 A CE/CCC</b>	<b>85 A CSA</b>	<b>85 A CE/CCC</b>
	<b>lbs (kg)</b>	<b>lbs (kg)</b>	<b>lbs (kg)</b>	<b>lbs (kg)</b>
Power supply	54.1 (24.5)	47.0 (21.3)	59.9 (27.2)	50.4 (22.8)

	<b>65/85 A</b>
	<b>lbs (kg)</b>
Hand torch 7.6 m (25 ft)	6.8 (3.1)
Hand torch 15 m (50 ft)	12.2 (5.5)
Hand torch 23 m (75 ft)	17.6 (8.0)

Machine torch 7.6 m (25 ft)	7.6 (3.4)
Machine torch 15 m (50 ft)	13.2 (6.0)
Machine torch 23 m (75 ft)	18.8 (8.5)

	<b>65 A</b>	<b>85 A</b>
	<b>lbs (kg)</b>	<b>lbs (kg)</b>
Work lead 7.6 m (25 ft)	2.8 (1.3)	6.8 (3.1)
Work lead 15 m (50 ft)	5.0 (2.3)	7.5 (3.4)
Work lead 23 m (75 ft)	6.9 (3.1)	10.6 (4.8)

## SPECIFICATIONS

### Powermax65 power supply ratings

Rated open-circuit voltage ( $U_0$ ) CSA, 1-phase, 3-phase CE/CCC, 3-phase	CSA 296 VDC CE/CCC 270 VDC		
Output characteristic*	Drooping		
Rated output current ( $I_2$ )	20 – 65 A		
Rated output voltage ( $U_2$ )	139 VDC		
Duty cycle at 40° C (104° F) (See data plate on power supply for more information on duty cycle.)	CSA	50% @ 65 A, 230 – 600 V, 1/3 PH 40% @ 65 A, 200 – 208 V, 1/3 PH 100% @ 46 A, 230 – 600 V, 1/3 PH	
	CCC/CE	50% @ 65 A, 380/400 V, 3 PH 100% @ 46 A, 380/400 V, 3 PH	
Operating temperature	14° to 104° F (-10° to 40° C)		
Storage temperature	-13° to 131° F (-25° to 55° C)		
Power factor 200 – 480 V CSA, 1-phase 200 – 600 V CSA, 3-phase 380/400 V CCC/CE, 3-phase	0.99 – 0.97 0.94 – 0.73 0.94		
$R_{scc}$ – Short Circuit Ratio (CE/CCC models only)	$U_1$ – Volts AC rms, 3PH	$R_{scc}$	
	400 VAC	225.7	
EMC classification CISPR 11 (CE/CCC models only)‡	Class A		
Input voltage ( $U_1$ )/ Input current ( $I_1$ ) at rated output ( $U_2$ $I_{2MAX}$ , $I_{1MAX}$ ) (See Section 2 <i>Power Supply Setup</i> for more information.)	CSA	200/208/240/480 V, 1 PH, 50/60 Hz 52/50/44/22 A 200/208/240/480/600 V, 3 PH, 50/60 Hz 32/31/27/13/13 A	
	CCC/CE**†	380/400 V, 3 PH, 50/60 Hz 15.5/15 A	
Gas type	Air	Nitrogen	
Gas quality	Clean, dry, oil-free per ISO 8573-1 Class 1.2.2	99.95% pure	
Recommended gas inlet flow rate/pressure	Cutting: 400 scfh, 6.7 scfm (190 slpm) @ 85 psi (5.9 bar) Maximum Removal gouging: 450 scfh, 7.5 scfm (210 slpm) @ 70 psi (4.8 bar) Maximum Control gouging: 450 scfh, 7.5 scfm (210 slpm) @ 70 psi (4.8 bar)		

\* Defined as a plot of output voltage versus output current.

\*\* Equipment complies with IEC 61000-3-12 provided that the short-circuit power  $S_{sc}$  is greater than or equal to 2035 KVA at the interface point between the user's supply and the public system. It is the responsibility of the installer or user of the equipment to ensure, by consultation with the distribution network operator if necessary, that the equipment is connected only to a supply with a short-circuit power  $S_{sc}$  greater than or equal to 2035 KVA.

† Equipment complies with IEC 61000-3-11 provided that the supply impedance,  $Z_{max}$ , is 0.201 or less. It is the responsibility of the installer or user of the equipment to ensure, by consultation with the distribution network operator if necessary, that the equipment is connected only to a supply with a impedance of 0.201 or less.

‡ WARNING: This Class A equipment is not intended for use in residential locations where the electrical power is provided by the public low-voltage supply system. There may be potential difficulties in ensuring electromagnetic compatibility in those locations, due to conducted as well as radiated disturbances.

## SPECIFICATIONS

### Powermax85 power supply ratings

Rated open-circuit voltage ( $U_0$ ) CSA, single-phase, 3-phase CCC/CE, 3-phase	CSA CCC/CE	305 VDC 270 VDC
Output characteristic*	Drooping	
Rated output current ( $I_2$ )	25 – 85 A	
Rated output voltage ( $U_2$ )	143 VDC	
Duty cycle at 40° C (104° F) (See data plate on power supply for more information on duty cycle.)	CSA          CCC/CE	60% @ 85 A, 230 – 600 V, 3 PH 60% @ 85 A, 480 V, 1 PH 50% @ 85 A, 240 V, 1 PH 50% @ 85 A 200 – 208 V, 3 PH 40% @ 85 A 200 – 208 V, 1 PH 100% @ 66 A, 230 – 600 V, 1/3 PH 60% @ 85 A, 380/400 V, 3 PH 100% @ 66 A, 380/400 V, 3 PH
Operating temperature	14° to 104° F (-10° to 40° C)	
Storage temperature	-13° to 131° F (-25° to 55° C)	
Power factor 200 – 480 V CSA, 1-phase 200 – 600 V CSA, 3-phase 380/400 V CCC/CE, 3-phase	0.99 – 0.96 0.94 – 0.76 0.94	
$R_{sce}$ – Short Circuit Ratio (CCC/CE models only)	$U_1$ – Volts AC rms, 3PH	$R_{sce}$
	400 VAC	225.7
EMC classification CISPR 11 (CCC/CE models only)†	Class A	
Input voltage ( $U_1$ )/ Input current ( $I_1$ ) at rated output ( $U_{2\ MAX}$ , $I_{2\ MAX}$ ) (See Section 2 <i>Power Supply Setup</i> for more information.)	CSA    CCC/CE**,†	200/208/240/480 V, 1 PH, 50/60 Hz 70/68/58/29 A 200/208/240/480/600 V, 3 PH, 50/60 Hz 42/40/35/18/17 A 380/400 V, 3 PH, 50/60 Hz 20.5/19.5 A
Gas type	Air	Nitrogen
Gas quality	Clean, dry, oil-free per ISO 8573-1 Class 1.2.2	99.95% pure
Recommended gas inlet flow rate/pressure	Cutting: 400 scfh, 6.7 scfm (190 slpm) @ 85 psi (5.9 bar) Maximum Removal gouging: 450 scfh, 7.5 scfm (210 slpm) @ 70 psi (4.8 bar) Maximum Control gouging: 450 scfh, 7.5 scfm (210 slpm) @ 70 psi (4.8 bar)	

\* Defined as a plot of output voltage versus output current.

\*\* Equipment complies with IEC 61000-3-12 provided that the short-circuit power  $S_{sc}$  is greater than or equal to 2035 KVA at the interface point between the user's supply and the public system. It is the responsibility of the installer or user of the equipment to ensure, by consultation with the distribution network operator if necessary, that the equipment is connected only to a supply with a short-circuit power  $S_{sc}$  greater than or equal to 2035 KVA.


† Equipment complies with IEC 61000-3-11 provided that the supply impedance,  $Z_{max}$ , is 0.201 or less. It is the responsibility of the installer or user of the equipment to ensure, by consultation with the distribution network operator if necessary, that the equipment is connected only to a supply with a impedance of 0.201 or less.

‡ WARNING: This Class A equipment is not intended for use in residential locations where the electrical power is provided by the public low-voltage supply system. There may be potential difficulties in ensuring electromagnetic compatibility in those locations, due to conducted as well as radiated disturbances.


## SPECIFICATIONS

---


### Duramax 75° hand torch dimensions

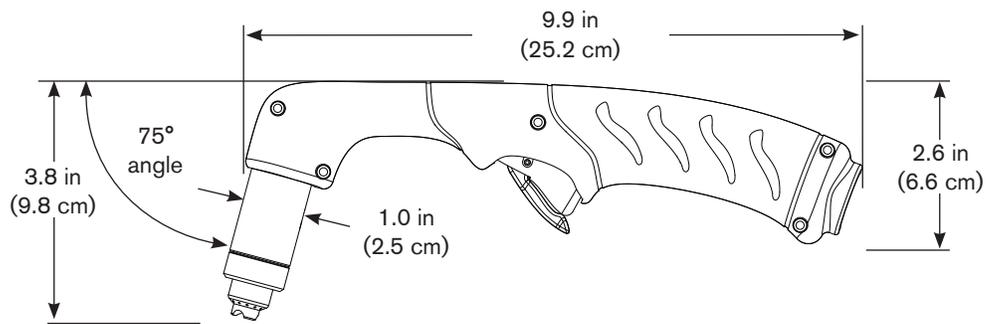


### Duramax 15° hand torch dimensions

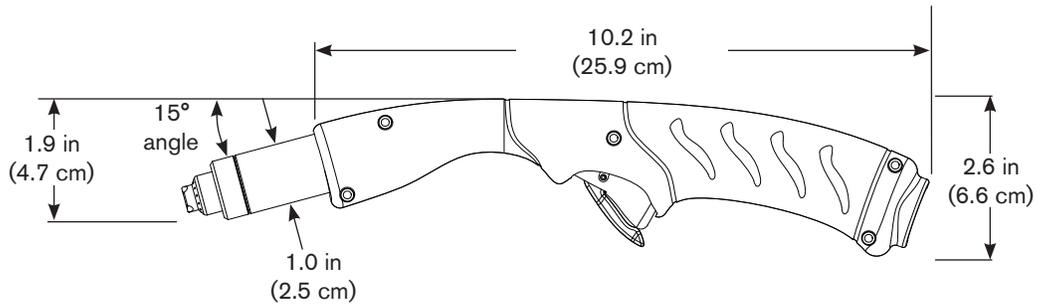

**Duramax 180° full-length machine torch dimensions**

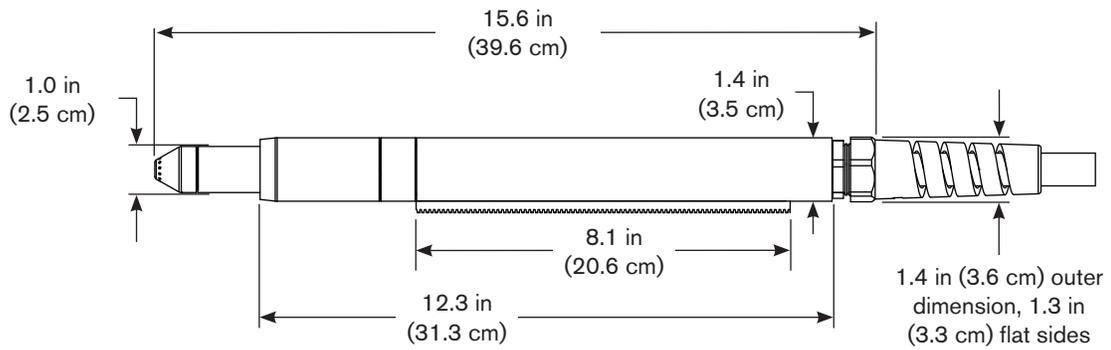

**Duramax 180° mini machine torch dimensions**

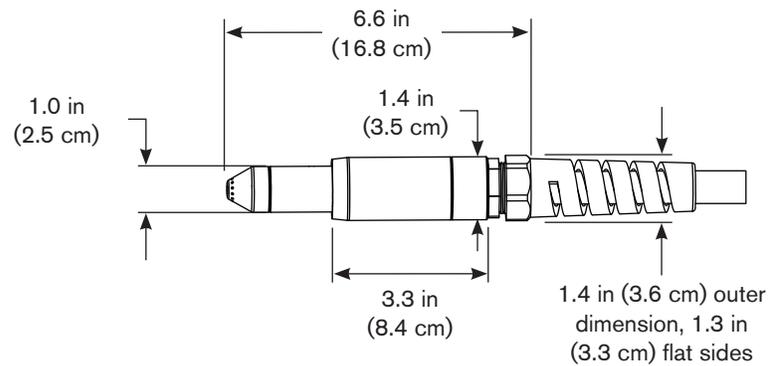

## SPECIFICATIONS

---

### Powermax65 cutting specifications

<b>Handheld cut capacity (material thickness)</b>	
Recommended cut capacity at 20 ipm (500 mm/min)*	3/4 in (19 mm)
Recommended cut capacity at 10 ipm (250 mm/min)*	1 in (25 mm)
Severance capacity at 5 ipm (125 mm/min)*	1-1/4 in (32 mm)
<b>Pierce capacity (material thickness)</b>	
Pierce capacity for handheld cutting, or mechanized cutting with torch height control	5/8 in (16 mm)
Pierce capacity for mechanized cutting without torch height control	1/2 in (12 mm)
<b>Maximum cut speed** (mild steel)</b>	
1/4 in (6 mm)	145 ipm (4000 mm/min)
1/2 in (12 mm)	50 ipm (1400 mm/min)
3/4 in (19 mm)	24 ipm (600 mm/min)
1 in (25 mm)	12 ipm (320 mm/min)
<b>Gouging capacity</b>	
Maximum Removal metal removal rate on mild steel	10.7 lbs/hr (4.8 kg/hr)
Maximum Control metal removal rate on mild steel	7.5 lbs/hr (3.4 kg/hr)
<b>Duramax series torch weights (refer to 1-5 <i>Component weights</i>)</b>	
<b>Duty cycle and voltage information (refer to 1-6 <i>Powermax65 power supply ratings</i>)</b>	

\* Cut capacity speeds are not necessarily maximum speeds. They are the speeds that must be achieved to be rated at that thickness.

\*\* Maximum cut speeds are the results of Hypertherm's laboratory testing. Actual cutting speeds may vary based on different cutting applications.

**Powermax85 cutting specifications**

<b>Handheld cut capacity (material thickness)</b>	
Recommended cut capacity at 20 ipm (500 mm/min)*	1 in (25 mm)
Recommended cut capacity at 10 ipm (250 mm/min)*	1-1/4 in (32 mm)
Severance capacity at 5 ipm (125 mm/min)*	1-1/2 in (38 mm)
<b>Pierce capacity (material thickness)</b>	
Pierce capacity for handheld cutting, or mechanized cutting with torch height control	3/4 in (19 mm)
Pierce capacity for mechanized cutting without torch height control	5/8 in (16 mm)
<b>Maximum cut speed** (mild steel)</b>	
1/4 in (6 mm)	200 ipm (5500 mm/min)
1/2 in (12 mm)	70 ipm (2000 mm/min)
3/4 in (19 mm)	36 ipm (900 mm/min)
1 in (25 mm)	21 ipm (550 mm/min)
1-1/4 in (32 mm)	13 ipm (330 mm/min)
<b>Gouging capacity</b>	
Maximum Removal metal removal rate on mild steel	19.5 lbs/hr (8.8 kg/hr)
Maximum Control metal removal rate on mild steel	13.7 lbs/hr (6.2 kg/hr)
<b>Duramax series torch weights (refer to 1-5 Component weights)</b>	
<b>Duty cycle and voltage information (refer to 1-8 Powermax85 power supply ratings)</b>	

\* Cut capacity speeds are not necessarily maximum speeds. They are the speeds that must be achieved to be rated at that thickness.

\*\* Maximum cut speeds are the results of Hypertherm's laboratory testing. Actual cutting speeds may vary based on different cutting applications.

### Symbols and marks

Your product may have one or more of the following markings on or near the data plate. Due to differences and conflicts in national regulations, not all marks are applied to every version of a product.



#### **S mark**

The S mark indicates that the power supply and torch are suitable for operations carried out in environments with increased hazard of electrical shock according to IEC 60974-1.



#### **CSA mark**

Products with a CSA mark meet the United States and Canadian regulations for product safety. The products were evaluated, tested, and certified by CSA-International. Alternatively, the product may have a mark by one of the other Nationally Recognized Testing Laboratories (NRTL) accredited in both the United States and Canada, such as UL or TÜV.



#### **CE mark**

The CE marking signifies the manufacturer's declaration of conformity to applicable European directives and standards. Only those versions of products with a CE marking located on or near the data plate have been tested for compliance with the European Low Voltage Directive and the European Electromagnetic Compatibility (EMC) Directive. EMC filters needed to comply with the European EMC Directive are incorporated within versions of the product with a CE marking.



#### **Eurasian Customs Union (CU) mark**

CE versions of products that include an EAC mark of conformity meet the product safety and EMC requirements for export to Russia, Belarus, and Kazakhstan.



#### **GOST-TR mark**

CE versions of products that include a GOST-TR mark of conformity meet the product safety and EMC requirements for export to the Russian Federation.



#### **C-Tick mark**

CE versions of products with a C-Tick mark comply with the EMC regulations required for sale in Australia and New Zealand.



#### **CCC mark**

The China Compulsory Certification (CCC) mark indicates that the product has been tested and found compliant with product safety regulations required for sale in China.



#### **UkrSEPRO mark**

The CE versions of products that include a UkrSEPRO mark of conformity meet the product safety and EMC requirements for export to the Ukraine.




#### **Serbian AAA mark**

CE versions of products that include a AAA Serbian mark meet the product safety and EMC requirements for export to Serbia.

**IEC symbols**

The following symbols may appear on the power supply data plate, control labels, switches, LEDs, and LCD screen.

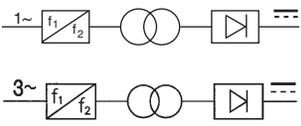	Direct current (DC)		Power is ON
	Alternating current (AC)		Power is OFF
	Plasma torch cutting		An inverter-based power source, either 1-phase or 3-phase
	Plate metal cutting		Volt/amp curve, "drooping" characteristic
	Expanded metal cutting		Power is ON (LED)
	Gouging		System fault (LED)
	AC input power connection		Inlet gas pressure fault (LCD)
	The terminal for the external protective (earth) conductor		Missing or loose consumables (LCD)
			Power supply is out of temperature range (LCD)



## Section 2

### POWER SUPPLY SETUP

---

*In this section:*

Unpack the Powermax65 or Powermax85 system .....	2-2
Claims .....	2-2
Contents.....	2-3
Position the power supply.....	2-4
Prepare the electrical power .....	2-4
Install a line-disconnect switch .....	2-5
Requirements for grounding .....	2-5
Power connection for the Powermax65 .....	2-6
Single-phase power cord (not for CE/CCC model).....	2-7
Three-phase power cord – plug installation .....	2-7
Power connection for the Powermax85 .....	2-8
Single-phase power cord (not for CE/CCC model).....	2-9
Single-phase power cord installation .....	2-10
Three-phase power cord – plug installation.....	2-11
Extension cord recommendations.....	2-11
Extension cord specifications.....	2-12
Engine-driven generator recommendations .....	2-13
Prepare the gas supply.....	2-14
Additional gas filtration.....	2-14
Connect the gas supply.....	2-15

### Unpack the Powermax65 or Powermax85 system


1. Verify that all items on your order have been received in good condition. Contact your distributor if any parts are damaged or missing.
2. Inspect the power supply for damage that may have occurred during shipping. If there is evidence of damage, refer to "Claims" below. All communications regarding this equipment must include the model number and the serial number located on the back of the power supply.
3. Before you set up and operate this Hypertherm system, read the separate *Safety and Compliance Manual* included with your system for important safety information.

### Claims

- **Claims for damage during shipment** – If your unit was damaged during shipment, you must file a claim with the carrier. Hypertherm will furnish you with a copy of the bill of lading upon request. If you need additional assistance, call the nearest Hypertherm office listed in the front of this manual.
- **Claims for defective or missing merchandise** – If any component is missing or defective, contact your Hypertherm distributor. If you need additional assistance, call the nearest Hypertherm office listed in the front of this manual.

**Contents**

Verify the items in the box against the illustration.

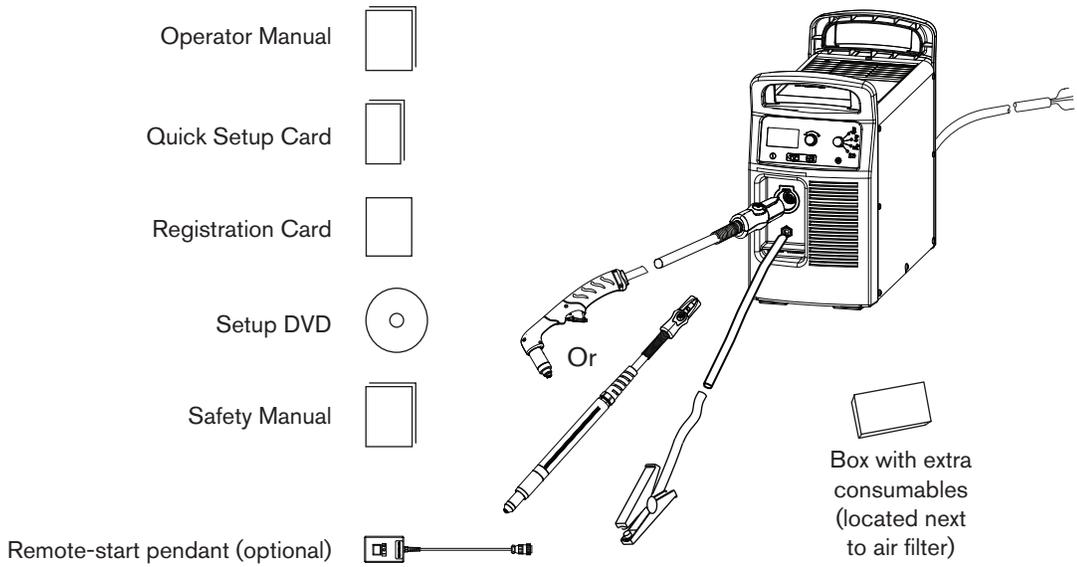

## POWER SUPPLY SETUP

---

### Position the power supply

Locate the power supply near an appropriate power receptacle for your installation: 200 – 480 volts (CSA 1-phase), 200 – 600 volts (CSA 3-phase), or 380/400 volts (3-phase CCC/CE). The power supply has a 10-foot (3 m) power cord. Allow at least 10 inches (0.25 m) of space around the power supply for proper ventilation.

The power supply is not suitable for use in rain or snow.

To avoid toppling, do not set the power supply on an incline greater than 10 degrees.

### Prepare the electrical power

Hypertherm (designated HYP on the data plate) input current ratings are used to determine conductor sizes for power connection and installation instructions. The HYP rating is determined under maximum normal operating conditions and the higher HYP input current value should be used for installation purposes.

The maximum output voltage will vary based on your input voltage and the circuit's amperage. Because the current draw varies during startup, slow-blow fuses are recommended as shown in the charts below. Slow-blow fuses can withstand currents up to 10 times the rated value for short periods of time.



**Caution: Protect the circuit with appropriately sized time-delay (slow-blow) fuses and a line-disconnect switch.**

### **Install a line-disconnect switch**

Use a line-disconnect switch for each power supply so that the operator can turn off the incoming power quickly in an emergency. Locate the switch so that it is easily accessible to the operator. Installation must be performed by a licensed electrician according to national and local codes. The interrupt level of the switch must equal or exceed the continuous rating of the fuses. In addition, the switch should:

- Isolate the electrical equipment and disconnect all live conductors from the incoming supply voltage when in the OFF position.
- Have one OFF and one ON position that are clearly marked with O (OFF) and I (ON).
- Have an external operating handle that can be locked in the OFF position.
- Contain a power-operated mechanism that serves as an emergency stop.
- Have appropriate slow-blow fuses installed. See 2-6 *Power connection for the Powermax65* or 2-8 *Power connection for the Powermax85* for recommended fuse sizes.

### **Requirements for grounding**

To ensure personal safety, proper operation, and to reduce electromagnetic interference (EMI), the power supply must be properly grounded.

- The power supply must be grounded through the power cord according to national and local electrical codes.
- Single-phase service must be of the 3-wire type with a green or green/yellow wire for the protective earth ground and must comply with national and local requirements. Do not use a 2-wire service.
- Three-phase service must be of the 4-wire type with a green or green/yellow wire for protective earth ground and must comply with national and local requirements.
- Refer to the separate *Safety and Compliance Manual* included with your system for more information on grounding.

### Power connection for the Powermax65

The Powermax65 CSA model is a universal power supply that can configure itself to operate with AC voltages from 200 to 600, 1- or 3-phase. The CCC/CE model is 380/400 V, 3-phase only. The rated output is 25 – 65 A, 139 VDC.

CSA model	Single-phase			Three-phase				
	200 – 208	230 – 240	480	200 – 208	230 – 240	400	480	600
Input voltage	200 – 208	230 – 240	480	200 – 208	230 – 240	400	480	600
Input current at 9.0 kw output	52	44	22	32	27	15	13	13
Input current during arc stretch	74	74	38	45	45	27	23	23
Fuse (slow-blow)	80	80	40	50	50	30	25	25

CE/CCC model	Three-phase
Input voltage	380/400
Input current at 9.0 kw output	15.5/15
Input current during arc stretch	27
Fuse (slow-blow)	30

### Single-phase power cord (not for CE/CCC model)

To operate your Powermax65 on 1-phase power, you will need to install an appropriate power cord. Refer to 2-10 *Single-phase power cord installation* for instructions.




**Caution:** When using the Powermax65 CSA model power supply with a 1-phase power source, replace the supplied power cord with an 8 AWG (10 mm<sup>2</sup>) 3-wire power cord. The power cord must be connected by a licensed electrician. (CE/CCC model is 3-phase only.)

### Three-phase power cord – plug installation

The Powermax65 power supplies are shipped with an 8 AWG 4-wire power cord on CSA models. A 2.5 mm<sup>2</sup>, 4-wire style H07RN-F\* power cord is provided on CE/CCC models. To operate the Powermax65, use a plug that meets national and local electrical codes. The plug must be connected to the power cord by a licensed electrician.

The procedure is similar to installing a single-phase power cord as shown in the section 2-10 *Single-phase power cord installation*. The figure below shows the additional wire connected to L3.

\* Style H07RN-F cord is a harmonized, heavy duty, flexible, rubber insulated, black neoprene jacketed multi-conductor IEC60245-4 / EN50525 European power cord with “CE” printed on the cord. The H07RN-F cord used by Hypertherm also has CCC certification to GB/T 5013.4 with “CCC” printed on the cord.

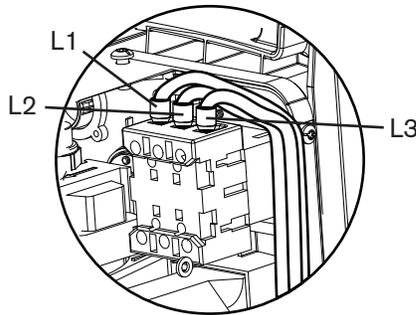

### Power connection for the Powermax85

The Powermax85 CSA model is a universal power supply that can configure itself to operate with AC voltages from 200 to 600, 1- or 3-phase (600 V 3-phase only). The CCC/CE model is 380/400 V, 3-phase only. The rated output is 25 – 85 A, 143 VDC.

CSA model	Single-phase			Three-phase				
	200 – 208	230 – 240	480	200 – 208	230 – 240	400	480	600
Input voltage	200 – 208	230 – 240	480	200 – 208	230 – 240	400	480	600
Input current at 12.2 kw output	70	60	29	42	36	21	18	17
Input current during arc stretch	98	98	50	60	60	38	31	30
Fuse (slow-blow)	100	100	50	60	60	40	30	30

CE/CCC model	Three-phase
Input voltage	380/400
Input current at 12.2 kw output	20.5/20
Input current during arc stretch	38
Fuse (slow-blow)	40

**Single-phase power cord (not for CE/CCC model)**

To operate your Powermax85 on 1-phase power, you will need to install an appropriate power cord. Refer to 2-10 *Single-phase power cord installation* for instructions.






**Caution:** When using the Powermax85 CSA model power supply with a 1-phase power source, replace the supplied power cord with a 6AWG (16 mm<sup>2</sup>) 3-wire power cord. The power cord must be connected by a licensed electrician. (CE/CCC model is 3-phase only.)

## POWER SUPPLY SETUP

### Single-phase power cord installation


Strip and prepare the power cord wires as shown below.

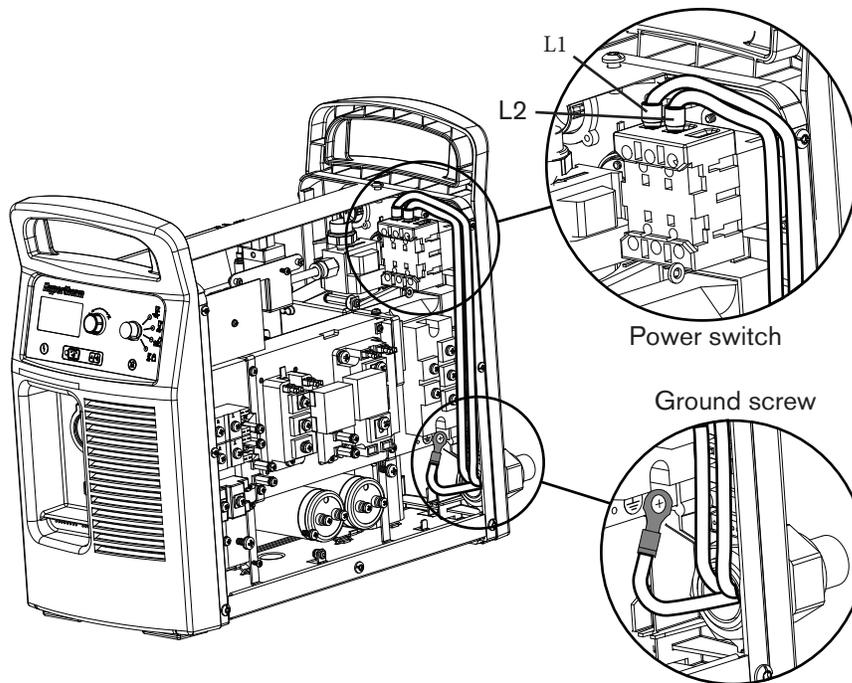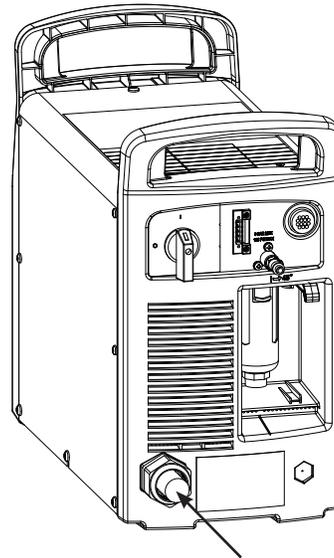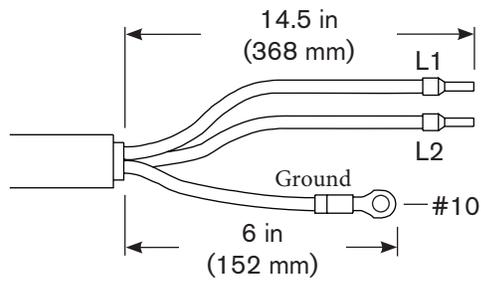

### Three-phase power cord – plug installation

The Powermax85 power supplies are shipped with an 8 AWG 4-wire power cord on CSA models. A 4 mm<sup>2</sup>, 4-wire style H07RN-F\* power cord is provided on CE/CCC models. To operate the Powermax85, use a plug that meets national and local electrical codes. The plug must be connected to the power cord by a licensed electrician.

The procedure is similar to installing a single-phase power cord as shown in the section 2-10 *Single-phase power cord installation*. The figure below shows the additional wire connected to L3.

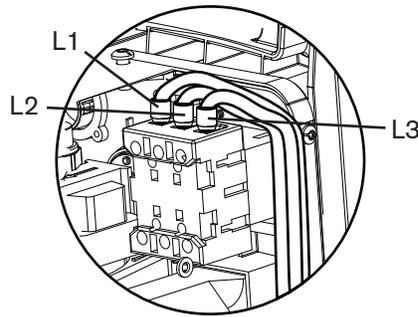

\* Style H07RN-F cord is a harmonized, heavy duty, flexible, rubber insulated, black neoprene jacketed multi-conductor IEC60245-4 / EN50525 European power cord with “CE” printed on the cord. The H07RN-F cord used by Hypertherm also has CCC certification to GB/T 5013.4 with “CCC” printed on the cord.

### Extension cord recommendations

Any extension cord must have an appropriate wire size for the cord length and system voltage. Use a cord that meets national and local codes.

The table on the next page provides the recommended gauge sizes for various lengths and input voltages. The lengths in the tables are the length of the extension cord only; they do not include the power supply's power cord.

## POWER SUPPLY SETUP

### Extension cord specifications

Extension cord length	< 10 ft (< 3 m)	10 – 25 ft (3 – 7.6 m)	25 – 50 ft (7.5 – 15 m)	50 – 100 ft (15 – 30 m)	100 – 150 ft (30 – 45 m)	
<b>65 A CSA</b>						
Input voltage (VAC)	Phase	AWG (mm <sup>2</sup> )	AWG (mm <sup>2</sup> )	AWG (mm <sup>2</sup> )	AWG (mm <sup>2</sup> )	AWG (mm <sup>2</sup> )
200 – 240	1	8 (10)	8 (10)	8 (10)	6 (16)	4 (25)
480	1	12 (4)	12 (4)	12 (4)	10 (6)	10 (6)
200 – 240	3	10 (6)	10 (6)	10 (6)	8 (10)	6 (16)
400/480	3	12 (4)	12 (4)	12 (4)	12 (4)	12 (4)
600	3	12 (4)	12 (4)	12 (4)	12 (4)	12 (4)
<b>65 A CE/CCC</b>						
Input voltage (VAC)	Phase	mm <sup>2</sup>	mm <sup>2</sup>	mm <sup>2</sup>	mm <sup>2</sup>	mm <sup>2</sup>
380	3	4	4	4	4	4
400	3	4	4	4	4	4
<b>85 A CSA</b>						
Input voltage (VAC)	Phase	AWG (mm <sup>2</sup> )	AWG (mm <sup>2</sup> )	AWG (mm <sup>2</sup> )	AWG (mm <sup>2</sup> )	AWG (mm <sup>2</sup> )
200 – 240	1	6 (16)	6 (16)	6 (16)	4 (25)	2 (35)
480	1	10 (6)	10 (6)	10 (6)	8 (10)	8 (10)
200 – 240	3	8 (10)	8 (10)	8 (10)	6 (16)	4 (25)
400/480	3	10 (6)	10 (6)	10 (6)	10 (6)	10 (6)
600	3	10 (6)	10 (6)	10 (6)	10 (6)	10 (6)
<b>85 A CE/CCC</b>						
Input voltage (VAC)	Phase	mm <sup>2</sup>	mm <sup>2</sup>	mm <sup>2</sup>	mm <sup>2</sup>	mm <sup>2</sup>
380	3	6	6	6	6	6
400	3	6	6	6	6	6

## Engine-driven generator recommendations

Generators used with the Powermax65 or Powermax85 should satisfy the following requirements:

### CSA

- 1-phase, 50/60 Hz, 230/240 VAC
- 3-phase, 50/60 Hz, 200-600 VAC (480 VAC recommended for best performance)

### CE/CCC

- 3-phase, 50/60 Hz, 380/400 VAC (400 VAC recommended for best performance)

Engine drive rating	System output current	Performance (arc stretch)
20 kw	85 A	Full
15 kw	70 A	Limited
15 kw	65 A	Full
12 kw	65 A	Limited
12 kw	40 A	Full
8 kw	40 A	Limited
8 kw	30 A	Full

Note: Based on the generator rating, age, and condition, adjust the cutting current as needed.

If a fault occurs while using a generator, turning the power switch quickly to OFF and then to ON again (sometimes called a “quick reset”) may not clear the fault. Instead, turn OFF the power supply and wait 30 to 45 seconds before turning ON again.

### Prepare the gas supply


The gas supply can be shop-compressed or cylinder-compressed. A high-pressure regulator must be used on either type of supply and must be capable of delivering gas to the air inlet on the power supply.

If the supply quality is poor, cut speeds decrease, cut quality deteriorates, cutting thickness capability decreases, and the life of the consumables shortens. To address these issues, use an optional air filtration system. See *Additional gas filtration*, below.

For optimal performance, the gas should be compliant with ISO8573-1:2010, Class 1.2.2 (that is, it should have a maximum number of solid particulate per m<sup>3</sup> of <20,000 for particle sizes in the range of 0.1-0.5 microns, <400 for particle sizes in the range of 0.5-1 microns, and <10 for particle sizes in the range of 1-5 microns). The maximum water vapor dew point should be <-40° C (-40° F). The maximum oil (aerosol, liquid, and vapor) content should be less than 0.1 mg/m<sup>3</sup>.

### Additional gas filtration

When site conditions introduce moisture, oil, or other contaminants into the gas line, use a 3-stage coalescing filtration system. A 3-stage filtering system works as shown below to clean contaminants from the gas supply.

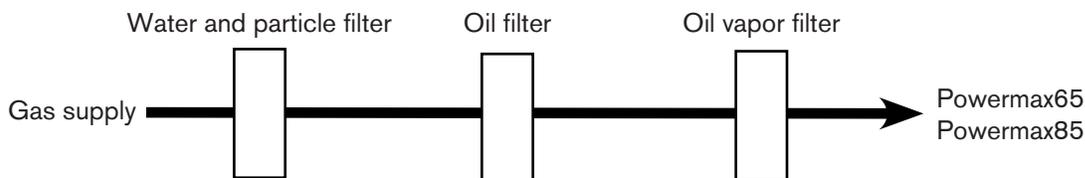


The filtering system should be installed between the gas supply and the power supply. Additional gas filtration may increase the required minimum inlet pressure.

Hypertherm offers these optional external filter kits:

- 1 The Eliminer moisture removal air filter kit (128647) removes water and dirt from the gas supply. For more information, refer to Field Service Bulletin 804180.
- 2 The oil removal air filter kit (428719) removes oil, oil vapor, and dirt from the gas supply. For more information, refer to Field Service Bulletin 809610.


Note: For additional parts related to these filter kits, see page 6-14 *Accessory parts*.

If you use both external filters, install them in the order shown to prevent damage to the gas line and equipment.

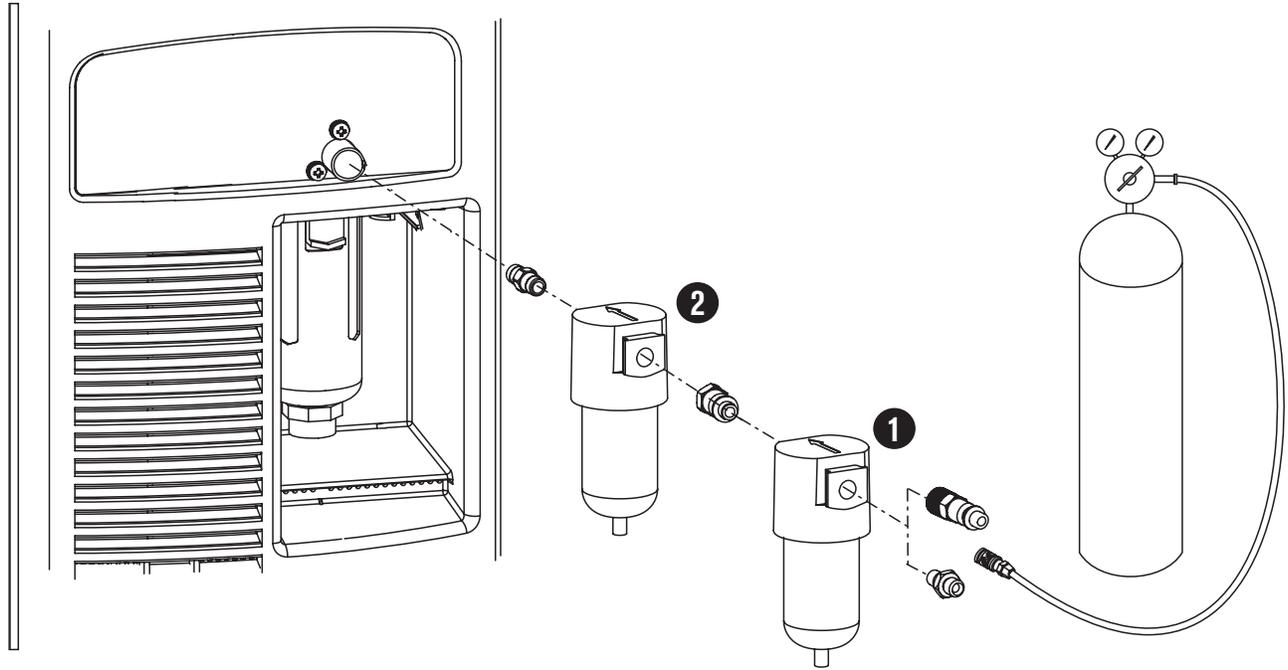

**Connect the gas supply**

Connect the gas supply to the power supply using an inert-gas hose with a 3/8 inch (9.5 mm) internal diameter and a 1/4 NPT quick-disconnect coupler, or a 1/4 NPT x G-1/4 BSPP (CE/CCC units) quick-disconnect coupler.

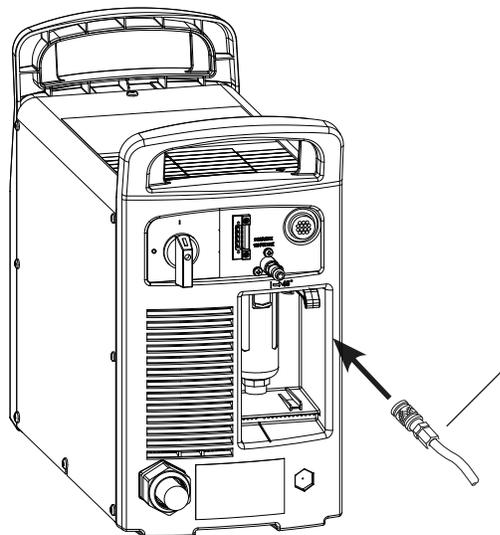

The recommended inlet pressure while gas is flowing is 85 – 135 psi (5.9 – 9.3 bar).



### WARNING

**Do not allow the gas supply pressure to exceed 135 psi (9.3 bar). The filter bowl may explode if this pressure is exceeded.**

#### Minimum inlet pressure (while gas is flowing)

This table shows the minimum required inlet pressure when the recommended inlet pressure is not available.

	Torch lead length		
	7.6 m (25 ft)	15 m (50 ft)	23 m (75 ft)
Cutting	75 psi (5.2 bar)	80 psi (5.5 bar)	85 psi (5.9 bar)
Maximum Removal gouging	60 psi (4.1 bar)	65 psi (4.5 bar)	70 psi (4.8 bar)
Maximum Control gouging	60 psi (4.1 bar)	65 psi (4.5 bar)	70 psi (4.8 bar)

#### Gas flow rates

Cutting	400 scfh, 6.7 scfm (190 slpm) at a minimum 85 psi (5.9 bar)
Maximum Removal gouging	450 scfh, 7.5 scfm (210 slpm) at a minimum 70 psi (4.8 bar)
Maximum Control gouging	450 scfh, 7.5 scfm (210 slpm) at a minimum 70 psi (4.8 bar)

## Section 3

### TORCH SETUP

---

*In this section:*

Introduction .....	3-2
Consumable life.....	3-2
CopperPlus™ electrode for Duramax torches.....	3-2
Hand torch setup .....	3-3
Choose the hand torch consumables .....	3-4
Hand torch consumables .....	3-4
Install the hand torch consumables.....	3-6
Machine torch setup.....	3-7
Converting a full-length machine torch to a mini machine torch.....	3-8
Mount the torch.....	3-10
Choose the machine torch consumables.....	3-12
Machine torch consumables.....	3-12
Install the machine torch consumables .....	3-15
Aligning the torch .....	3-15
Connecting an optional remote-start pendant .....	3-16
Connecting an optional machine interface cable.....	3-17
Connecting the torch lead.....	3-22
Using the cut charts .....	3-23
Estimated kerf-width compensation.....	3-24
85 A shielded consumables .....	3-26
65 A shielded consumables .....	3-30
45 A shielded consumables .....	3-34
FineCut® consumables.....	3-38
85 A unshielded consumables.....	3-43
65 A unshielded consumables.....	3-47
45 A unshielded consumables.....	3-51

### Introduction

Duramax™ series handheld and machine torches are available for the Powermax65 and Powermax85 systems. The FastConnect™ quick-disconnect system makes it easy to remove the torch for transport or to switch from one torch to the other if your applications require the use of different torches. The torches are cooled by ambient air and do not require special cooling procedures.

This section explains how to set up your torch and choose the appropriate consumables for the job.

### Consumable life

How often you need to change the consumables on your Powermax65 or Powermax85 will depend on a number of factors:

- The thickness of the metal being cut.
- The average length of the cut.
- Whether you are doing machine or hand cutting.
- The air quality (presence of oil, moisture, or other contaminants).
- Whether you are piercing the metal or starting cuts from the edge.
- Proper torch-to-work distance when gouging or cutting with unshielded consumables.
- Proper pierce height.
- Whether you are cutting in “continuous pilot arc” mode or normal mode. Cutting with a continuous pilot arc causes more consumable wear.

Under normal conditions, the electrode will wear out first during machine cutting and the nozzle will wear out first when hand cutting.

A general rule is that a set of consumables lasts approximately 2 to 3 hours of actual “arc on” time for hand cutting, depending on these factors. For mechanized cutting, consumables should last about 3 to 5 hours.


You will find more information about proper cutting techniques in Section 4, *Operation*.

### CopperPlus™ electrode for Duramax torches


The CopperPlus electrode (part number 220777) delivers at least two times longer consumable life over standard consumables (Hypertherm consumables designed for the system). This electrode is designed exclusively for use with Duramax torches when cutting metal 12 mm (1/2 inch) and under, and is compatible with 40 A to 105 A settings.

## Hand torch setup

### Duramax 75° hand torch

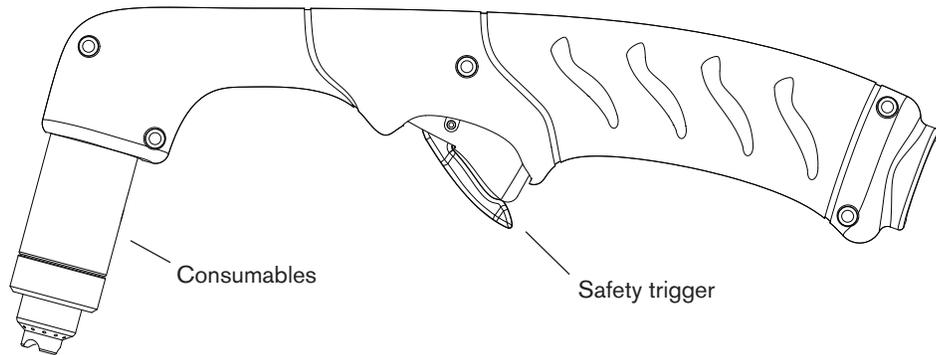

### Duramax 15° hand torch

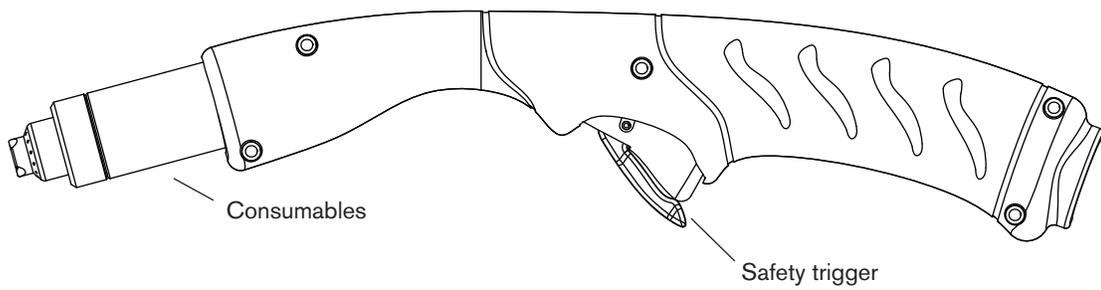

## TORCH SETUP

---

### Choose the hand torch consumables

Hypertherm includes a box of consumables with your system. Both styles of hand torches shown on the previous page use the same consumables.

Hand torches use shielded consumables. Therefore, you can drag the torch tip along the metal.

Consumables for hand cutting are shown on the next page. Notice that the retaining cap and electrode are the same for cutting, gouging, and FineCut® applications. Only the shield, nozzle, and swirl ring are different.

These 2 sets of gouging consumables can be used for both hand cutting and machine cutting:

- Maximum Removal gouging – For aggressive metal removal, deep gouge profiles, and extreme metal washing.
- Maximum Control gouging – For more precise metal removal, shallower gouge profiles, and light metal washing.

For the best cut quality on thin materials, you may prefer to use FineCut consumables, or use a 45 A nozzle and reduce the amperage to that setting.

To cut or gouge in hard to access or confined spaces, use HyAccess™ consumables. These 65 A consumables extend the reach of the general-purpose (standard) consumables by approximately 7.5 cm (3 inches). You can expect to achieve approximately the same cut thicknesses and cut quality as with the general-purpose consumables at 65 A.


Two HyAccess nozzles are available:

- One standard nozzle designed for a broad range of cutting applications
- One gouging nozzle designed specifically for gouging


When the tip of either nozzle wears out, replace the entire nozzle.

### Hand torch consumables


#### Drag-cutting consumables: Powermax65

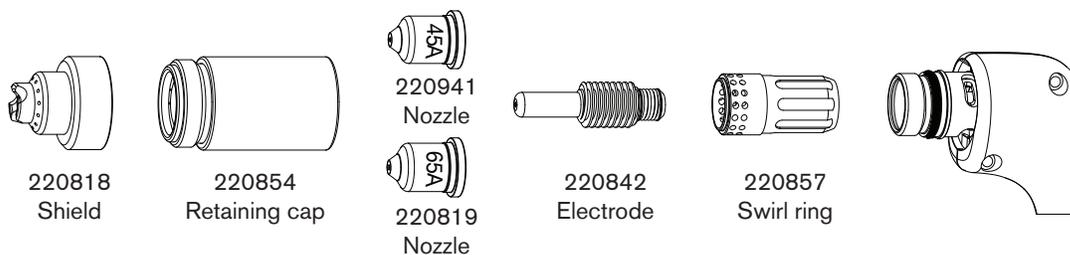


**Drag-cutting consumables: Powermax85**

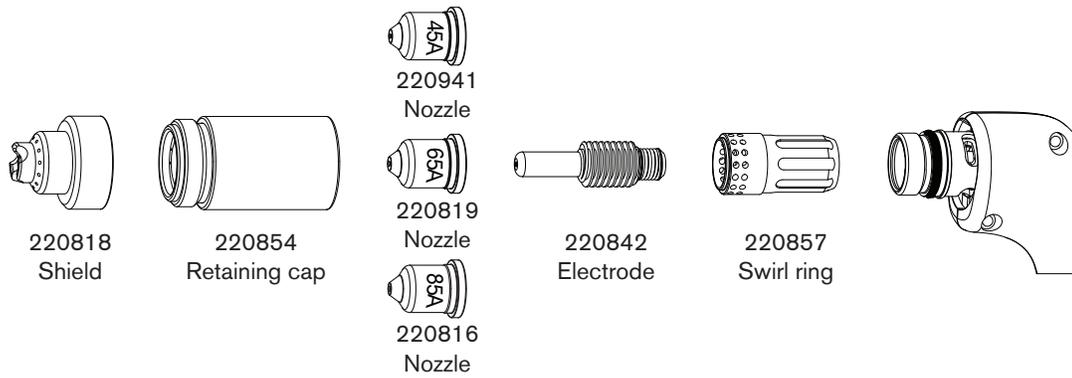


**Maximum Removal gouging consumables**

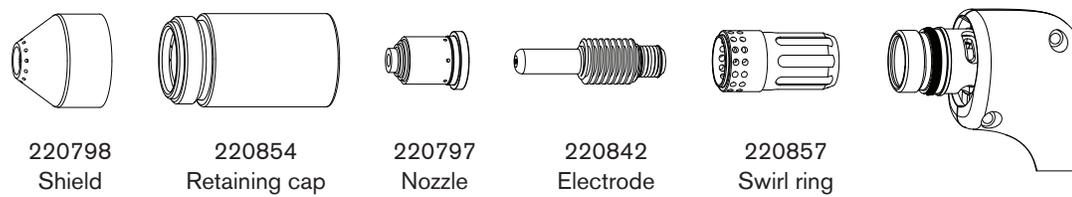


**Maximum Control gouging consumables**

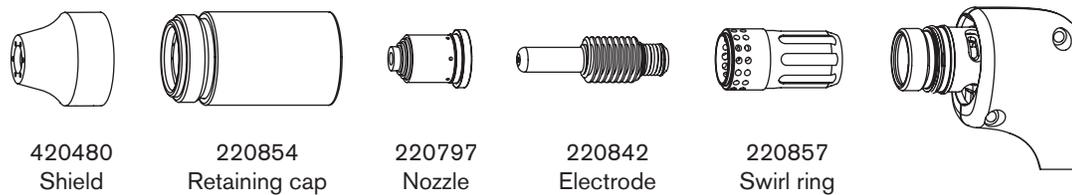

**FineCut® consumables**

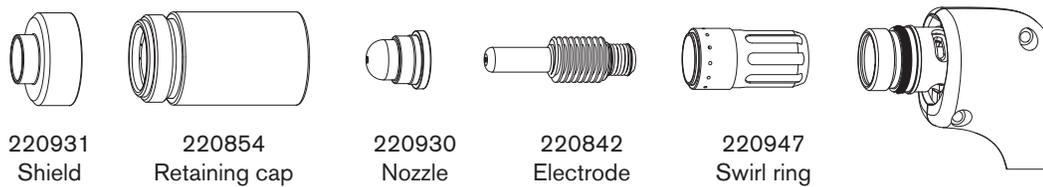


**HyAccess 65 A consumables**

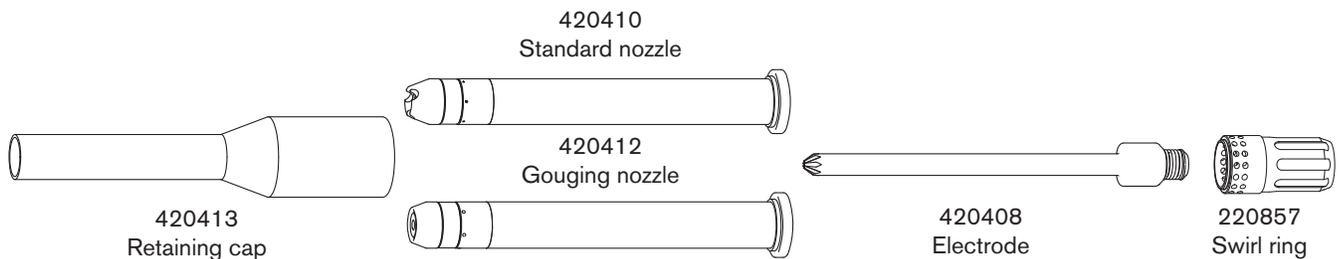


## TORCH SETUP

### Install the hand torch consumables

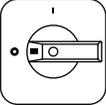		<p style="text-align: center;"><b>WARNING</b> <b>INSTANT-ON TORCHES</b> <b>PLASMA ARC CAN CAUSE INJURY AND BURNS</b></p>
	<p>The plasma arc comes on immediately when the torch trigger is activated. Make sure the power is OFF before changing consumables.</p>	


To operate the hand torch, a complete set of consumable parts must be installed: shield, retaining cap, nozzle, electrode, and swirl ring.

With the power switch in the OFF (O) position, install the torch consumables as shown below.

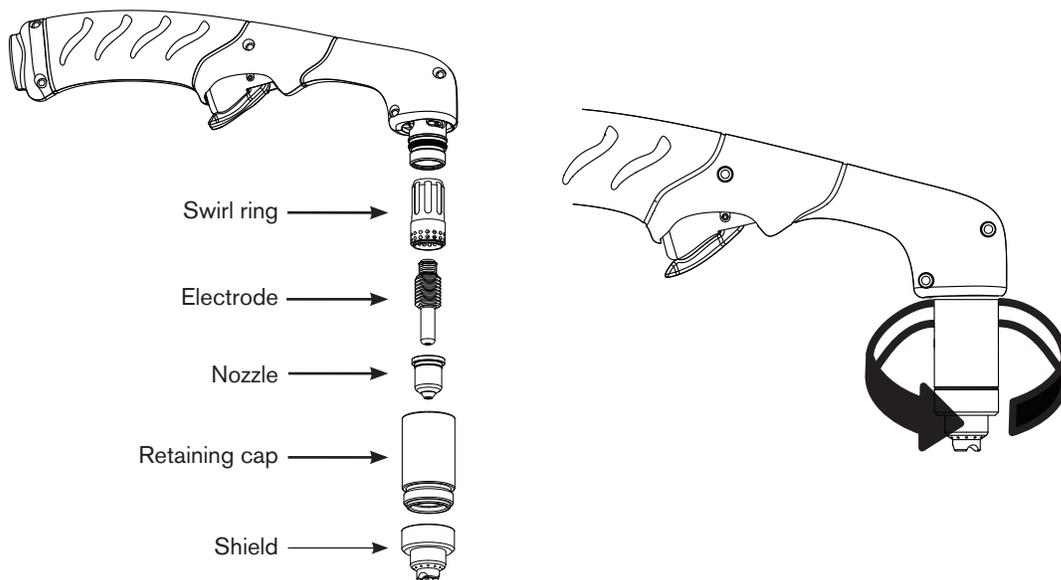


## Machine torch setup

### Duramax 180° full-length machine torch

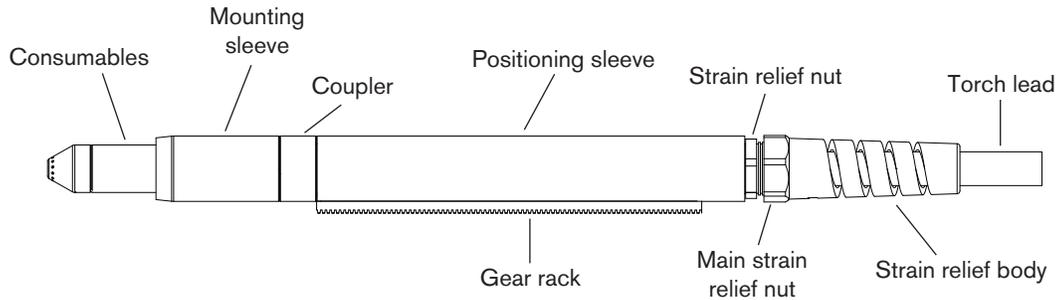

### Duramax 180° mini machine torch

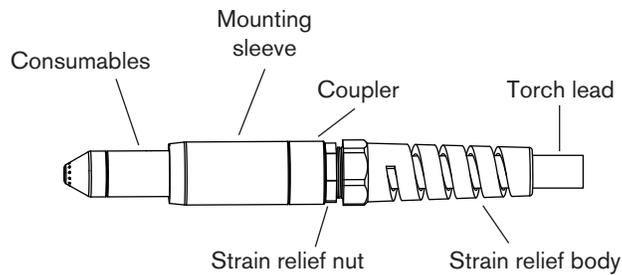

Before using either style of machine torch, you must:

- Mount the torch on your cutting table or other equipment.
- Choose and install the consumables.
- Align the torch.
- Attach the torch lead to the power supply.
- Set up the power supply for remote starting with either the remote-start pendant or a machine interface cable.

### Converting a full-length machine torch to a mini machine torch


You can convert a full-length machine torch to a mini machine torch by removing the positioning sleeve.

Note: If you are converting a full-length machine torch to a mini machine torch *and* mounting the torch at the same time, skip this section and follow the instructions in 3-10 *Mount the torch*.

Refer to the figures in the section 3-7 *Machine torch setup* and follow these instructions.

Note: While disconnecting and reconnecting the torch parts, maintain the same orientation between the torch head and torch lead. Twisting the torch head in relation to the torch lead can cause damage.

1. Disconnect the torch lead from the power supply and remove the consumables from the torch.
2. Unscrew the strain relief body from the strain relief nut and slide the strain relief body back along the torch lead.
3. Unscrew the strain relief nut from the positioning sleeve and slide the nut back along the torch lead.
4. Unscrew the positioning sleeve from the coupler.
5. Unscrew the coupler from the mounting sleeve.
6. Remove the three screws from the consumables end of the mounting sleeve and slide the mounting sleeve off the front of the torch body.

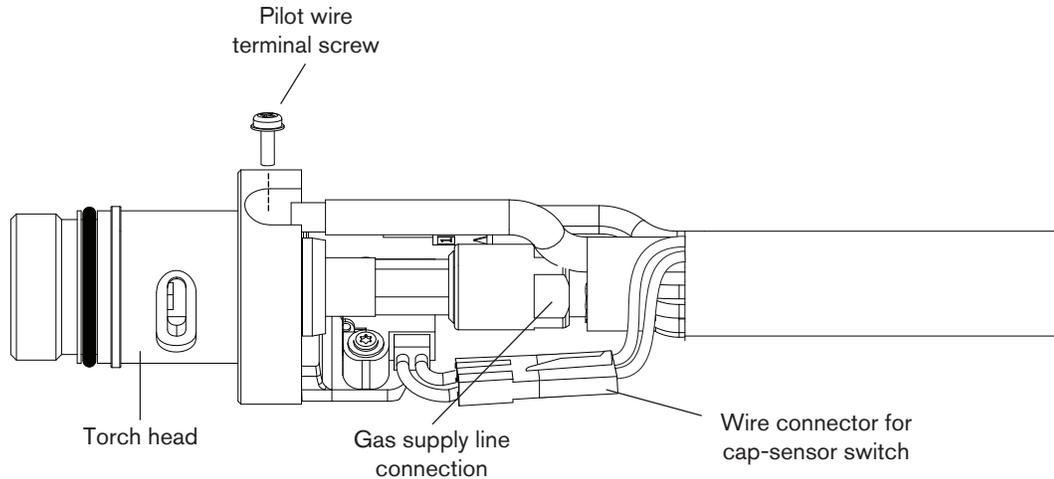

7. Disconnect the wire connector for the cap-sensor switch.
8. Remove the screw that secures the torch's pilot wire to the torch body.
9. Use 1/4-inch and 3/8-inch wrenches, or adjustable wrenches, to loosen the nut that secures the gas supply line to the torch lead. Set the torch body aside.
10. Slide the coupler and positioning sleeve off the front of the torch lead.
11. Slide the coupler over the torch lead.
12. Reconnect the gas line to the torch lead.
13. Reattach the torch's pilot wire to the torch body using the screw.
14. Reconnect the cap-sensor switch's wire connector.
15. Slide the mounting sleeve over the front of the torch body. Align the slot on the front of the mounting sleeve (next to one of the three screw holes) with the cap-sensor plunger on the torch body.
16. Attach the mounting sleeve to the torch body using the three screws.
17. Screw the coupler into the mounting sleeve.
18. Screw the strain relief nut into the coupler.
19. Screw the strain relief body into the strain relief nut.

## TORCH SETUP

---

### Mount the torch


Depending on the type of cutting table you have, you may or may not need to disassemble the torch to route it through the track and mount it. If your cutting table's track is large enough for you to thread the torch through it without removing the torch body from the lead, do so and then attach the torch to the lifter per the manufacturer's instructions.

Note: The Duramax machine torches can be mounted on a wide variety of X-Y tables, track burners, pipe bevelers, and other equipment. Install the torch per the manufacturer's instructions and follow the instructions below for disassembly if necessary.

If you need to disassemble and reassemble the torch, refer to the figures in the section 3-7 *Machine torch setup* and follow these instructions.

Note: While disconnecting and reconnecting the torch parts, maintain the same orientation between the torch head and torch lead. Twisting the torch head in relation to the torch lead can cause damage.

1. Disconnect the torch lead from the power supply and remove the consumables from the torch.
2. Unscrew the strain relief body from the strain relief nut and slide the strain relief body back along the torch lead.
3. Unscrew the strain relief nut from the positioning sleeve (full-length machine torch) and slide the nut back along the torch lead.
4. Unscrew the positioning sleeve from the coupler.
5. Unscrew the coupler from the mounting sleeve.
6. Remove the three screws from the consumables end of the mounting sleeve and slide the mounting sleeve off the front of the torch body.

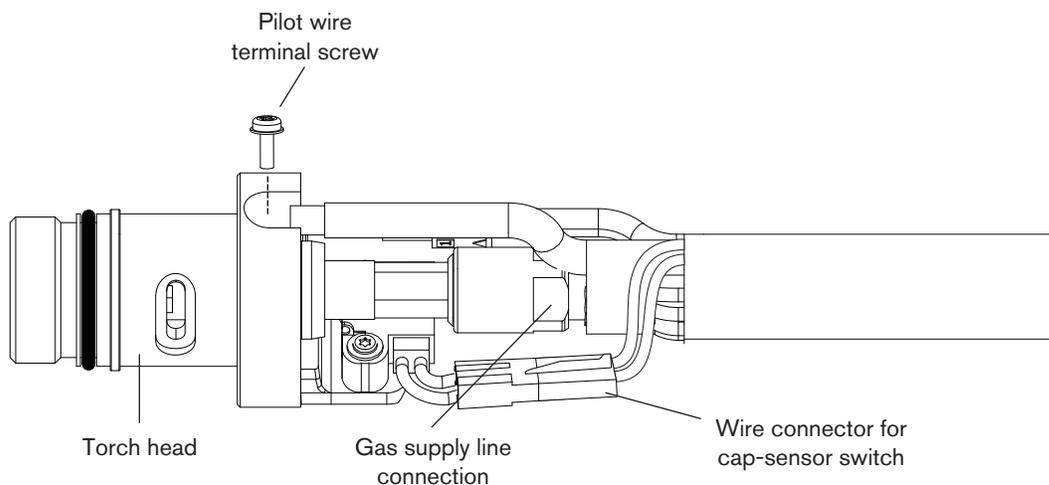

7. Disconnect the wire connector for the cap-sensor switch.
8. Remove the screw that secures the torch's pilot wire to the torch body.
9. Use 1/4-inch and 3/8-inch wrenches, or adjustable wrenches, to loosen the nut that secures the gas supply line to the torch lead. Set the torch body aside.

Note: Cover the end of the gas line on the torch lead with tape to keep dirt and other contaminants from getting in the gas line when you route the lead through the track.

10. Slide the coupler, positioning sleeve (full-length machine torch), strain relief nut, and strain relief body off the front of the torch lead.
11. If you do not need the gear rack on a full-length machine torch, slide the gear rack from the positioning sleeve toward the consumables end of the sleeve.
12. Route the torch lead through the cutting table's track.
13. Slide the strain relief body and strain relief nut over the torch lead.
14. If you are mounting a full-length machine torch, slide the positioning sleeve over the torch head.
15. Slide the coupler over the torch lead.
16. Reconnect the gas line to the torch lead.
17. Reattach the torch's pilot wire to the torch body using the screw.
18. Reconnect the cap-sensor switch's wire connector.
19. Slide the mounting sleeve over the front of the torch body. Align the slot on the front of the mounting sleeve (next to one of the three screw holes) with the cap-sensor plunger on the torch body.
20. Attach the mounting sleeve to the torch body using the three screws.
21. Screw the coupler into the mounting sleeve.
22. If you are mounting a full-length machine torch, screw the positioning sleeve into the coupler.
23. Reconnect the strain relief nut and strain relief body.
24. Attach the torch to the lifter per the manufacturer's instructions.

## TORCH SETUP

---

### Choose the machine torch consumables


Powermax systems with the Duramax 180° full-length machine torch or Duramax 180° mini machine torch are shipped with a box of consumables. In addition, an ohmic-sensing retaining cap is available for use with shielded consumables.

With shielded consumables, the torch tip may touch the metal when cutting. With unshielded consumables, you must keep the torch a small distance, about 2-3 mm (.08-.12 inch), away from the metal. Unshielded consumables generally have a shorter life than shielded consumables. Depending upon which system you order, you may receive a starter consumable kit with a standard retaining cap or ohmic retaining cap.


Both styles of machine torches use the same consumables.

### Machine torch consumables


#### Mechanized shielded consumables: Powermax65

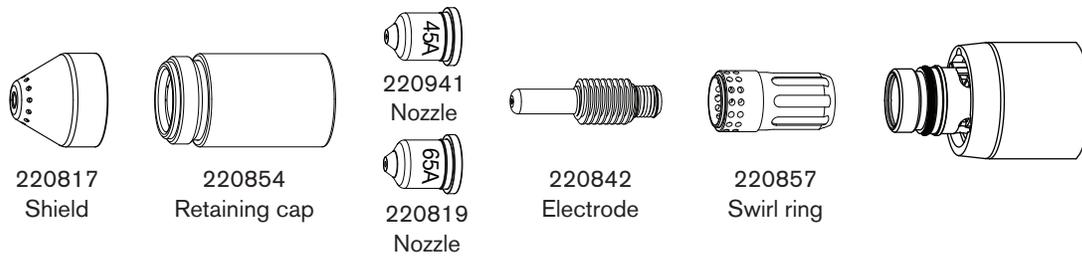


#### Mechanized shielded with ohmic consumables: Powermax65

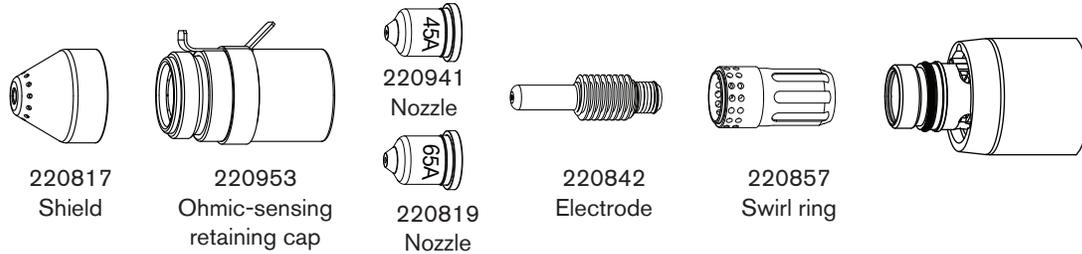


**Mechanized unshielded consumables: Powermax65**

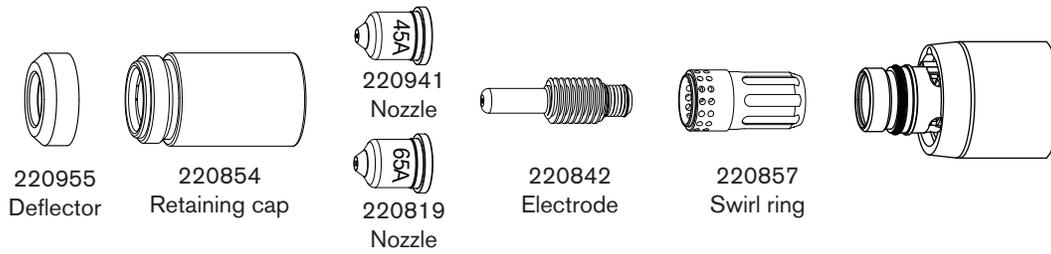

**Mechanized shielded consumables: Powermax85**

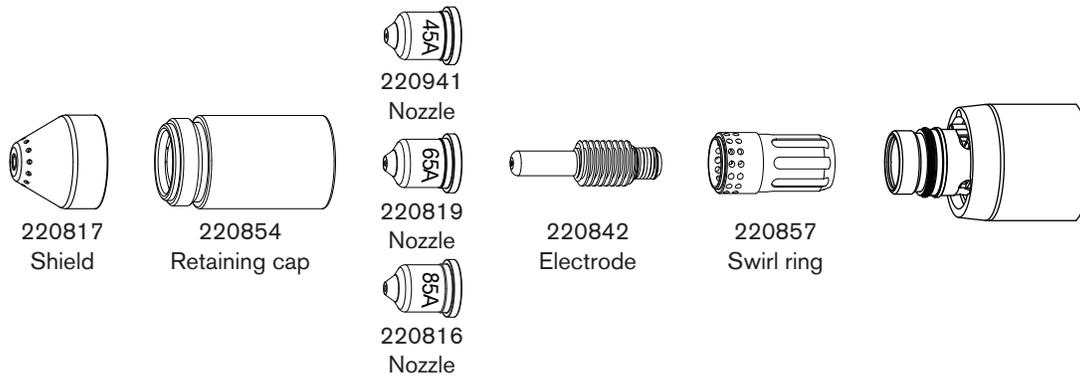


**Mechanized shielded with ohmic consumables: Powermax85**

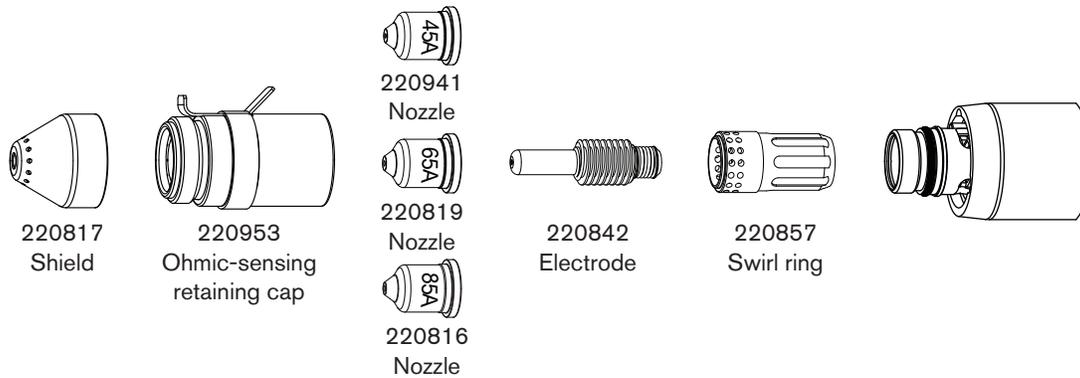


# TORCH SETUP


## Mechanized unshielded consumables: Powermax85

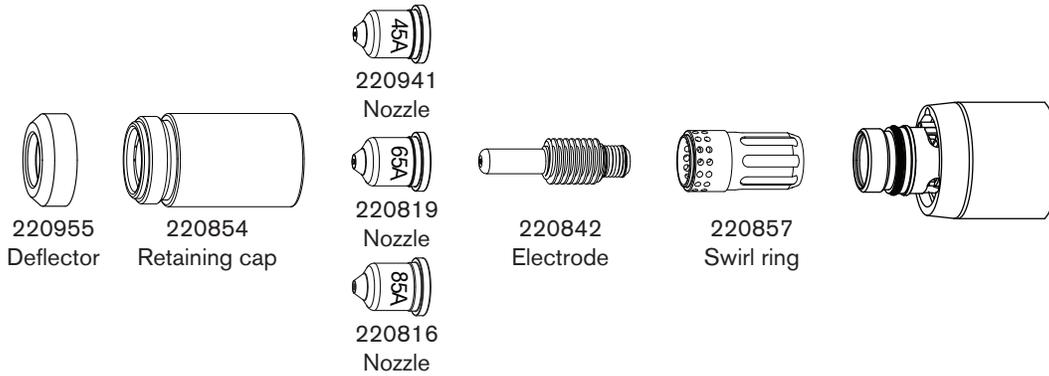


## Maximum Removal gouging consumables

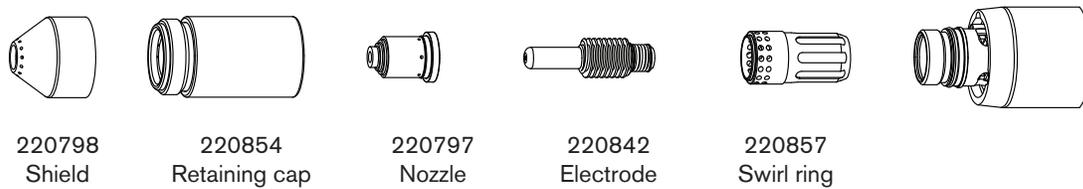


## Maximum Control gouging consumables

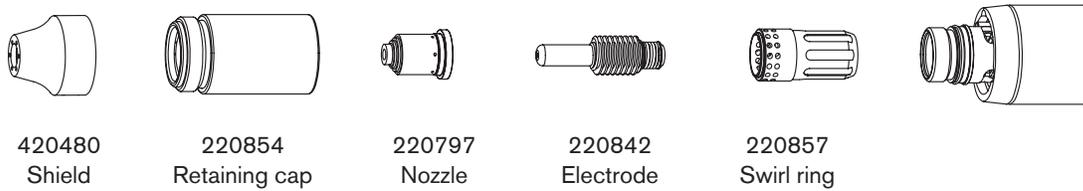


## FineCut® shielded consumables

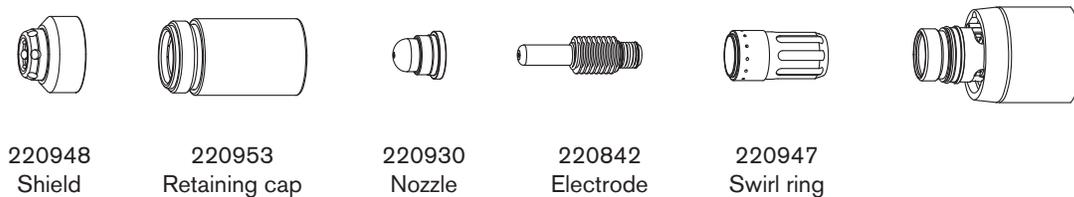

## FineCut® unshielded consumables

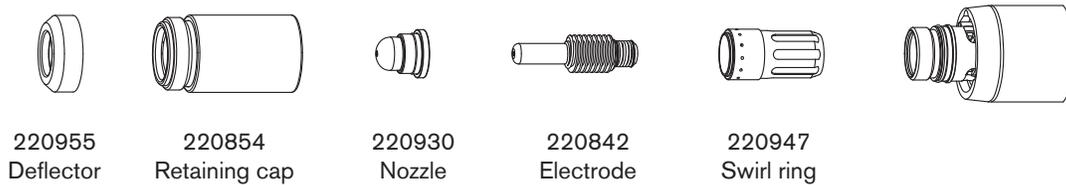

**Install the machine torch consumables**

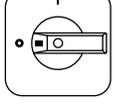
		<p><b>WARNING</b> <b>INSTANT-ON TORCHES</b></p> <p><b>PLASMA ARC CAN CAUSE INJURY AND BURNS</b></p>
	<p><b>The plasma arc comes on immediately when the torch is activated. Make sure the power is OFF before changing the consumables.</b></p>	

To operate the machine torch, a complete set of consumable parts must be installed: shield, retaining cap, nozzle, electrode, and swirl ring.

With the power switch in the OFF (O) position, install the machine torch consumables in a manner similar to the hand torch consumables. Refer to 3-6 *Install the hand torch consumables*.

**Aligning the torch**

Mount the machine torch perpendicular to the workpiece in order to get a vertical cut. Use a square to align the torch at 0° and 90°.

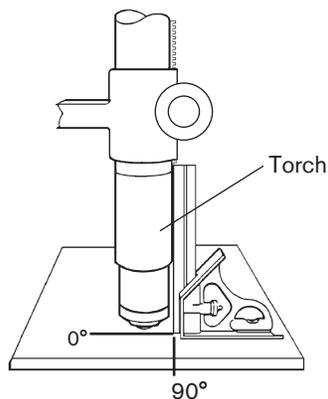


### Connecting an optional remote-start pendant

Powermax65 and Powermax85 configurations with a Duramax machine torch can include an optional remote-start pendant.

- Part number 128650: 25 foot (7.6 m)
- Part number 128651: 50 foot (15 m)
- Part number 128652: 75 foot (23 m)
- Part number 428755: 150 foot (45 m)

Remove the receptacle cover and plug the Hypertherm remote-start pendant into the receptacle on the rear of the power supply.

Note: The remote-start pendant is for use only with a machine torch. It will not operate if a handheld torch is installed.

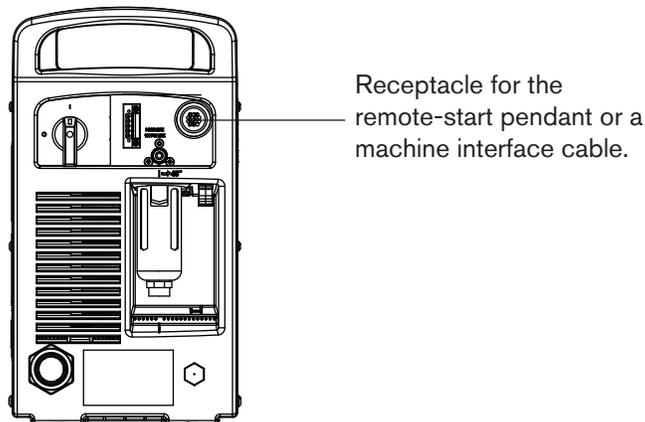

## Connecting an optional machine interface cable

The Powermax65 and Powermax85 power supplies are equipped with an optional, factory-installed, five-position voltage divider that is designed to be safely connected without tools. The built-in voltage divider provides a scaled down arc voltage of 20:1, 21.1:1, 30:1, 40:1, and 50:1 (maximum output of 18 V). An optional receptacle on the rear of the power supply provides access to the scaled down arc voltage and signals for arc transfer and plasma start.


Note: The factory presets the voltage divider to 50:1. To change the voltage divider to a different setting, refer to 3-20 *Setting the five-position voltage divider*.

**Caution:** The factory-installed internal voltage divider provides a maximum of 18 V under open circuit conditions. This is an impedance-protected functional extra low voltage (ELV) output to prevent shock, energy, and fire under normal conditions at the machine interface receptacle and under single fault conditions with the machine interface wiring. The voltage divider is not fault tolerant and ELV outputs do not comply with safety extra low voltage (SELV) requirements for direct connection to computer products.



Hypertherm offers several choices of machine interface cables for the Powermax65 and Powermax85:

- To use the built-in voltage divider that provides a scaled down arc voltage in addition to signals for arc transfer and plasma start:
  - Use part number 228350 (7.6 m, 25 ft) or 228351 (15 m, 50 ft) for wires terminated with spade connectors.
  - Use part number 123896 (15 m, 50 ft) for a cable terminated with a D-sub connector. (Compatible with Hypertherm's Edge Ti and Sensor PHC products.)
- To use signals for arc transfer and plasma start only, use either part number 023206 (7.6 m, 25 ft) or part number 023279 (15 m, 50 ft). These cables have spade connectors as shown below.

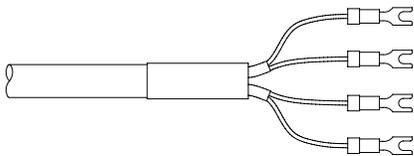

## TORCH SETUP

---

Note: The cover on the machine interface receptacle prevents dust and moisture from damaging the receptacle when not in use. This cover should be replaced if damaged or lost (part number 127204).

See the *Parts* section for more information.


Installation of the machine interface cable must be performed by a qualified service technician. To install a machine interface cable:

1. Turn OFF the power and disconnect the power cord.
2. Remove the machine interface receptacle's cover from the rear of the power supply.
3. Connect the Hypertherm machine interface cable to the power supply.
4. If you are using a cable with a D-sub connector on the other end, plug it into the appropriate pin connector on the torch height controller or CNC. Secure it with the screws on the D-sub connector.

If you are using a cable with wires and spade connectors on the other end, terminate the machine interface cable inside the electrical enclosure of listed and certified torch height controllers or CNC controllers to prevent unauthorized access to the connections after installation. Verify that the connections are correct and that all live parts are enclosed and protected before operating the equipment.

Note: The integration of Hypertherm equipment and customer-supplied equipment including interconnecting cords and cables, if not listed and certified as a system, is subject to inspection by local authorities at the final installation site.


The connector sockets for each type of signal available through the machine interface cable are shown in the figure below. The table provides details about each signal type.

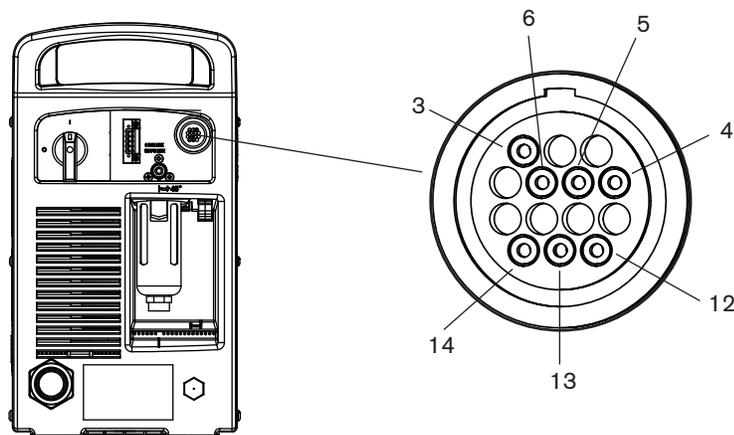


Refer to the following table when connecting the Powermax65 or Powermax85 to a torch height controller or CNC controller with a machine interface cable.

Signal	Type	Notes	Connector sockets	External cable wires	Internal cable wires
Start (start plasma)	Input	Normally open. 18 VDC open circuit voltage at START terminals. Requires dry contact closure to activate.	3	Green	Black
			4	Black	Red
Transfer (start machine motion)	Output	Normally open. Dry contact closure when the arc transfers. 120 VAC/1 A maximum at the machine interface relay or switching device (supplied by the customer).	12	Red	White
			14	Black	Green
Voltage divider	Output	Divided arc signal of 20:1, 21.1:1, 30:1, 40:1, 50:1 (provides a maximum of 18 V).	5 (-)	Black (-)	Black (-)
			6 (+)	White (+)	Red (+)
Ground	Ground		13		Green/yellow

**External cable wires**

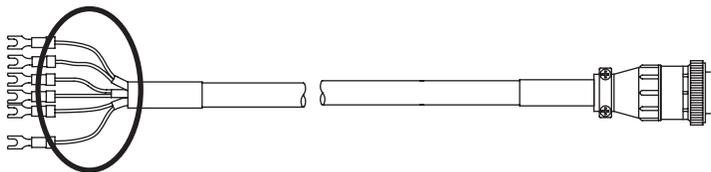

**Internal cable wires**

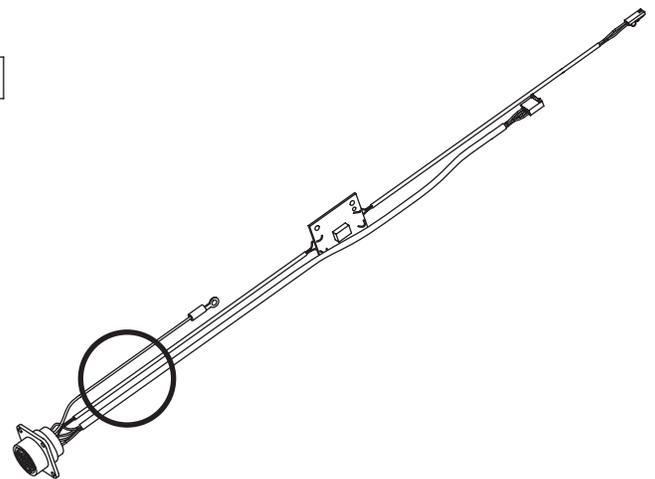


## TORCH SETUP

### Setting the five-position voltage divider


To change the factory preset voltage divider from 50:1 to a different setting:

1. Turn OFF the power supply and disconnect the power cord.
2. Remove the power supply cover.
3. Locate the voltage divider DIP switches on the left side of the power supply.

Note: The figure below shows the default setting (50:1) with the number 4 switch up.

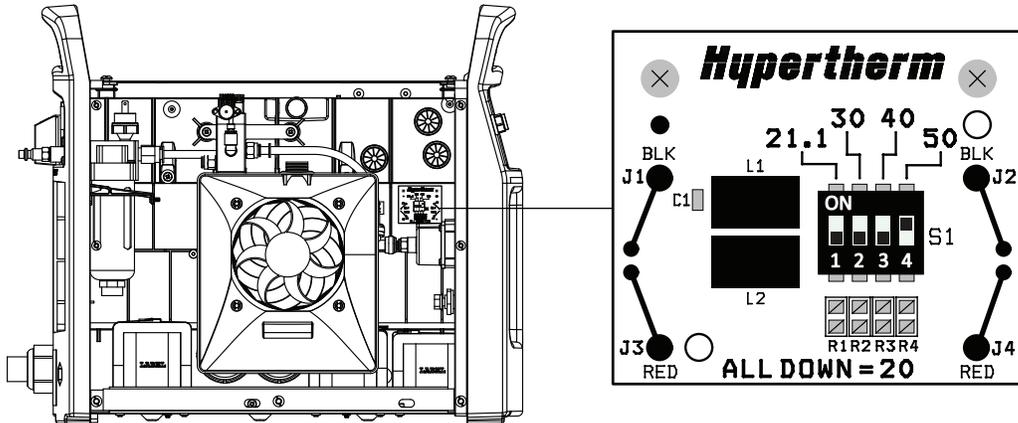

4. Set the DIP switches to one of the following settings and replace the power supply cover.

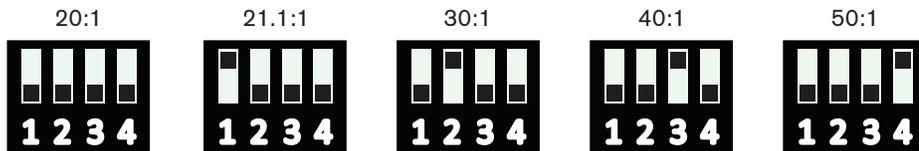

**Accessing raw arc voltage**


To access divided raw arc voltage, refer to Field Service Bulletin 807060.

**WARNING  
HIGH VOLTAGE AND CURRENT**


Connecting directly to the plasma circuit for access to raw arc voltage increases the risk of shock hazard, energy hazard, and fire hazard in the event of a single fault. The output voltage and the output current of the circuit are specified on the data plate.

### Connecting the torch lead

The Powermax65 and Powermax85 are equipped with FastConnect™, a quick-disconnect system for connecting and disconnecting handheld and machine torch leads. When connecting or disconnecting a torch, first turn OFF the system. To connect either torch, push the connector into the receptacle on the front of the power supply.

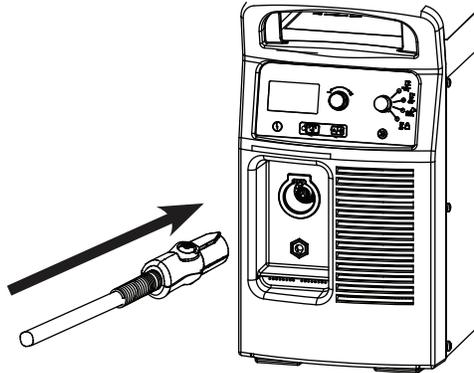

To remove the torch, press the red button on the connector and pull the connector out of the receptacle.

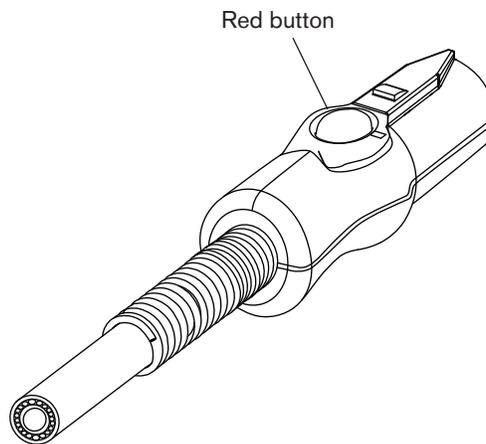

## Using the cut charts

The following sections provide cut charts for each set of mechanized consumables. A consumable diagram with part numbers precedes each set of charts. For each consumable type, there are Metric and English charts for mild steel, stainless steel, and aluminum.

Note: For cut charts on using F5 gas to cut stainless steel, refer to the *Use F5 to Cut Stainless Steel* application note (809060). You can download this document from the Documents library at [www.hypertherm.com](http://www.hypertherm.com).

Each chart contains the following information:

- Material Thickness – Thickness of the workpiece (metal plate being cut).
- Torch-to-Work Distance – For shielded consumables, the distance between the shield and the workpiece during cutting. For unshielded consumables, the distance between the nozzle and the workpiece during cutting.
- Initial Pierce Height – Distance between the shield (shielded) or the nozzle (unshielded) and the workpiece when the torch is triggered, prior to descending to the cut height.
- Pierce Delay Time – Length of time the triggered torch remains stationary at the pierce height before the torch starts the cutting motion.
- Best Quality Settings (cut speed and voltage) – Settings that provide the starting point for finding the best cut quality (best angle, least dross, best cut-surface finish). Adjust the speed for your application and table to obtain the desired result.
- Production Settings (cut speed and voltage) – 80% of the maximum speed ratings. These speeds result in the greatest number of cut parts, but not necessarily the best possible cut quality.

Note: The arc voltage increases as the consumables wear and the voltage setting should be increased to maintain the correct Torch-to-Work Distance.

Each cut chart lists hot and cold air flow rates.

- Hot air flow rate – Plasma is on, the system is operating at running current, and the system is in a steady state at the default system pressure (automatic mode).
- Cold air flow rate – Plasma is off and the system is in a steady state with air flowing through the torch at the default system pressure.

Note: Hypertherm collected the data under laboratory test conditions using new consumables.

## TORCH SETUP

### Estimated kerf-width compensation

The widths in the tables below are for reference. The data are obtained with the “Best Quality” settings. Differences between installations and material composition may cause actual results to vary from those shown in the tables.

#### Estimated kerf-width compensation – Metric (mm)

Process	Thickness (mm)									
	0.5	1	2	3	6	8	10	12	16	20
<b>Mild Steel</b>										
85A Shielded				1.7	1.8	1.9	2.0	2.2	2.4	2.6
65A Shielded			1.6	1.6	1.8	1.9	2.0	2.2	2.3	
45A Shielded	1.1	1.1	1.4	1.5	1.7					
FineCut	0.7	0.7	1.3	1.3						
85A Unshielded			1.7	1.8	1.9	2.0	2.1	2.1	2.3	
65A Unshielded			1.6	1.6	1.7	1.8	1.9	2.0		
45A Unshielded	0.5	0.9	1.3	1.3						
<b>Stainless Steel</b>										
85A Shielded				1.6	1.8	1.9	2.1	2.3	2.4	2.5
65A Shielded			1.4	1.5	1.8	1.9	2.0	2.2	2.4	
45A Shielded	0.9	1.1	1.5	1.6	1.8					
FineCut	0.6	0.6	1.0	1.4						
85A Unshielded			1.7	1.7	1.8	1.9	2.1	2.2	2.4	
65A Unshielded			1.6	1.6	1.8	1.8	1.9	2.0		
45A Unshielded	0.5	1.0	1.3	1.5	1.5					
<b>Aluminum</b>										
85A Shielded				2.0	1.9	2.0	2.1	2.2	2.4	2.6
65A Shielded			1.9	1.9	1.9	2.0	2.1	2.3	2.5	
45A Shielded		1.5	1.5	1.6	1.5					
85A Unshielded			1.9	1.9	1.9	2.0	2.0	2.1	2.2	
65A Unshielded			1.8	1.8	1.8	1.8	1.9	2.0		
45A Unshielded		1.6	1.5	1.4	1.5					


**Estimated kerf-width compensation – English (inches)**

Process	Thickness (inches)									
	22GA	18GA	14GA	10GA	3/16	1/4	3/8	1/2	5/8	3/4
<b>Mild Steel</b>										
85A Shielded				0.068	0.071	0.073	0.078	0.090	0.095	0.100
65A Shielded			0.062	0.065	0.068	0.070	0.076	0.088	0.090	0.091
45A Shielded	0.035	0.054	0.055	0.061	0.065	0.066				
FineCut	0.024	0.043	0.049	0.051						
85A Unshielded				0.070	0.073	0.075	0.080	0.085	0.090	
65A Unshielded			0.062	0.064	0.066	0.068	0.075	0.081		
45A Unshielded	0.020	0.050	0.051	0.054	0.057	0.059				
<b>Stainless Steel</b>										
85A Shielded				0.065	0.068	0.070	0.080	0.094	0.095	0.096
65A Shielded			0.056	0.062	0.068	0.073	0.076	0.090	0.093	0.096
45A Shielded	0.032	0.055	0.058	0.067	0.069	0.069				
FineCut	0.018	0.036	0.040	0.055						
85A Unshielded				0.068	0.070	0.072	0.080	0.090	0.095	
65A Unshielded			0.061	0.064	0.067	0.070	0.072	0.080		
45A Unshielded	0.020	0.054	0.052	0.060	0.058	0.058				
<b>Aluminum</b>										
		<b>1/32</b>	<b>1/16</b>	<b>1/8</b>	<b>3/16</b>	<b>1/4</b>	<b>3/8</b>	<b>1/2</b>	<b>5/8</b>	<b>3/4</b>
85A Shielded				0.080	0.078	0.075	0.080	0.090	0.095	0.100
65A Shielded			0.073	0.074	0.075	0.076	0.083	0.091	0.100	
45A Shielded		0.059	0.061	0.065		0.060				
85A Unshielded				0.075	0.075	0.075	0.080	0.082	0.088	
65A Unshielded			0.070	0.070	0.070	0.070	0.072	0.079		
45A Unshielded		0.062	0.058	0.057		0.061				

## 85 A shielded consumables




220817  
Shield

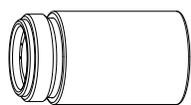


220854  
Retaining cap





220816  
Nozzle

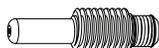


220842  
Electrode

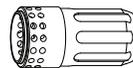

220857  
Swirl ring

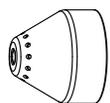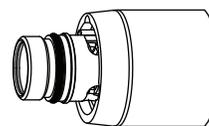


220817  
Shield

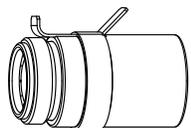


220953  
Ohmic-sensing  
retaining cap




220816  
Nozzle

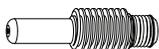

220842  
Electrode

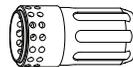

220857  
Swirl ring

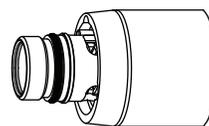

**85A Shielded  
Mild Steel**

Air flow rate - slpm/scfh	
Hot	190 / 400
Cold	235 / 500

**Metric**

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings	
					Cut Speed	Voltage	Cut Speed	Voltage
mm	mm	mm	%	seconds	(mm/min)	Volts	(mm/min)	Volts
3	1.5	3.8	250	0.1	6800	122	9200	120
4				0.2	5650	122	7300	122
6				0.5	3600	123	4400	125
8					2500	125	3100	127
10					1680	127	2070	128
12		4.5	300	0.7	1280	130	1600	130
16				1.0	870	134	930	133
20		6.0	400	1.5	570	137	680	136
25		Edge Start			350	142	450	141
30		Edge Start			200	146	300	144

**English**

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings	
					Cut Speed	Voltage	Cut Speed	Voltage
	in	in	%	seconds	ipm	Volts	ipm	Volts
10GA	0.06	0.15	250	0.2	250	122	336	121
3/16 in				0.2	185	123	220	123
1/4 in				0.5	130	123	160	126
3/8 in					70	126	86	127
1/2 in					45	131	56	131
5/8 in		0.18	300	1.0	35	134	37	133
3/4 in		0.24	400	1.5	24	136	29	135
7/8 in		Edge Start			19	139	22	138
1 in		Edge Start			13	142	17	141
1-1/8 in		Edge Start			9	145	13	143
1-1/4 in	Edge Start			7	148	10	146	

## TORCH SETUP

85A Shielded  
Stainless Steel

Air flow rate - slpm/scfh	
Hot	190 / 400
Cold	235 / 500

### Metric

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings	
					Cut Speed	Voltage	Cut Speed	Voltage
mm	mm	mm	%	seconds	(mm/min)	Volts	(mm/min)	Volts
3	1.5	3.8	250	0.1	7500	122	9200	120
4				0.2	6100	122	7500	120
6				0.5	3700	122	4600	122
8					2450	124	3050	124
10		4.5	300	1550	127	1900	126	
12				0.7	1100	131	1400	130
16				1.0	700	135	760	134
20				Edge Start		480	138	570
25		Edge Start		300	143	370	141	

### English

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings		
					Cut Speed	Voltage	Cut Speed	Voltage	
	in	in	%	seconds	ipm	Volts	ipm	Volts	
10GA	0.06	0.15	250	0.2	275	122	336	120	
3/16 in					200	122	240	121	
1/4 in				0.5	130	122	164	122	
3/8 in					65	126	80	125	
1/2 in		0.18	300	36	132	48	131		
5/8 in				1.0	28	135	30	134	
3/4 in				Edge Start		20	137	24	136
7/8 in				Edge Start		16	140	19	139
1 in		Edge Start		11	143	14	141		

**85A Shielded  
Aluminum**

Air flow rate - slpm/scfh	
Hot	190 / 400
Cold	235 / 500

**Metric**

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings	
					Cut Speed	Voltage	Cut Speed	Voltage
mm	mm	mm	%	seconds	(mm/min)	Volts	(mm/min)	Volts
3	1.5	3.8	250	0.1	8000	122	9400	121
4				0.2	6500	123	8000	123
6				0.5	3800	126	4900	126
8					2650	130	3470	129
10		4.5	300	1920	132	2500	131	
12				1450	134	1930	133	
16				950	139	1200	137	
20		Edge Start			600	143	880	141
25		Edge Start			380	146	540	144


**English**

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings			
					Cut Speed	Voltage	Cut Speed	Voltage		
	in	in	%	seconds	ipm	Volts	ipm	Volts		
1/8 in	0.06	0.15	250	0.2	300	122	360	121		
1/4 in				130	127	172	127			
3/8 in				0.5	80	132	104	131		
1/2 in					50	135	68	133		
5/8 in		0.18	300	1.0	38	139	48	137		
3/4 in				Edge Start			25	142	37	140
7/8 in				Edge Start			20	144	29	142
1 in		Edge Start			14	146	20	144		


## TORCH SETUP

---

### 65 A shielded consumables

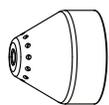


220817  
Shield

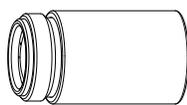


220854  
Retaining cap





220819  
Nozzle

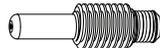


220842  
Electrode

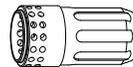

220857  
Swirl ring

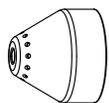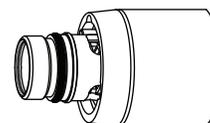


220817  
Shield

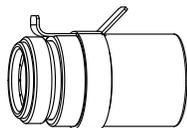

220953  
Ohmic-sensing  
retaining cap




220819  
Nozzle

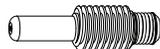

220842  
Electrode



220857  
Swirl ring

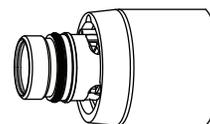

**65A Shielded  
Mild Steel**

Air flow rate - slpm/scfh	
Hot	160 / 340
Cold	220 / 470

**Metric**

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings		
					Cut Speed	Voltage	Cut Speed	Voltage	
mm	mm	mm	%	seconds	(mm/min)	Volts	(mm/min)	Volts	
3	1.5	3.8	250	0.2	5200	125	6100	123	
4				0.5	4250	125	5100	124	
6					2550	127	3240	127	
8				1700	129	2230	128		
10		4.5	300	0.7	1100	131	1500	129	
12				1.2	850	134	1140	131	
16		6.0	400	2.0	560	138	650	136	
20		Edge Start				350	142	450	142
25						210	145	270	145

**English**

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings		
					Cut Speed	Voltage	Cut Speed	Voltage	
	in	in	%	seconds	ipm	Volts	ipm	Volts	
10GA	0.06	0.15	250	0.1	190	125	224	123	
3/16 in				0.5	0.2	140	126	168	125
1/4 in					0.5	90	127	116	127
3/8 in				0.7	45	130	62	129	
1/2 in		0.18	300	1.2	30	135	40	132	
5/8 in		0.24	400	2.0	23	138	26	136	
3/4 in		Edge Start				15	141	19	141
7/8 in						12	143	14	143
1 in						8	145	10	145

## TORCH SETUP

65A Shielded  
Stainless Steel

Air flow rate - slpm/scfh	
Hot	160 / 340
Cold	220 / 470

### Metric

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings	
					Cut Speed	Voltage	Cut Speed	Voltage
mm	mm	mm	%	seconds	(mm/min)	Volts	(mm/min)	Volts
2	1.5	3.8	250	0.1	8100	125	10000	121
3				0.2	6700	125	8260	123
4				0.5	5200	125	6150	124
6					2450	126	2850	126
8				0.7	1500	129	1860	129
10		960	132		1250	132		
12		4.5	300	1.2	750	135	920	134
16		Edge Start			500	139	500	139
20		Edge Start			300	143	370	143

### English

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings	
					Cut Speed	Voltage	Cut Speed	Voltage
	in	in	%	seconds	ipm	Volts	ipm	Volts
10GA	0.06	0.15	250	0.1	240	125	296	123
3/16 in				0.2	155	126	168	125
1/4 in				0.5	80	126	96	126
3/8 in					40	131	52	131
1/2 in		0.18	300	1.2	26	136	32	135
5/8 in		Edge Start			20	139	20	139
3/4 in		Edge Start			14	142	15	142

**65A Shielded  
Aluminum**

Air flow rate - slpm/scfh	
Hot	160 / 340
Cold	220 / 470


**Metric**

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings	
					Cut Speed	Voltage	Cut Speed	Voltage
mm	mm	mm	%	seconds	(mm/min)	Volts	(mm/min)	Volts
2	1.5	3.8	250	0.1	8800	121	10300	122
3				0.2	7400	124	8800	124
4				0.5	6000	126	7350	125
6					3200	130	4400	128
8				0.7	1950	133	2750	130
10		1200	136		1650	132		
12		1000	138		1330	136		
16		4.5	300	1.2	650	143	800	141
20		Edge Start			380	147	560	145


**English**

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings		
					Cut Speed	Voltage	Cut Speed	Voltage	
	in	in	%	seconds	ipm	Volts	ipm	Volts	
1/16 in	0.06	0.15	250	0.1	365	121	428	121	
1/8 in					280	124	336	124	
1/4 in				0.5	105	131	152	128	
3/8 in					50	135	68	131	
1/2 in				0.7	35	139	48	138	
5/8 in		Edge Start			26	143	32	141	
3/4 in		16	146		24	144			

## 45 A shielded consumables

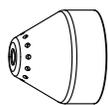


220817  
Shield

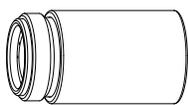


220854  
Retaining cap





220941  
Nozzle

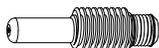


220842  
Electrode

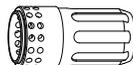

220857  
Swirl ring

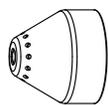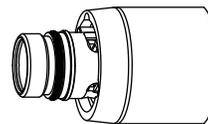


220817  
Shield

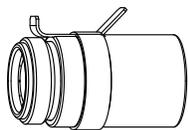


220953  
Ohmic-sensing  
retaining cap




220941  
Nozzle

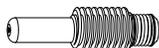

220842  
Electrode

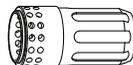

220857  
Swirl ring

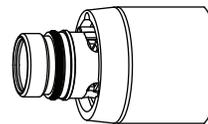

**45A Shielded  
Mild Steel**

Air flow rate - slpm/scfh	
Hot	150 / 310
Cold	210/ 450

**Metric**

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings	
					Cut Speed	Voltage	Cut Speed	Voltage
mm	mm	mm	%	seconds	(mm/min)	Volts	(mm/min)	Volts
0.5	1.5	3.8	250	0.0	9000	128	12500	126
1					9000	128	10800	128
1.5				0.1	9000	130	10200	129
2					6600	130	7800	129
3				0.4	3850	133	4900	131
4					2200	134	3560	131
6				0.5	1350	137	2050	132

**English**

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings	
					Cut Speed	Voltage	Cut Speed	Voltage
	in	in	%	seconds	ipm	Volts	ipm	Volts
26GA	0.06	0.15	250	0.0	350	128	500	128
22GA					350	128	450	128
18GA				0.1	350	129	400	128
16GA					350	130	400	129
14GA				0.2	270	130	320	129
12GA				0.4	190	133	216	131
10GA					100	134	164	131
3/16 in				0.5	70	135	108	132
1/4 in				0.6	48	137	73	132

## TORCH SETUP

45A Shielded  
Stainless Steel

Air flow rate - slpm/scfh	
Hot	150 / 310
Cold	210/ 450

### Metric

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings	
					Cut Speed	Voltage	Cut Speed	Voltage
mm	mm	mm	%	seconds	(mm/min)	Volts	(mm/min)	Volts
0.5	1.5	3.8	250	0.0	9000	130	12500	129
1					9000	130	10800	130
1.5				0.1	9000	130	10200	130
2					6000	132	8660	131
3				0.4	3100	132	4400	132
4					2000	134	2600	134
6				0.5	900	140	1020	139

### English

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings	
					Cut Speed	Voltage	Cut Speed	Voltage
	in	in	%	seconds	ipm	Volts	ipm	Volts
26GA	0.06	0.15	250	0.0	350	130	500	129
22GA					350	130	450	129
18GA				0.1	350	130	400	130
16GA					350	130	400	130
14GA				0.2	250	132	360	131
12GA				0.4	140	132	206	131
10GA					100	133	134	134
3/16 in				0.5	52	135	58	135
1/4 in				0.6	30	141	35	140

**45A Shielded  
Aluminum**

Air flow rate - slpm/scfh	
Hot	150 / 310
Cold	210/ 450

**Metric**

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings	
					Cut Speed	Voltage	Cut Speed	Voltage
mm	mm	mm	%	seconds	(mm/min)	Volts	(mm/min)	Volts
1	1.5	3.8	250	0.0	8250	136	11000	136
2				0.1	6600	136	9200	135
3				0.2	3100	139	6250	134
4				0.4	2200	141	4850	135
6				0.5	1500	142	2800	137

**English**


Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings	
					Cut Speed	Voltage	Cut Speed	Voltage
	in	in	%	seconds	ipm	Volts	ipm	Volts
1/32 in	0.06	0.15	250	0.0	325	136	450	136
1/16 in				0.1	325	136	400	136
3/32 in				0.2	200	136	328	134
1/8 in				0.4	100	140	224	134
1/4 in				0.5	54	142	96	137

### FineCut® consumables

Note: The cut charts in this section apply to both shielded and unshielded consumables.




220948  
Shield

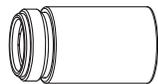


220953  
Retaining cap




220930  
Nozzle

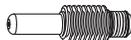


220842  
Electrode

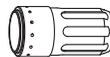

220947  
Swirl ring

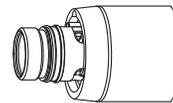


220955  
Deflector

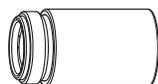

220854  
Retaining cap




220930  
Nozzle

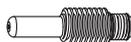

220842  
Electrode



220947  
Swirl ring

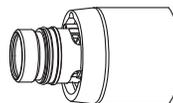

**FineCut  
Mild Steel**

Air flow rate - slpm/scfh	
Hot	155 / 330
Cold	215 / 460

**Metric**

Material Thickness	Amps	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		
						Cut Speed	Voltage	
mm	A	mm	mm	%	seconds	(mm/min)	Volts	
0.5	40	1.5	3.8	250	0.0	8250	78	
0.6						8250	78	
0.8						8250	78	
1	45				0.2	8250	78	
1.5						0.4	6400	78
2							4800	78
3					0.5	2500	78	
4	0.6					1900	78	

**English**

Material Thickness	Amps	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		
						Cut Speed	Voltage	
	A	in	in	%	seconds	ipm	Volts	
26GA	40	0.06	0.15	250	0.0	325	78	
24GA						325	78	
22GA						325	78	
20GA	45				0.1	325	78	
18GA						0.2	325	78
16GA							0.4	250
14GA					200	78		
12GA	0.5				120	78		
10GA		95	78					

## TORCH SETUP

**FineCut**  
**Stainless Steel**

Air flow rate - slpm/scfh	
Hot	155 / 330
Cold	215 / 460

**Metric**

Material Thickness	Amps	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		
						Cut Speed	Voltage	
mm	A	mm	mm	%	seconds	(mm/min)	Volts	
0.5	40	0.5	2.0	400	0.0	8250	68	
0.6						8250	68	
0.8						8250	68	
1	45				0.1	8250	68	
1.5						0.2	6150	70
2							4800	71
3					0.5	2550	80	
4						1050	84	

**English**

Material Thickness	Amps	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		
						Cut Speed	Voltage	
	A	in	in	%	seconds	ipm	Volts	
26GA	40	0.02	0.08	400	0.0	325	68	
24GA						325	68	
22GA						325	68	
20GA	45				0.1	325	68	
18GA						0.2	325	68
16GA					0.4		240	70
14GA							200	70
12GA					0.5	120	80	
10GA	75	80						

**Low Speed FineCut  
Mild Steel**

Air flow rate – slpm/scfh	
Hot	155 / 330
Cold	215 / 460

**Metric**

Material Thickness	Current	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Recommended	
						Cut Speed	Voltage
mm	A	mm	mm	%	seconds	(mm/min)	Volts
0.5	30	1.5	3.8	250	0.0	3800	69
0.6						3800	68
0.8					0.1	3800	70
1 *	0.2					3800	72
1.5 *					0.4	3800	75
2	45					3700	76
3					0.5	2750	78
4						0.6	1900

**English**

Material Thickness	Current	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Recommended	
						Cut Speed	Voltage
	A	inches	inches	%	seconds	ipm	Volts
26GA	30	0.06	0.15	250	0.0	150	70
24GA						150	68
22GA					0.1	150	70
20GA	150					71	
18GA	40				0.2	150	73
16GA *						0.4	150
14GA *	45				0.5		150
12GA						120	78
10GA		95	78				

\*Not a dross-free cut.

## TORCH SETUP

Low Speed FineCut  
Stainless Steel

Air flow rate – slpm/scfh	
Hot	155 / 330
Cold	215 / 460


Metric

Material Thickness	Current	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Recommended		
						Cut Speed	Voltage	
mm	A	mm	mm	%	seconds	(mm/min)	Volts	
0.5	30	0.5	2.0	400	0.0	3800	69	
0.6						3800	69	
0.8						3800	69	
1	40				0.15	3800	69	
1.5						0.4	2900	69
2							2750	69
3	45				0.5	2550	80	
4						1050	80	

English

Material Thickness	Current	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Recommended		
						Cut Speed	Voltage	
	A	in	in	%	seconds	ipm	Volts	
26GA	30	0.02	0.08	400	0.0	150	69	
24GA						150	69	
22GA					0.1	150	69	
20GA						150	69	
18GA	40				0.2	145	69	
16GA						0.4	115	69
14GA							110	69
12GA	45				0.5	120	80	
10GA		0.6	75	80				

**85 A unshielded consumables**

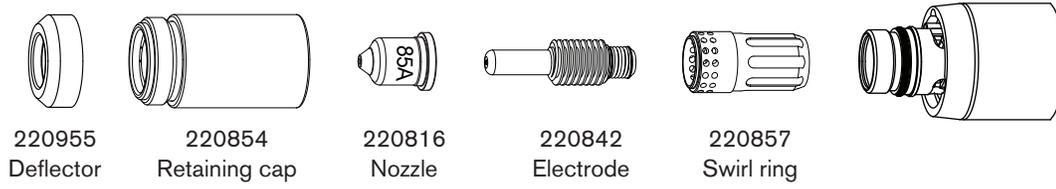

## TORCH SETUP

85A Unshielded  
Mild Steel

Air flow rate - slpm/scfh	
Hot	190 / 400
Cold	235 / 500

### Metric

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings			
					Cut Speed	Voltage	Cut Speed	Voltage		
mm	mm	mm	%	seconds	(mm/min)	Volts	(mm/min)	Volts		
3	2.0	5.0	250	0.1	6240	118	9000	117		
4				0.2	5250	118	7200	117		
6				0.5	3450	120	4400	119		
8					2400	121	3100	121		
10		6.0	300	0.7	1560	123	2070	122		
12					1200	126	1600	124		
16					Edge Start		820	132	930	128
20							540	137	640	132
25							320	143	400	137

### English

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings	
					Cut Speed	Voltage	Cut Speed	Voltage
	in	in	%	seconds	ipm	Volts	ipm	Volts
10GA	0.08	0.20	250	0.2	230	118	328	117
3/16 in					175	119	220	118
1/4 in				0.5	125	120	160	119
3/8 in					65	122	86	122
1/2 in		0.24	300	0.6	42	127	56	125
5/8 in		Edge Start		33	131	37	128	
3/4 in				23	136	27	131	
7/8 in				18	140	21	134	
1 in				12	144	15	138	

**85A Unshielded  
Stainless Steel**

Air flow rate - slpm/scfh	
Hot	190 / 400
Cold	235 / 500

**Metric**

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings	
					Cut Speed	Voltage	Cut Speed	Voltage
mm	mm	mm	%	seconds	(mm/min)	Volts	(mm/min)	Volts
2	2.0	5.0	250	0.1	8550	117	11300	116
3					7000	118	9660	117
4				5600	118	7800	118	
6				3400	120	4570	121	
8		0.5	2250	121	2970	122		
10			6.0	300	1430	123	1840	124
12		1000			129	1340	128	
16		Edge Start			650	134	730	133
20		Edge Start			360	138	570	137

**English**

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings	
					Cut Speed	Voltage	Cut Speed	Voltage
	in	in	%	seconds	ipm	Volts	ipm	Volts
10GA	0.08	0.20	250	0.2	250	118	352	118
3/16 in					180	119	249	119
1/4 in				120	120	160	121	
3/8 in				60	122	77	123	
1/2 in		0.24	300	0.6	35	131	46	129
5/8 in					Edge Start			26
3/4 in		Edge Start			17	137	24	136

## TORCH SETUP

85A Unshielded  
Aluminum

Air flow rate - slpm/scfh	
Hot	190 / 400
Cold	235 / 500


### Metric

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings	
					Cut Speed	Voltage	Cut Speed	Voltage
mm	mm	mm	%	seconds	(mm/min)	Volts	(mm/min)	Volts
2	2.0	5.0	250	0.1	8700	118	11200	118
3					7350	120	9600	119
4				6000	122	8100	120	
6				3300	125	4930	122	
8		6.0	300	0.5	2350	127	3250	124
10					1800	128	2140	127
12		Edge Start			1300	133	1720	130
16					840	139	1130	134
20					470	144	700	138

### English

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings	
					Cut Speed	Voltage	Cut Speed	Voltage
	in	in	%	seconds	ipm	Volts	ipm	Volts
1/8 in	0.08	0.20	250	0.2	280	120	368	119
3/16 in					200	123	271	120
1/4 in				110	126	172	122	
3/8 in				75	127	88	126	
1/2 in		0.24	300	0.6	45	135	62	131
5/8 in		Edge Start			34	139	45	134
3/4 in					22	143	32	137

65 A unshielded consumables

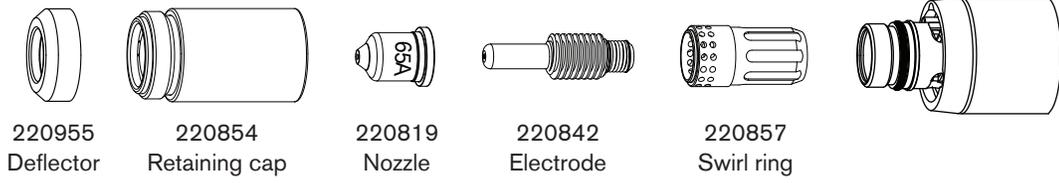

## TORCH SETUP

65A Unshielded  
Mild Steel

Air flow rate - slpm/scfh	
Hot	160 / 340
Cold	220 / 470

### Metric

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings	
					Cut Speed	Voltage	Cut Speed	Voltage
mm	mm	mm	%	seconds	(mm/min)	Volts	(mm/min)	Volts
3	2.0	5.0	250	0.2	5200	118	6330	118
4				0.5	4250	118	5250	118
6					2550	120	3560	120
8				1620	123	2230	121	
10		6.0	300	0.7	970	127	1500	122
12		Edge Start			760	129	1140	124
16					500	134	650	129
20					280	138	400	133

### English

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings	
					Cut Speed	Voltage	Cut Speed	Voltage
	in	in	%	seconds	ipm	Volts	ipm	Volts
10GA	0.08	0.20	250	0.1	190	118	232	118
3/16 in				0.5	135	119	172	119
1/4 in					90	120	116	120
3/8 in				0.24	300	0.7	40	126
1/2 in		Edge Start			27	130	40	125
5/8 in					20	134	26	129
3/4 in					13	137	18	132

**65A Unshielded  
Stainless Steel**

Air flow rate - slpm/scfh	
Hot	160 / 340
Cold	220 / 470

**Metric**

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings	
					Cut Speed	Voltage	Cut Speed	Voltage
mm	mm	mm	%	seconds	(mm/min)	Volts	(mm/min)	Volts
2	2.0	5.0	250	0.1	7950	117	10300	116
3				0.2	6600	118	8500	117
4				0.5	5050	119	6500	119
6					2300	121	3070	121
8		0.7	1400	123	1900	122		
10		6.0	300	0.7	920	126	1250	123
12		Edge Start			710	130	925	127
16		Edge Start			430	135	500	133

**English**

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings	
					Cut Speed	Voltage	Cut Speed	Voltage
	in	in	%	seconds	ipm	Volts	ipm	Volts
10GA	0.08	0.20	250	0.1	235	118	304	118
3/16 in				0.2	150	120	194	120
1/4 in				0.5	75	121	100	121
3/8 in		0.24	300		0.7	38	125	52
1/2 in		Edge Start			25	132	32	129
5/8 in		Edge Start			17	135	20	133

## TORCH SETUP

65A Unshielded  
Aluminum

Air flow rate - slpm/scfh	
Hot	160 / 340
Cold	220 / 470


### Metric

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings	
					Cut Speed	Voltage	Cut Speed	Voltage
mm	mm	mm	%	seconds	(mm/min)	Volts	(mm/min)	Volts
2	2.0	5.0	250	0.1	7750	123	11300	122
3				0.2	6550	124	9500	123
4				0.5	5400	125	7640	124
6					3000	127	3900	126
8				0.7	1800	130	2460	127
10		6.0	300	0.7	1100	133	1640	129
12		Edge Start			900	135	1250	133
16		Edge Start			600	139	700	136

### English

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings	
					Cut Speed	Voltage	Cut Speed	Voltage
	in	in	%	seconds	ipm	Volts	ipm	Volts
1/16 in	0.08	0.20	250	0.1	325	122	476	122
1/8 in					250	124	360	123
3/16 in					175	125	245	124
1/4 in				0.5	100	127	128	126
3/8 in					0.24	300	0.7	45
1/2 in		Edge Start			32	136	44	134
5/8 in		Edge Start			24	138	28	136

**45 A unshielded consumables**

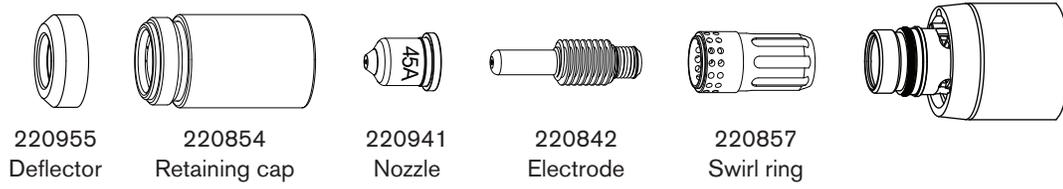

## TORCH SETUP

45A Unshielded  
Mild Steel

Air flow rate - slpm/scfh	
Hot	150 / 310
Cold	210 / 450

### Metric

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings	
					Cut Speed	Voltage	Cut Speed	Voltage
mm	mm	mm	%	seconds	(mm/min)	Volts	(mm/min)	Volts
0.5	1.5	3.8	250	0.0	9000	120	12500	120
1					9000	120	10800	121
1.5				7700	120	10200	121	
2				6150	119	7800	122	
3				0.4	3950	121	4900	123
4					2350	123	3560	124
6				0.5	1400	126	2050	124

### English

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings	
					Cut Speed	Voltage	Cut Speed	Voltage
	in	in	%	seconds	ipm	Volts	ipm	Volts
26GA	0.06	0.15	250	0.0	350	120	500	120
22GA					350	120	450	120
18GA				0.1	350	119	400	121
16GA					300	121	400	121
14GA				0.2	250	119	320	122
12GA				0.4	200	120	216	123
10GA					100	123	164	124
3/16 in				0.5	85	122	108	124
1/4 in				0.6	48	127	73	124

**45A Unshielded  
Stainless Steel**

Air flow rate - slpm/scfh	
Hot	150 / 310
Cold	210 / 450

**Metric**

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings	
					Cut Speed	Voltage	Cut Speed	Voltage
mm	mm	mm	%	seconds	(mm/min)	Volts	(mm/min)	Volts
0.5	1.5	3.8	250	0.0	9000	121	12500	119
1					9000	121	10800	119
1.5				0.1	9000	121	10200	120
2					6000	122	9600	120
3				0.4	3250	123	4750	120
4					1900	128	3000	122
6				0.5	700	130	1450	124

**English**

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings	
					Cut Speed	Voltage	Cut Speed	Voltage
	in	in	%	seconds	ipm	Volts	ipm	Volts
26GA	0.06	0.15	250	0.0	350	120	500	119
22GA					350	120	450	119
18GA				0.1	350	118	400	119
16GA					350	121	400	120
14GA				0.2	300	122	400	120
12GA				0.4	150	121	224	120
10GA					100	125	140	121
3/16 in				0.5	42	131	88	123
1/4 in				0.6	25	130	48	124

## TORCH SETUP

45A Unshielded  
Aluminum

Air flow rate - slpm/scfh	
Hot	150 / 310
Cold	210 / 450

Metric

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings	
					Cut Speed	Voltage	Cut Speed	Voltage
mm	mm	mm	%	seconds	(mm/min)	Volts	(mm/min)	Volts
1	1.5	3.8	250	0.0	7400	126	11000	121
2				0.1	4400	127	9200	123
3				0.2	2800	129	6250	125
4				0.4	2100	132	4700	126
6				0.5	1050	135	2250	127

English

Material Thickness	Torch-to-Work Distance	Initial Pierce Height		Pierce Delay Time	Best Quality Settings		Production Settings	
					Cut Speed	Voltage	Cut Speed	Voltage
	in	in	%	seconds	ipm	Volts	ipm	Volts
1/32 in	0.06	0.15	250	0.0	325	126	450	121
1/16 in				0.1	200	126	400	122
3/32 in				0.2	150	127	328	124
1/8 in				0.4	100	130	224	125
1/4 in				0.5	36	136	72	127

## Section 4

### OPERATION

---


*In this section:*

Controls and indicators .....	4-2
Rear controls .....	4-2
Front controls and LEDs .....	4-2
Status screen .....	4-4
Operating the Powermax65 or Powermax85 .....	4-6
Connect the electrical power, gas supply, and torch lead .....	4-6
Attach the work lead to the power supply .....	4-7
Attach the work clamp to the workpiece .....	4-8
Turn ON the system .....	4-9
Set the operating mode switch .....	4-9
Check the indicators .....	4-10
Manually adjusting the gas pressure .....	4-10
Adjusting the current (amperage) .....	4-11
Understanding duty-cycle limitations .....	4-12
Using the hand torch .....	4-13
Operate the safety trigger .....	4-13
Hand torch cutting hints .....	4-14
Start a cut from the edge of the workpiece .....	4-15
Pierce a workpiece .....	4-16
Gouge a workpiece .....	4-17
Common hand-cutting faults .....	4-20
Using the machine torch .....	4-21
Ensure the torch and table are set up correctly .....	4-21
Understand and optimize cut quality .....	4-21
To pierce a workpiece using the machine torch .....	4-23
Common machine-cutting faults .....	4-24

## Controls and indicators

The Powermax65 and Powermax85 power supplies have the following: ON/OFF switch, adjustment knob, automatic/manual pressure setting mode selector, current/gas selector, operating mode switch, indicator LEDs, and a status screen.


### Rear controls

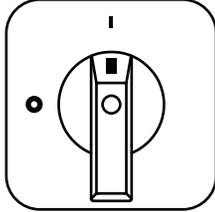

#### ON (I)/OFF (O) power switch

Activates the power supply and its control circuits.

### Front controls and LEDs

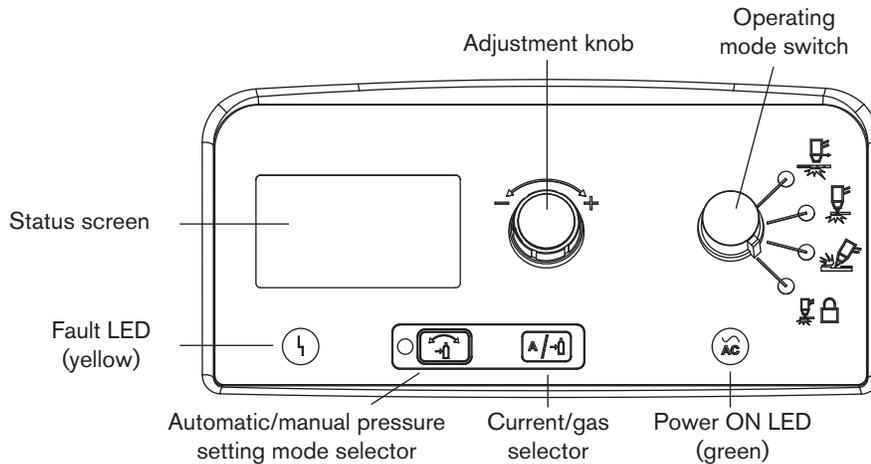


#### Fault LED (yellow)

When illuminated, this LED indicates that there is a fault with the power supply. For information about these fault conditions and how to correct them, refer to section 5.



#### Power ON LED (green)

When illuminated, this LED indicates that the power switch has been set to I (ON) and that the safety interlocks are satisfied. When blinking, the power supply has a fault.

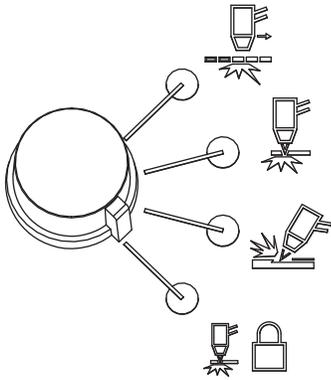

**Operating mode switch**

The operating mode switch can be set in one of four positions:

- Continuous pilot arc. Cuts expanded metal or grate.
- Non-continuous pilot arc. Cuts or pierces metal plate. This is the standard setting for normal drag-cutting.
- Gouge. Gouges metal plate.
- Torch lock. Same as the non-continuous pilot arc mode except the torch is locked in the ON position when you release the trigger during a cut.




**Automatic/manual pressure setting mode selector**

The selector switches between automatic and manual mode. In automatic mode, the power supply automatically sets the gas pressure based upon the torch type and lead length and the adjustment knob sets only the amperage. In manual mode, the adjustment knob sets either the gas pressure or the amperage. This LED is illuminated in manual mode.

Note: Manual mode should be used by experienced users who need to optimize the gas setting (override the automatic gas setting) for a specific cutting application.


When you switch from manual mode to automatic mode, the power supply automatically sets the gas pressure and the amperage setting is unchanged. When you switch from automatic mode to manual mode, the power supply remembers the previous manual gas pressure setting and the amperage setting is unchanged.

When you reset the power, the power supply remembers the previous mode, gas pressure, and amperage settings.

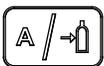

**Current/gas selector**

When in manual mode, this selector toggles between amperage and gas pressure for manual adjustments using the adjustment knob.

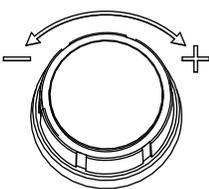


**Adjustment knob**

This knob adjusts the amperage. When operating in manual mode, this knob can also adjust the gas pressure, overriding the automatic setting for optimized applications.


## Status screen

The status screen shows system status and fault information.

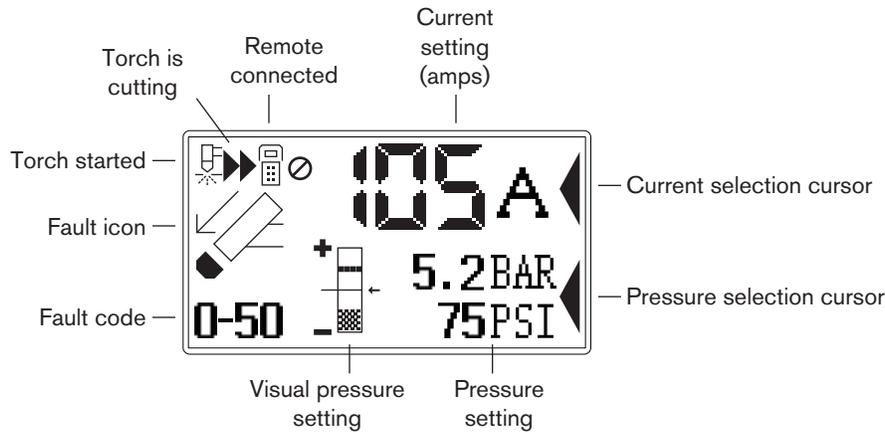

## Gas pressure indicators

In manual mode, the gas pressure is displayed in bar and psi. The gas pressure bar is also a visual indicator of the gas pressure.

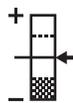

### Gas pressure bar

When the arrow is centered in the vertical bar (the reference pressure of the automatic pressure setting), the gas pressure is set to the preset (factory-defined) value. If the pressure is higher than the preset value, the arrow appears above the mid-point of the bar. If the pressure is lower than the preset value, the arrow appears below the mid-point of the bar.

Note: In automatic mode, the power supply adjusts the pressure to the preset value. You can use manual mode to adjust the pressure to satisfy the needs of a particular cutting job. Refer to 4-10 *Manually adjusting the gas pressure*.

## System status icons

The screen displays icons to indicate the system's status.



### Torch started

Indicates that the torch has received a start signal and has initiated a pilot arc.



### Torch is cutting

Indicates that the cutting arc has transferred to the metal and the torch is cutting.



### Remote control

Indicates that a remote control is controlling the power supply. All local controls are disabled.

## Fault codes

When a power supply or torch fault occurs, the system displays a fault code in the lower-left corner of the status screen and displays a corresponding fault icon above the code. The first digit is always zero. The other two digits identify the problem. Refer to section 5 for troubleshooting information.

Note: Only one fault code is displayed. If more than one fault occurs at the same time, only the fault code with the highest priority is displayed.

## Fault icons

The fault icons that appear on the left side of the status screen are described below. A fault code also appears to identify the fault. Refer to section 5 for troubleshooting information.



### Warning

The system continues to run.



### Fault

The system stops cutting. If you can not correct the problem and restart the system, contact your distributor or Hypertherm Technical Service.



### Error

The system requires service. Contact your distributor or Hypertherm Technical Service.



### Torch cap sensor

Indicates that the consumables are loose, improperly installed, or missing. Turn OFF the power, properly install the consumables, and turn ON the system again to reset the power supply.




### Temperature

Indicates that the temperature of the power supply power module is outside the acceptable operating range.



### Gas

Indicates that the gas is disconnected from the rear of the power supply or there is a problem with the gas supply.

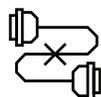

### Internal Serial Communications Interface

Indicates a problem with the SCl communications between the control board and the DSP board.


### Operating the Powermax65 or Powermax85

Follow the steps below to begin cutting or gouging with the Powermax65 or Powermax85.

#### Connect the electrical power, gas supply, and torch lead

For information on connecting the proper power cord with plug to the power supply, refer to Section 2, *Power Supply Setup*.

Plug in the power cord and connect the gas supply line. For more information about the electrical requirements and the gas supply requirements of the Powermax65 and Powermax85, see Section 2, *Power Supply Setup*. To connect the torch, push the FastConnect™ connector into the receptacle on the front of the power supply. You will attach the work lead in the next section.

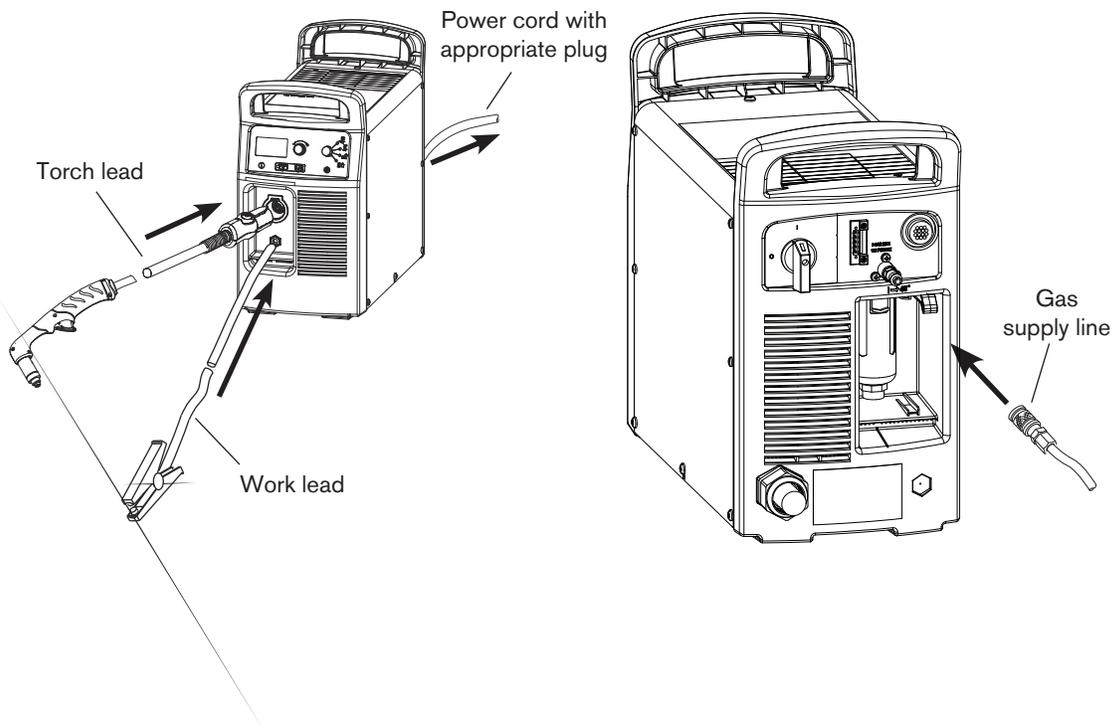


## Attach the work lead to the power supply



**Caution: Make sure you use a work lead that is appropriate for your power supply. Use a 65 A work lead with the Powermax65. Use an 85 A work lead with the Powermax85. The amperage is marked near the rubber boot of the work lead connector.**

1. Insert the work lead connector into the receptacle on the front of the power supply.

Note: The receptacle is keyed. Align the key on the work lead connector with the opening at the top of the receptacle on the power supply.

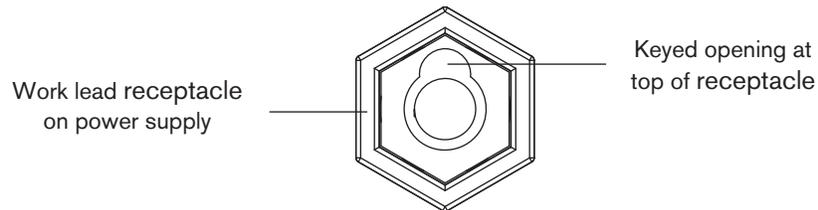

2. Push the work lead connector all the way into the receptacle on the power supply and turn clockwise, approximately 1/4 turn, until the connector is fully seated against the stop in order to achieve an optimal electrical connection.




**Caution: Ensure the work lead is fully seated in the receptacle to prevent overheating.**

### Attach the work clamp to the workpiece

The work clamp must be connected to the workpiece while you are cutting. If you are using the Powermax65 or Powermax85 with a cutting table, you can connect the work lead directly to the table instead of attaching the work clamp to the workpiece. See your table manufacturer's instructions.

Note the following:


- Ensure that the work clamp and the workpiece make good metal-to-metal contact. Remove rust, dirt, paint, coatings, and other debris to ensure the power supply makes proper contact with the workpiece.
- For the best cut quality, attach the work clamp as close as possible to the area being cut.
- **Do not attach the work clamp to the portion of the workpiece to be cut away.**

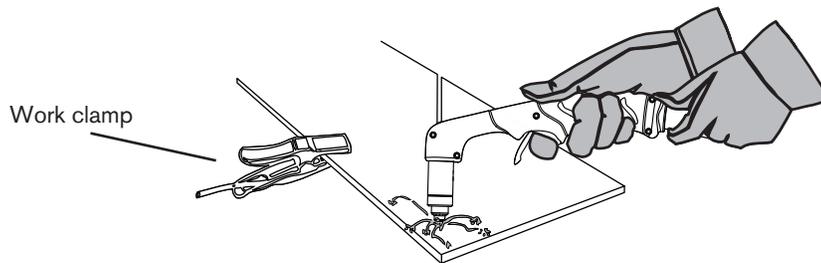

**Caution: Do not attach the work clamp under water. If the power supply is below the work clamp, water can enter the power supply via the work lead and cause severe damage.**

**Turn ON the system**


Set the ON/OFF switch to the ON (I) position.

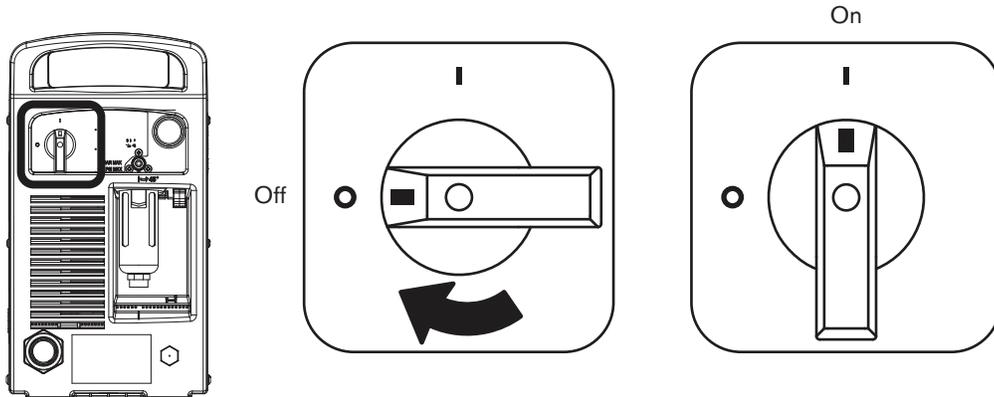

**Set the operating mode switch**

Use the operating mode switch to select the type of work you want to perform.

In automatic gas mode, Smart Sense™ technology automatically adjusts the gas pressure according to the selected cutting mode and torch lead length for optimum cutting.

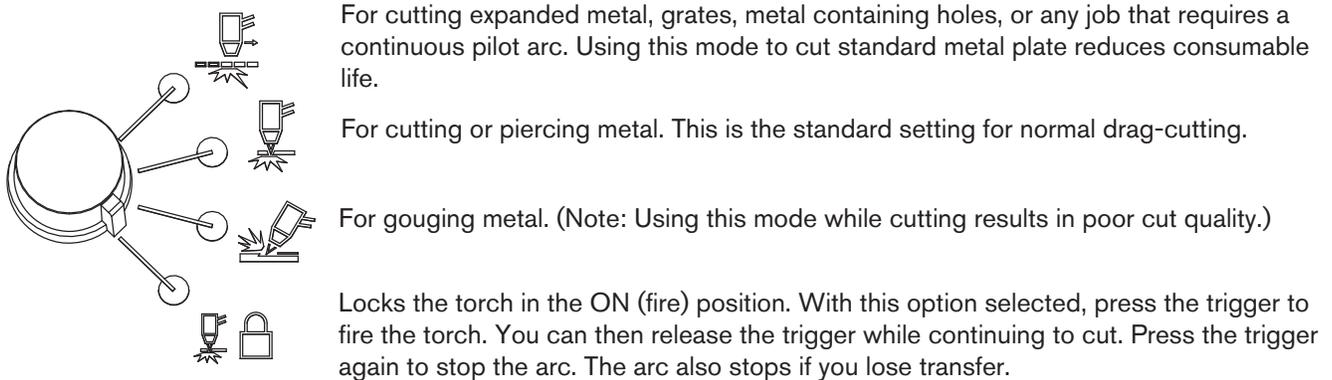

### Check the indicators

Verify the following:

- The green power ON LED on the front of the power supply is illuminated.
- The Fault LED is *not* illuminated.
- No error icons appear in the status screen.

If a fault icon appears in the status screen, or the Fault LED is illuminated, or the power ON LED is blinking, correct the fault condition before continuing. Refer to Section 5 for troubleshooting information.

### Manually adjusting the gas pressure

For normal operations, the power supply automatically adjusts the gas pressure. If you need to adjust the gas pressure for a specific application, you can use manual mode to do so.

Note: Manual mode should be used by experienced users who need to optimize the gas setting (override the automatic gas setting) for a specific cutting application.

When you switch from manual mode to automatic mode, the power supply automatically sets the gas pressure and the amperage setting is unchanged. When you switch from automatic mode to manual mode, the power supply remembers the previous manual gas pressure setting and the amperage setting is unchanged.

When you reset the power, the power supply remembers the previous mode, gas pressure, and amperage settings.

To adjust the pressure:

1. Press the automatic/manual pressure setting mode selector so that the LED next to the selector illuminates. Refer to the diagram in 4-2 *Front controls and LEDs*.
2. Press the current/gas selector until the selection cursor is opposite the gas pressure setting in the status screen.
3. Turn the adjustment knob to adjust the gas pressure to the desired level. Watch the arrow in the pressure bar as you adjust the pressure.

## **Adjusting the current (amperage)**

Turn the adjustment knob to adjust the current for your particular cutting application.

If the system is in manual mode, do the following to adjust the amperage.

1. Press the current/gas selector until the selection cursor is opposite the amperage setting in the status screen.
2. Turn the adjustment knob to change the amperage.
3. If you wish to exit manual mode, press the automatic/manual pressure setting mode selector. The LED goes off.

Note: When you exit manual mode, the gas pressure resets to the factory-optimized value.

When you switch between manual mode and automatic mode, the power supply retains the amperage setting. When you reset the power, the power supply returns to the previous mode (automatic mode or manual mode) and remembers the previous amperage setting.

### Understanding duty-cycle limitations

The duty cycle is the amount of time, in minutes, that a plasma arc can remain on within a 10-minute period when operating at an ambient temperature of 104° F (40° C).

With a Powermax65:

- At 65 A, the arc can remain on for 5 minutes out of 10 minutes without causing the unit to overheat (50% duty cycle).
- At 59 A, the arc can remain on for 6 minutes out of 10 (60%).
- At 46 A, the arc can remain on for 10 minutes out of 10 (100%).

With a Powermax85:

- At 85 A, the arc can remain on for 6 minutes out of 10 minutes without causing the unit to overheat (60% duty cycle).
- At 74 A, the arc can remain on for 8 minutes out of 10 (80%)
- At 66 A, the arc can remain on for 10 minutes out of 10 (100%).

If the duty cycle is exceeded, the power supply overheats, the temperature fault icon appears in the status screen, the arc shuts off, and the cooling fan continues to run. You can not resume cutting until the temperature fault icon disappears and the fault LED goes off.

## Using the hand torch



**WARNING**  
**INSTANT-ON TORCHES**  
**PLASMA ARC CAN CAUSE INJURY AND BURNS**


Plasma arc comes on immediately when the torch trigger is activated.

The plasma arc will cut quickly through gloves and skin.

- Wear correct and appropriate protective equipment.
- Keep away from the torch tip.
- Do not hold the workpiece and keep your hands clear of the cutting path.
- Never point the torch toward yourself or others.


## Operate the safety trigger

The hand torches are equipped with a safety trigger to prevent accidental firings. When you are ready to use the torch, flip the trigger's safety cover forward (toward the torch head) and press the red torch trigger as shown below.

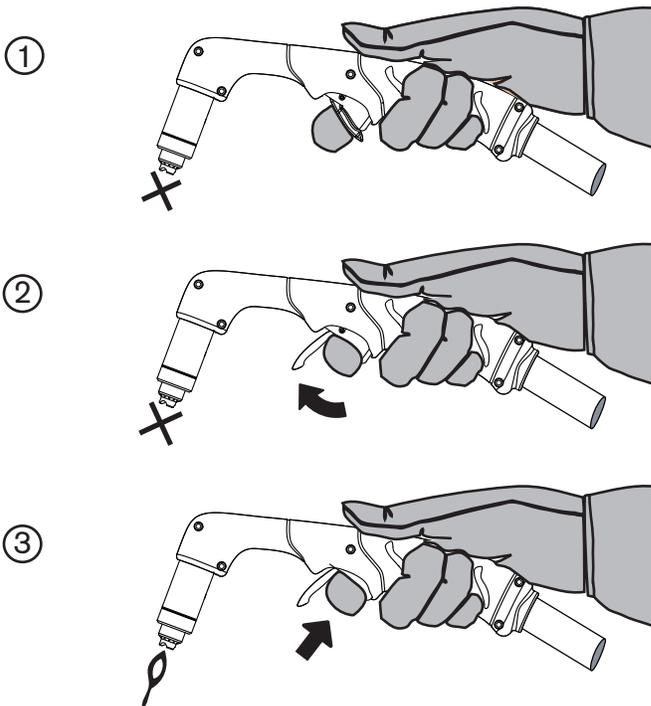

### Hand torch cutting hints

- Drag the torch tip lightly along the workpiece to maintain a steady cut.
- While cutting, make sure that sparks exit from the bottom of the workpiece. The sparks should lag slightly behind the torch as you cut ( $15^{\circ}$  —  $30^{\circ}$  angle from vertical).
- If sparks spray up from the workpiece, move the torch more slowly, or set the output current higher.
- With either the 75-degree or 15-degree hand torch, hold the torch nozzle perpendicular to the workpiece so that the nozzle is at a  $90^{\circ}$  angle to the cutting surface. Observe the cutting arc as the torch cuts.

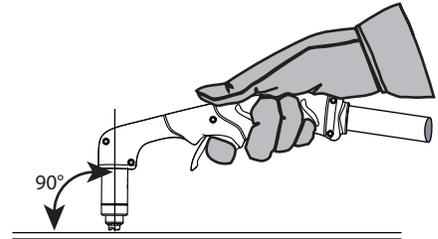


- If you fire the torch unnecessarily, you will shorten the life of the nozzle and electrode.




- Pulling, or dragging, the torch along the cut is easier than pushing it.
- For straight-line cuts, use a straight edge as a guide. To cut circles, use a template or a radius cutter attachment (a circle cutting guide). See the *Parts* section for part numbers for the Hypertherm plasma cutting guides for cutting circles and making bevel cuts.


## Start a cut from the edge of the workpiece

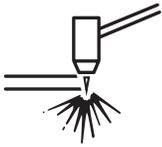

1. With the work clamp attached to the workpiece, hold the torch nozzle perpendicular (90°) to the edge of the workpiece.

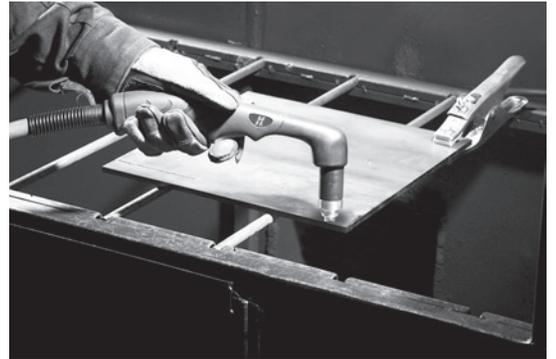

2. Press the torch's trigger to start the arc. Pause at the edge until the arc has cut completely through the workpiece.

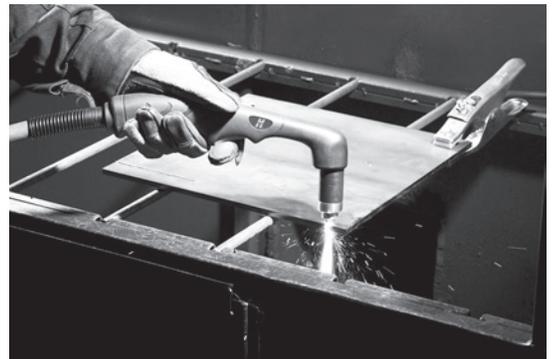


3. Drag the torch tip lightly across the workpiece to proceed with the cut. Maintain a steady, even pace.



## OPERATION


### Pierce a workpiece

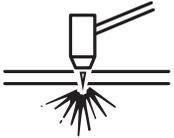

#### WARNING

**SPARKS AND HOT METAL CAN INJURE EYES AND BURN SKIN. When firing the torch at an angle, sparks and hot metal will spray out from the nozzle. Point the torch away from yourself and others.**

1. With the work clamp attached to the workpiece, hold the torch at an approximate 30° angle to the workpiece with the torch tip within 1/16 inch (1.5 mm) of the workpiece before firing the torch.
2. Fire the torch while still at an angle to the workpiece. Slowly rotate the torch to a perpendicular (90°) position.
3. Hold the torch in place while continuing to press the trigger. When sparks exit below the workpiece, the arc has pierced the material.
4. When the pierce is complete, drag the nozzle lightly along the workpiece to proceed with the cut.

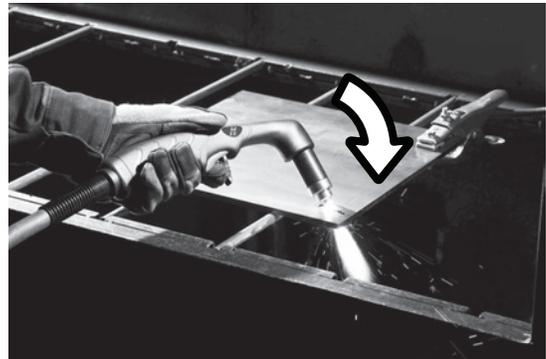


## Gouge a workpiece


**WARNING**

**SPARKS AND HOT METAL CAN INJURE EYES AND BURN SKIN. When firing the torch at an angle, sparks and hot metal will spray out from the nozzle. Point the torch away from yourself and others.**

1. Hold the torch so that the torch tip is within 1/16 inch (1.5 mm) from the workpiece before firing the torch.

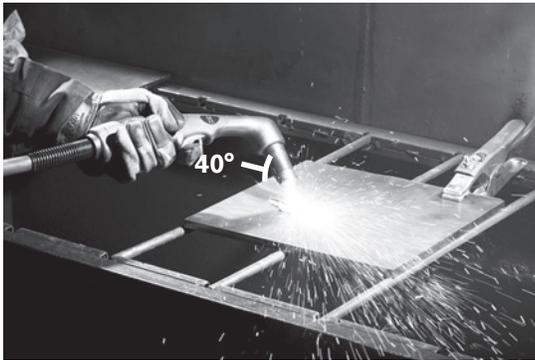

2. Hold the torch at a 40° angle with the nozzle about 1/4 — 1/2 inch (6 — 12 mm) from the workpiece. Press the trigger to obtain a pilot arc. Transfer the arc to the workpiece.

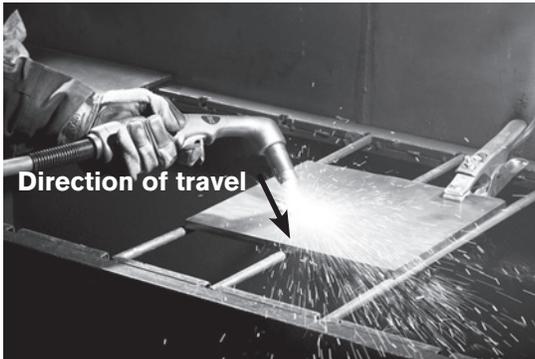

3. Pull the torch back and stretch the arc to 1-1/4 inch (32 mm). Push the plasma arc in the direction of the gouge you want to create. Increase standoff to create a shallower and wider gouge.


Keep a small distance between the torch tip and the molten metal to avoid reducing consumable life or damaging the torch.

Changing the torch's angle changes the dimensions of the gouge.

# OPERATION


## Gouge profile

You can vary the gouge profile by varying the speed of the torch over the workpiece, varying the torch-to-work standoff distance, varying the angle of the torch to the workpiece, and varying the current output of the power supply.

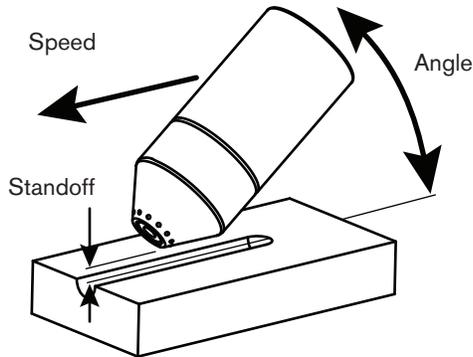


Operating parameters	
<b>Speed</b>	20 – 25 ipm (50.8 – 63.5 cm/min)
<b>Standoff</b>	1/4 – 3/8 in (6.4 – 9.5 mm)
<b>Angle</b>	35 – 40°


### Typical Maximum Control Gouge Profile for 65 A

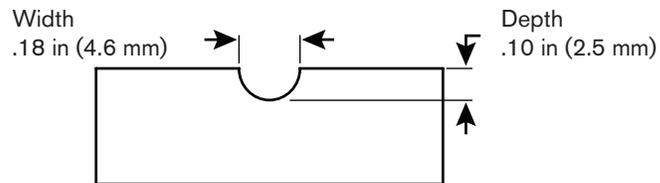


### Typical Maximum Removal Gouge Profile for 65 A

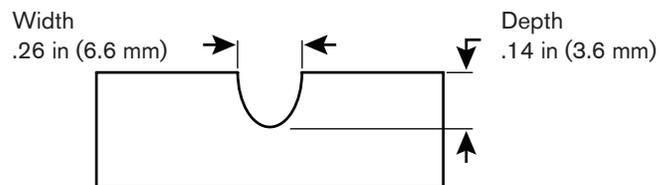

### Typical Maximum Control Gouge Profile for 85 A

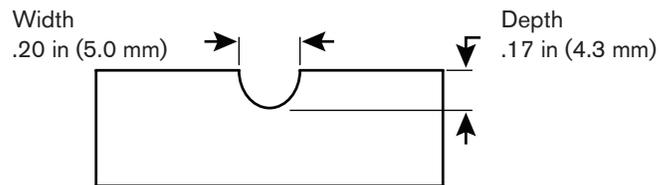

### Typical Maximum Removal Gouge Profile for 85 A

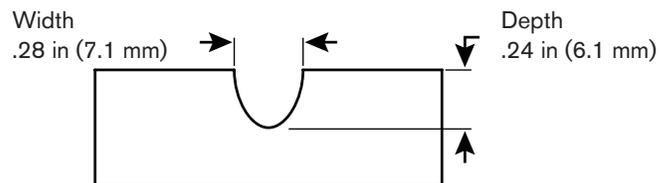

**Varying the gouge profile**

The following actions have the stated effects on the gouge profile:

- **Increasing the speed** of the torch will **decrease width** and **decrease depth**.
- **Decreasing the speed** of the torch will **increase width** and **increase depth**.
- **Increasing the standoff** of the torch will **increase width** and **decrease depth**.
- **Decreasing the standoff** of the torch will **decrease width** and **increase depth**.
- **Increasing the angle** of the torch (more vertical) will **decrease width** and **increase depth**.
- **Decreasing the angle** of the torch (less vertical) will **increase width** and **decrease depth**.
- **Increasing the current** of the power supply will **increase width** and **increase depth**.
- **Decreasing the current** of the power supply will **decrease width** and **decrease depth**.

### Common hand-cutting faults

The torch does not cut completely through the workpiece. The causes can be:

- The cut speed is too fast.
- The consumables are worn.
- The metal being cut is too thick for the selected amperage.
- Gouging consumables are installed instead of drag-cutting consumables.
- The work clamp is not attached properly to the workpiece.
- The gas pressure or gas flow rate is too low.

Cut quality is poor. The causes can be:

- The metal being cut is too thick for the amperage.
- The wrong consumables are being used (gouging consumables are installed instead of drag-cutting consumables, for example).
- You are moving the torch too quickly or too slowly.

The arc sputters and consumables life is shorter than expected. The cause can be:

- Moisture in the gas supply.
- Incorrect gas pressure.
- Consumables incorrectly installed.

## Using the machine torch

Since the Powermax with a machine torch can be used with a wide variety of cutting tables, track burners, pipe bevelers, and so on, you will need to refer to the manufacturer's instructions for specifics on operating the machine torch in your configuration. However, the information in the following sections will help you optimize cut quality and maximize consumable life.

### Ensure the torch and table are set up correctly

- Use a square to align the torch at right angles to the workpiece in two dimensions.
- The torch may travel more smoothly if you clean, check and “tune” the cutting table's rails and drive system. Unsteady machine motion can cause a regular, wavy pattern on the cut surface.
- Ensure that the torch does not touch the workpiece during cutting. Contact with the workpiece can damage the shield and nozzle and affect the cut surface.

### Understand and optimize cut quality


There are several factors to consider in cut quality:

- Cut angle — The degree of angularity of the cut edge.
- Dross — The molten material that solidifies on the top or bottom of the workpiece.
- Straightness of the cut surface — The cut surface can be concave or convex.

The following sections explain how these factors can affect cut quality.

#### Cut or bevel angle

- A positive cut angle, or bevel, results when more material is removed from the top of the cut than from the bottom.
- A negative cut angle results when more material is removed from the bottom of the cut.

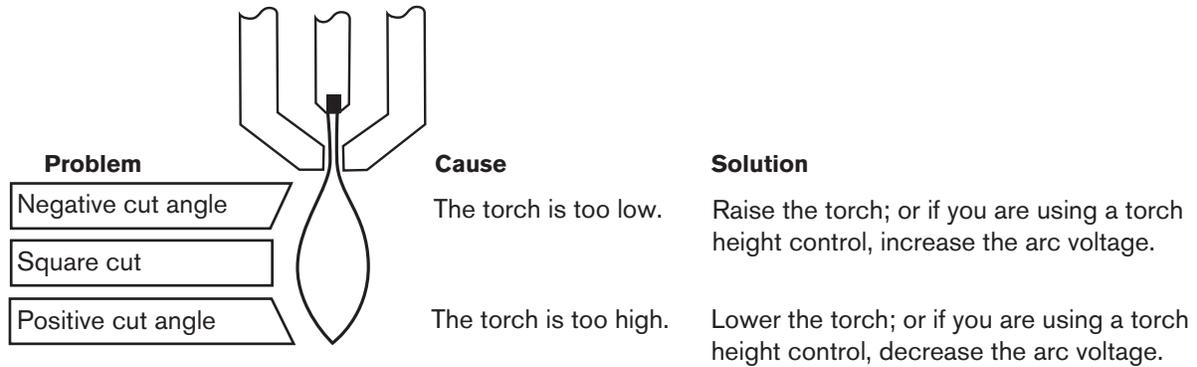

Note: The squarest cut angle will be on the *right* side with respect to the forward motion of the torch. The left side will always have some degree of bevel.

To determine whether a cut-angle problem is being caused by the plasma system or the drive system, make a test cut and measure the angle of each side. Next, rotate the torch 90° in its holder and repeat the process. If the angles are the same in both tests, the problem is in the drive system.

If a cut-angle problem persists after “mechanical causes” have been eliminated (see 4-21 *Ensure the torch and table are set up correctly*), check the torch-to-work distance, especially if the cut angles are all positive or all negative. Also consider the material being cut: if the metal is magnetized or hardened, you are more likely to experience cut angle problems.

### Dross

Some amount of dross will always be present when cutting with air plasma. However, you can minimize the amount and type of dross by adjusting your system correctly for your application.

Excess dross appears on the top edge of both pieces of the plate when the torch is too low (or voltage is too low when using a torch height control). Adjust the torch or adjust the voltage in small increments (5 volts or less) until the dross is reduced.

Low-speed dross forms when the torch’s cutting speed is too slow and the arc angles ahead. It forms as a heavy, bubbly deposit at the bottom of the cut and can be removed easily. Increase the speed to reduce this type of dross.

High-speed dross forms when the cutting speed is too fast and the arc angles behind. It forms as a thin, linear bead of solid metal attached very close to the cut. It is more firmly attached to the bottom of the cut than at low speed and is difficult to remove. To reduce high-speed dross:

- Decrease the cutting speed.
- Decrease the torch-to-work distance.

## **To pierce a workpiece using the machine torch**

As with the hand torch, you can start a cut with the machine torch at the edge of the workpiece or by piercing the workpiece. Piercing will result in a shorter consumable life than with edge starts.

The cut charts include a column for the recommended torch height when starting a pierce. For the Powermax65 and Powermax85, the pierce height is generally 2.5 times the cutting height. Refer to the cut charts for specifics.

The pierce delay must be sufficiently long that the arc can pierce the material before the torch moves, but not so long that the arc “wanders” while trying to find the edge of a large hole. As consumables wear, this delay time may need to be increased. Pierce delay times given in the cut charts are based on average delay times throughout the life of the consumables.

When piercing materials close to the maximum thickness for a specific process, consider the following important factors:

- Allow a lead-in distance approximately equal to the thickness of the material being pierced. For example, 20 mm (3/4 in) material requires a 20 mm lead-in.
- To avoid damage to the shield from the buildup of molten material created by the pierce, do not allow the torch to descend to cut height until it has cleared the puddle of molten material.
- Different material chemistries can have an adverse effect on the pierce capability of the system. In particular, high-strength steel with a high manganese or silicon content can reduce the maximum pierce capability. Hypertherm calculates mild steel parameters with certified A-36 plate.
- Using a “flying pierce” (that is, starting torch motion immediately after transfer and during the pierce process) can extend the piercing capability of the system in some cases. Because this can be a complex process that can damage the torch or other components, a stationary or edge start is recommended.

### Common machine-cutting faults

The torch's pilot arc will initiate, but will not transfer. Causes can be:

- The work cable is not making good contact with the cutting table or the cutting table is not making good contact with the workpiece.
- The torch-to-work distance is too large.

The workpiece is not totally penetrated, and there is excessive sparking on the top of the workpiece. Causes can be:

- The consumables are worn and need to be replaced. For optimized performance in a mechanized application, replace the nozzle and the electrode together.
- The work cable is not making good contact with the cutting table or the cutting table is not making good contact with the workpiece.
- The current (amperage) is set too low. See Section 3, *Torch Setup* for more information.
- The cut speed is too high. See the cut charts in Section 3, *Torch Setup*, for more information.
- The metal being cut exceeds the maximum capacity for the selected amperage. See Section 1, *Specifications*.

Dross forms on the bottom of the cut. Causes can be:

- The consumables are worn and need to be replaced. For optimized performance in a mechanized application, replace the nozzle and the electrode together.
- The cutting speed is not correct. Refer to the cut charts in Section 3, *Torch Setup*, for more information.
- The current (amperage) is set too low. Refer to the cut charts in Section 3, *Torch Setup*, for more information.

The cut angle is not square. Causes can be:

- The consumables are worn and need to be replaced. For optimized performance in a mechanized application, replace the nozzle and the electrode together.
- The direction of the torch travel is incorrect. The high-quality cut is always on the right with respect to the forward motion of the torch.
- The distance between the torch and the workpiece is not correct.
- The cutting speed is not correct. Refer to the cut charts in Section 3, *Torch Setup*, for more information.

The consumables' life is shortened. Causes can be:

- The arc current, arc voltage, travel speed, and other variables are not set as recommended in the cut charts.
- Firing the arc in the air (beginning or ending the cut off of the plate surface). Starting at the edge is acceptable as long as the arc makes contact with the workpiece when started.
- Starting a pierce with an incorrect torch height. Refer to the cut charts for the specific initial pierce height.

## Section 5


### MAINTENANCE AND REPAIR

---


*In this section:*

Perform routine maintenance .....	5-2
Inspect the consumables .....	5-3
Basic troubleshooting.....	5-4
Fault codes and solutions .....	5-6
Replace the air filter element and air filter bowl.....	5-10


## Perform routine maintenance

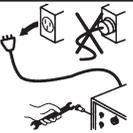		<b>DANGER ELECTRIC SHOCK CAN KILL</b>
	<b>Disconnect the electrical power before you perform any maintenance. All work that requires removal of the power supply cover must be performed by a qualified technician.</b>	

### Every use:

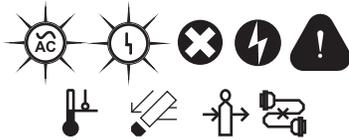

Check indicator lights and fault icons.  
Correct any fault conditions.

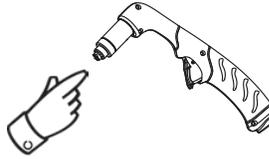


Inspect the consumables for proper installation and wear.

### Every 3 months:



Replace any damaged labels.

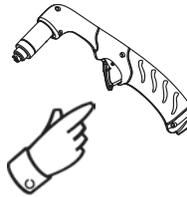

Inspect the trigger for damage.  
Inspect the torch body for cracks and exposed wires. Replace any damaged parts.




Inspect the power cord and plug. Replace if damaged.








Inspect the torch lead. Replace if damaged.

### Every 6 months:

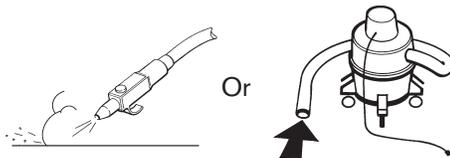

Clean the inside of the power supply with compressed air or a vacuum.

**Inspect the consumables**
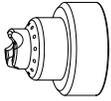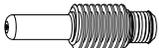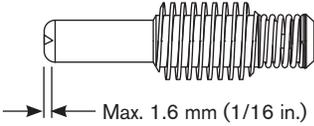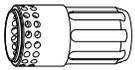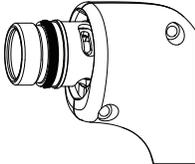
<b>Part</b>		<b>Inspect</b>	<b>Action</b>
	Shield or deflector	The center hole for roundness.  The gap between the shield and the nozzle for accumulated debris.	Replace the shield if the hole is no longer round.  Remove the shield and clean away any material.
	Nozzle	The center hole for roundness.   Good  Worn	Replace nozzle if the center hole is not round.
	Electrode	 Max. 1.6 mm (1/16 in.)	Replace electrode if the surface is worn or the pit depth is greater than 1.6 mm (1/16 inch) deep.
	Swirl ring	The surface inside the swirl ring for damage or wear and the gas holes for blockages.	Replace swirl ring if the surface is damaged or worn or any of the gas holes are blocked.
	Torch O-ring	The surface for damage, wear, or a lack of lubrication.	If the O-ring is dry, lubricate it and the threads with a thin layer of silicone lubricant. If the O-ring is worn or damaged, replace it.

### Basic troubleshooting

The following table provides an overview of the most common problems that can arise when using the Powermax system and explains how to solve them.

Note: Fault icons and corresponding fault codes appear in the LCD display. Refer to page 5-6 *Fault codes and solutions*.

If you are unable to fix the problem by following this basic troubleshooting guide, or if you need further assistance:

1. Call your Hypertherm distributor or authorized Hypertherm repair facility.
2. Call the nearest Hypertherm office listed in the front of this manual.

Problem	Solutions
The ON/OFF power switch is set to ON (I), but the power ON LED is not illuminated.	<ul style="list-style-type: none"><li>▪ Verify that the power cord is plugged into the receptacle.</li><li>▪ Verify that the power is ON at the main power panel or at the line-disconnect switch box.</li><li>▪ Verify that the line voltage is not too low (more than 15% below the rated voltage).</li><li>▪ Verify that the circuit breaker has not been tripped.</li></ul>
The arc does not transfer to the workpiece.	<ul style="list-style-type: none"><li>▪ Clean the area where the work clamp contacts the workpiece to ensure a good metal-to-metal connection.</li><li>▪ Inspect the work clamp for damage and repair as necessary.</li><li>▪ The pierce-height distance may be too large. Move the torch closer to the workpiece and fire the torch again.</li></ul>

<b>Problem</b>	<b>Solutions</b>
The arc blows out, but re-ignites when the torch trigger is pressed again.	<ul style="list-style-type: none"><li>▪ Inspect the consumable parts and replace them if they are worn or damaged. See page 5-3 <i>Inspect the consumables</i>.</li><li>▪ Replace the air filter element if it is contaminated. See page 5-10 <i>Replace the air filter element and air filter bowl</i>.</li><li>▪ Make sure the gas pressure is at the proper level.</li></ul>
The arc sputters and hisses.	<ul style="list-style-type: none"><li>▪ The air filter element is contaminated. Replace the element. See page 5-10 <i>Replace the air filter element and air filter bowl</i>.</li><li>▪ Inspect the gas line for moisture. If necessary, install or repair the gas filtration to the power supply. See the <i>Power Supply Setup</i> section.</li></ul>
The cut quality is poor.	<ul style="list-style-type: none"><li>▪ Verify that the torch is being used correctly. See Section 4, <i>Operation</i>.</li><li>▪ Inspect the consumables for wear and replace as necessary. See 5-3 <i>Inspect the consumables</i>.</li><li>▪ Check the air pressure and air quality.</li><li>▪ Verify that the cutting mode switch is in the proper position for the cutting operation.</li><li>▪ Verify that the correct consumables are installed.</li></ul>

### Fault codes and solutions

A label with descriptions for these common fault codes can be found inside the front cover of this manual. Peel off the label and place it on the rear of the power supply for reference.

Fault code	Description	Power LED	Fault LED	Fault icon	Solutions
0-12	Low input gas pressure or unstable gas pressure: Warning (the system continues to operate)	On	Off		<ul style="list-style-type: none"> <li>Adjust the gas inlet pressure as needed.</li> </ul>
0-13	AC input unstable: Warning (the system continues to operate)	Blinks (3 Hz)	Off		<ul style="list-style-type: none"> <li>Correct the power source.</li> </ul>
0-19	Power board hardware protection. One or more power board hardware faults (or noise) detected.	On	On		<p>The inverter shuts down and does not fire again for several seconds. If the fault is caused by electrical noise, the fault clears in a few seconds and the machine operates normally.</p> <p>If a true fault continues to occur, the 0-99 fault code appears on the operator screen. Service personnel can access the fault log in the service screen to identify the major fault.</p>
0-20	Low gas pressure	On	On		<ul style="list-style-type: none"> <li>Check the input gas supply.</li> <li>Adjust the gas pressure to the acceptable range using Manual mode. See Section 4, <i>Operation</i>.</li> </ul>
0-21	Gas flow lost while cutting	On	On		<ul style="list-style-type: none"> <li>Restore the gas inlet pressure and restart the power supply.</li> <li>Check the torch lead for leaks or kinking.</li> </ul>
0-22	No gas input	On	On		<ul style="list-style-type: none"> <li>Connect the gas source and restart the power supply.</li> </ul>

Fault code	Description	Power LED	Fault LED	Fault icon	Solutions
0-30	<p>Torch consumables stuck</p> <p>This indicates either a “torch stuck open” or a “torch stuck closed” situation.</p>	On	On		<ul style="list-style-type: none"> <li>▪ If the consumables became loose or were removed while the power supply is ON, turn OFF the power supply, correct the problem and then turn ON the power supply to clear this fault.</li> <li>▪ Change consumables.</li> <li>▪ If the consumables appear to be installed correctly, the torch may be damaged. Contact your Hypertherm distributor or authorized repair facility.</li> </ul>
0-40	Over/under temperature	On	On		<ul style="list-style-type: none"> <li>▪ Leave the power supply on to allow the fan to cool the power supply.</li> <li>▪ If the internal temperature of the power supply approaches -30° C (-22° F), move the power supply to a warmer location.</li> </ul>

## MAINTENANCE AND REPAIR


Fault code	Description	Power LED	Fault LED	Fault icon	Solutions
0-50	Retaining cap off	On	On		<ul style="list-style-type: none"> <li>Turn OFF the power supply. Verify that the consumables are installed and restart the power supply.</li> <li>If the consumables appear to be installed correctly, the torch may be damaged. Contact your Hypertherm distributor or authorized repair facility.</li> </ul>
0-51	Start/trigger signal on at power up  This situation indicates that the power supply is receiving a start signal. It is sometimes referred to as a "stuck start."	On	On		<ul style="list-style-type: none"> <li>If the power supply is turned on while the torch trigger is pressed, the system is disabled. Release the trigger and recycle the power switch.</li> </ul>
0-52	Torch not connected	On	On		<ul style="list-style-type: none"> <li>Plug a torch lead into the FastConnect receptacle on the front of the power supply and recycle the power switch.</li> </ul>

<b>Fault code</b>	<b>Description</b>	<b>Power LED</b>	<b>Fault LED</b>	<b>Fault icon</b>	<b>Solutions</b>
0-60	AC input voltage error	On	On		<ul style="list-style-type: none"> <li>▪ Phase loss: Check all input phases and fuses.</li> <li>▪ Over voltage: Check the line, decrease the voltage.</li> <li>▪ Under voltage: Check the line, increase the voltage.</li> </ul>
0-61	AC input unstable: Shutdown	On	On		<ul style="list-style-type: none"> <li>▪ The incoming line current is unstable. Power down and correct the line problem before continuing.</li> </ul>
0-98	Internal communication failure	On	On		<ul style="list-style-type: none"> <li>▪ Power down, wait 20 seconds, power up.</li> <li>▪ A qualified service technician must open the power supply case and check the ribbon cable between the control board and the DSP board.</li> </ul>
0-99	System hardware fault — service required  Indicates a major fault with the system.	On	On		<ul style="list-style-type: none"> <li>▪ A qualified service technician must service the system. Contact your distributor or authorized repair facility.</li> </ul>


### Replace the air filter element and air filter bowl

#### Remove the air filter bowl

1. Turn OFF the power, disconnect the power cord, and make sure the gas supply is disconnected. Position the rear of the power supply so the removable air filter bowl is easily accessible.

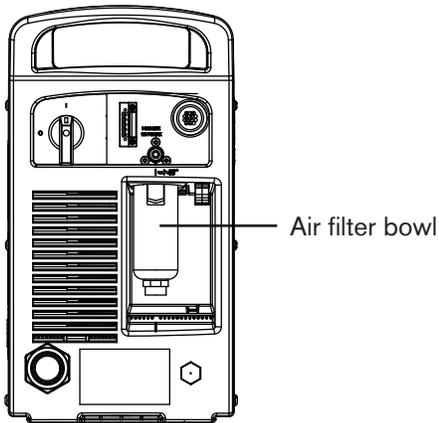

2. If the consumables case is positioned next to the air filter bowl, remove it first.
3. Grasp the filter bowl with your right hand. Push down the thumb latch and rotate the filter bowl approximately 45 degrees to the right.

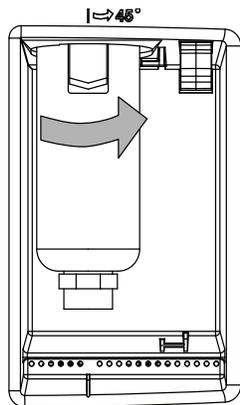

4. Pull the filter bowl straight down to remove.

### Identify air filter bowl model

Due to a manufacturing change, your Powermax65/85 may have one of the two air filter bowl models shown below. The bowl styles and O-rings are not interchangeable between models. Both filter bowls use the same air filter element, but the steps to replace the element will vary for each bowl.

#### Old metal guarded filter bowl



The filter assembly for the metal guarded bowl shown above is no longer available to order. The individual air filter element and filter bowl are still available to order.

To replace the air filter element and guarded metal bowl, skip to page 5-13 *Install the air filter element (for guarded metal bowl)*.

#### New plastic filter bowl



To replace the air filter element and filter bowl on this model, continue to the next section.


Note: The filter bowl may appear greenish-blue if you install optional nylon bowl kit 428415. (See page 6-3).

### Install the air filter element (for plastic or nylon bowl)

5. Twist and pull up on the black element retainer at the top of the filter bowl.



6. Gently twist the black element retainers ❶ until they come apart and you can remove the dirty air filter element ❷ from them.

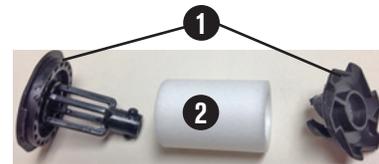

7. Twist the element retainers until they lock together and fit snugly against the new element.



Note: If the black element retainers are damaged, order a new air filter assembly in kit 428351.

8. If you are not replacing the air filter bowl:

- Install the thicker O-ring in kit 228695 onto the existing filter bowl.



Use thicker O-ring

- Clean the bowl by wiping away any oil, dirt, or other contaminants.



9. Place the air filter element in the filter bowl. Twist the filter element's top plastic part until it fastens securely to the top of the filter bowl.

Note: To install the air filter bowl, skip to step 10 on page 5-14.



**Install the air filter element (for guarded metal bowl)**

5. You can see the white filter element and black retaining nut on the filter assembly. Unscrew (counterclockwise) the plastic retaining nut that secures the filter element.
6. Replace the dirty element with the new white element.
7. Reinstall (clockwise) the original plastic retaining nut to finger-tight only.
8. Wipe away any oil, dirt, or other contaminants inside of the filter bowl to make sure it is clean.
9. Examine the O-ring at the top of the filter bowl.




- If the O-ring is damaged, replace it with the thinner of the two O-rings in kit 228695.



- If the O-ring is not damaged, make sure it is lightly lubricated with silicone lubricant (027055 not included).

### Install the air filter bowl (metal guarded, plastic, or nylon)

10. Vertically align the filter bowl and firmly push the filter bowl up to the top of the receptacle to seat the bowl.
11. Once the bowl is seated properly, rotate the bowl 45 degrees to the left until you hear the thumb latch click into place.

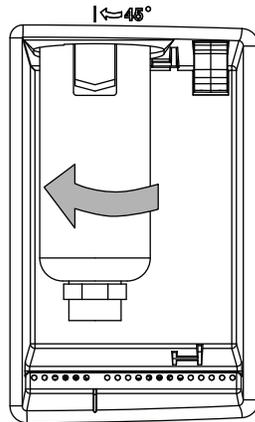

12. Reconnect the gas supply hose to the power supply and check for leaks.
13. Reconnect the electrical power and turn ON the power switch.

## Section 6

### PARTS


---

*In this section:*


Power supply parts.....	6-2
Duramax 75° hand torch replacement parts.....	6-6
Duramax 15° hand torch replacement parts.....	6-7
Hand torch consumables.....	6-8
Duramax 180° full-length machine torch replacement parts .....	6-9
Duramax 180° mini machine torch replacement parts .....	6-11
Machine torch consumables .....	6-13
Accessory parts.....	6-14
Powermax65/85 labels.....	6-15

Note: If your Powermax65/85 has a CCC power cord, order CE-certified replacement parts for every part except the power cord.

**Power supply parts**

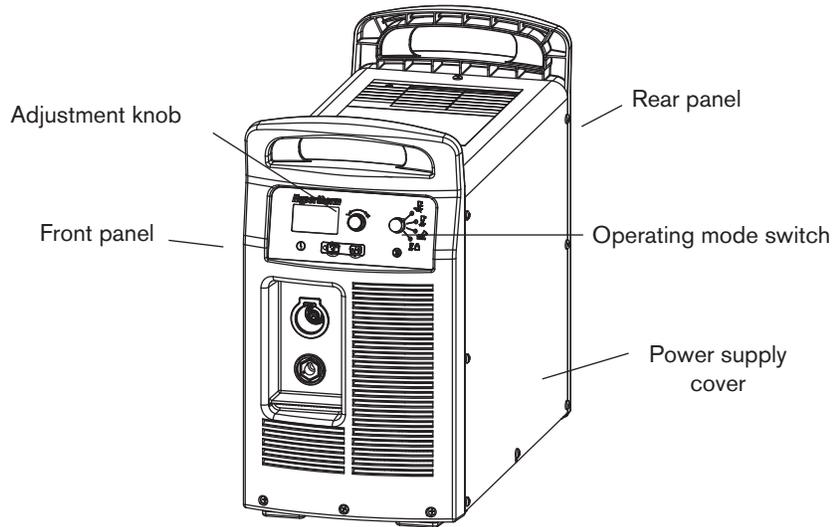

<b>Part number</b>	<b>Description</b>
228643	Kit: Powermax65/85 front panel
228645	Kit: Powermax65 CSA rear panel
228646	Kit: Powermax65 CE rear panel
228647	Kit: Powermax85 CSA rear panel
228653	Kit: Powermax85 CE rear panel
228642	Kit: Powermax65/85 cover screws
228666	Kit: Powermax65 CSA power supply cover
228674	Kit: Powermax65 CE power supply cover
228676	Kit: Powermax85 CSA power supply cover
228675	Kit: Powermax85 CE power supply cover
108797	Adjustment knob
108732	Operating mode switch

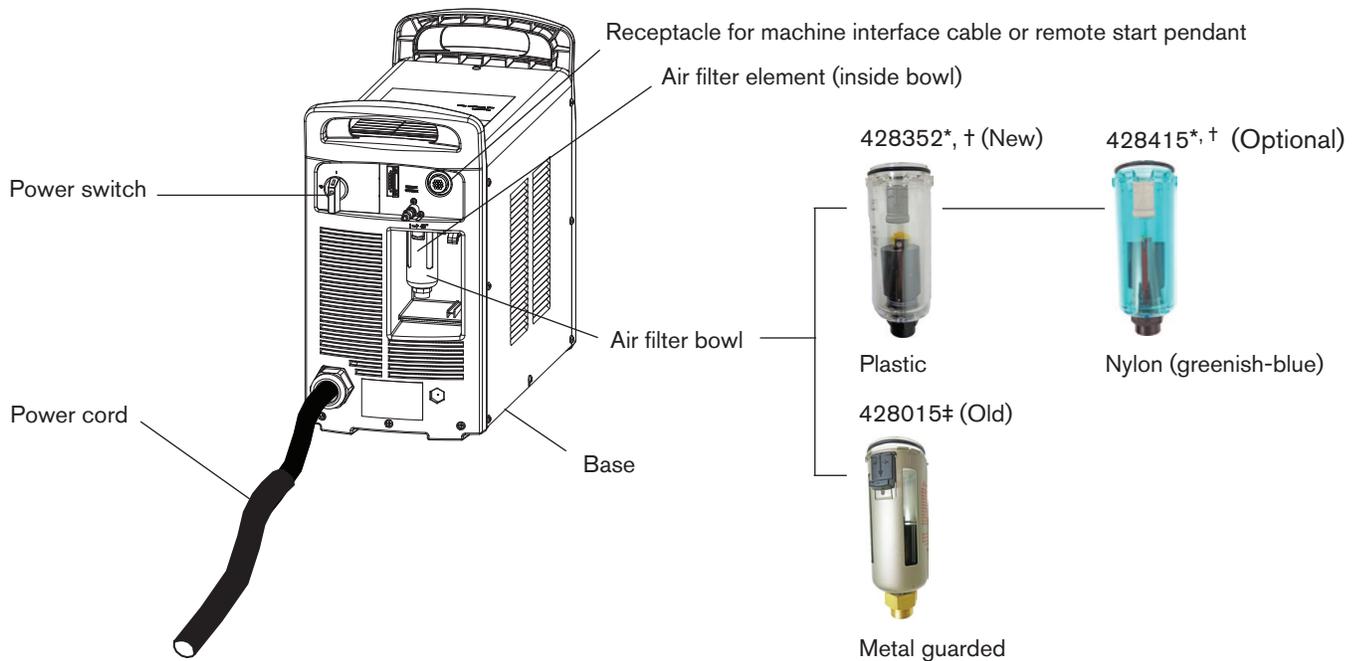

Part number	Description
428352*, †	Kit: Powermax65/85/105/125 plastic air filter bowl (includes O-ring)
428415*, †	Kit: Powermax65/85/105/125 nylon air filter bowl (includes O-ring)
428015 ‡	Kit: Powermax65/85/105/125 metal guarded air filter bowl (includes O-ring)
228695	Kit: Powermax65/85/105/125 air filter element (inside filter bowl) and O-ring (compatible with all bowl types)
228691	Kit: Powermax65/85 CSA power cord
228679	Kit: Powermax65 CE/CCC power cord
228678	Kit: Powermax85 CE/CCC power cord
228680	Kit: Powermax65/85 power cord strain relief
128650	Remote start pendant for machine torch, 7.6 m (25 ft)
128651	Remote start pendant for machine torch, 15 m (50 ft)
128652	Remote start pendant for machine torch, 23 m (75 ft)
428755	Remote start pendant for machine torch, 45 m (150 ft)

\* Filter bowl kit 428352 and 428415 only fit on air filter assembly kit 428351 (see page 6-5).


† The plastic air filter bowl (kit 428352) that comes with the Powermax65/85 is compatible with most air systems, but the airline should be maintained clean. Organic solvents, chemicals, cutting oil, synthetic oil, alkali, and thread lock solutions may cause harmful effects to the plastic air filter bowl. An optional nylon bowl (kit 428415) is available for sites that have difficulty preventing harsh chemicals from entering the air system.

‡ The filter bowl kits are not interchangeable. Filter bowl kit 428015 only fits on old air filter assembly kit 228685 (see page 6-5). Order kit 428015 if your existing filter bowl is guarded in metal, as shown above.

## PARTS

---

<b>Part number</b>	<b>Description</b>
023206	Machine interface cable (start, stop, arc transfer signals), 7.6 m (25 ft), spade connectors
023279	Machine interface cable (start, stop, arc transfer signals), 15 m (50 ft), spade connectors
228350	Machine interface cable (start, stop, arc transfer signals) for divided arc voltage, 7.6 m (25 ft), spade connectors
228351	Machine interface cable (start, stop, arc transfer signals) for divided arc voltage, 15 m (50 ft), spade connectors
223048	Machine interface cable (start, stop, arc transfer signals) for divided arc voltage, 7.6 m (25 ft), D-sub connector with screws
123896	Machine interface cable (start, stop, arc transfer signals) for divided arc voltage, 15 m (50 ft), D-sub connector with screws
223733	External machine interface cable for PlasmaCAM <sup>®</sup> tables, 4.6 m (15 ft)
223734	External machine interface cable for PlasmaCAM tables, 6.1 m (20 ft)
127204	Powermax45/65/85 Machine interface receptacle cover
228539	Kit: RS485 board with cables (65/85)
228697	Kit: Powermax65/85 Machine Interface Cable (internal cable w/v-div board)

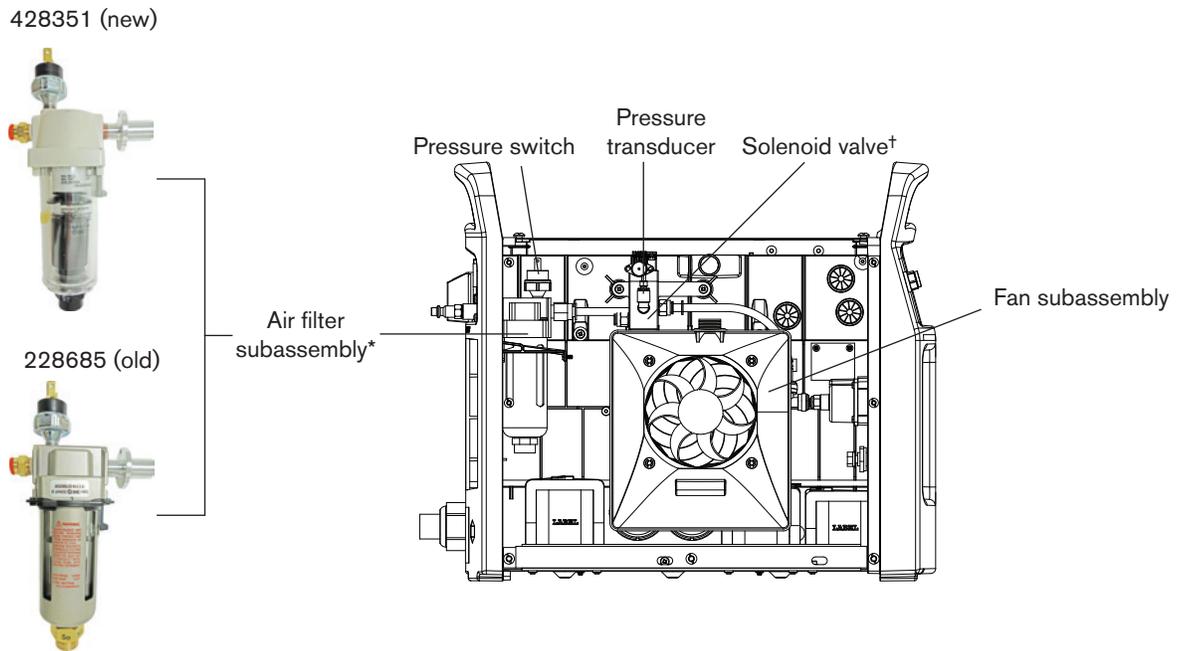


<b>Part number</b>	<b>Description</b>
228686	Kit: Powermax65/85 fan subassembly
428351	Kit: Powermax65/85/105/125 air filter subassembly (includes filter bowl, air filter element, and O-ring)
228688	Kit: Powermax65/85 pressure switch
228687†	Kit: Powermax65/85 solenoid valve (includes tubing and screws)
228689	Kit: Powermax65/85 pressure transducer

\* Due to a manufacturing change, the new air filter assembly in kit 428351 (shown above) replaces the old air filter assembly in kit 228685. Although kit 228685 is no longer available to order, you can still order its individual filter bowl and filter element (see page 6-3).

† Due to a manufacturing change, some solenoid valve models have an additional fitting (not shown above) on the gas tubing.


**Duramax 75° hand torch replacement parts**

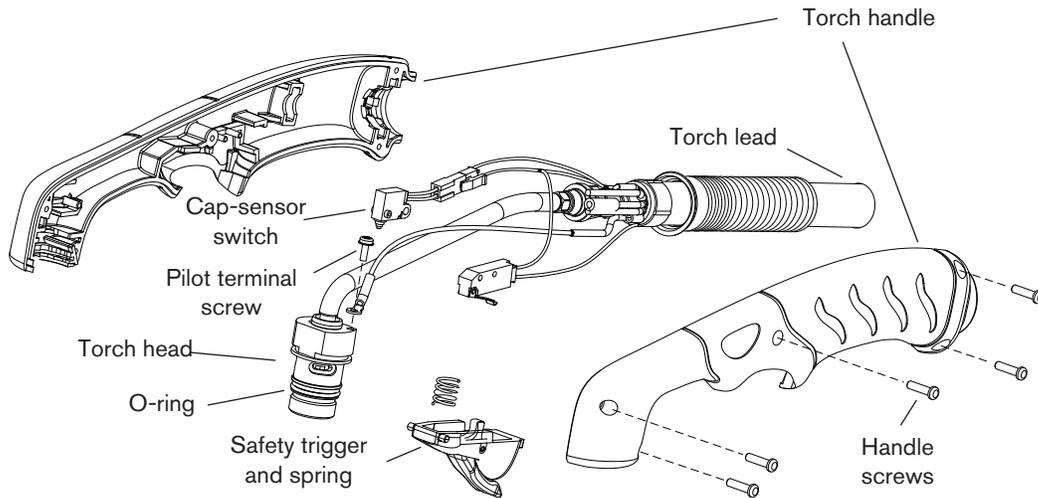

The entire hand torch and lead assembly can be replaced, or individual component parts can be replaced. Part numbers starting with 059 indicate complete torch and lead assemblies.

<b>Part number</b>	<b>Description</b>
059473	Powermax65/85/105 75° hand torch assembly with 7.6 m (25 ft) lead
059474	Powermax65/85/105 75° hand torch assembly with 15 m (50 ft) lead
059475	Powermax65/85/105 75° hand torch assembly with 23 m (75 ft) lead
228954	Kit: Duramax 75°/HRT torch handle replacement
075714	Handle screws, #4 x 1/2 slotted TORX pan head, S/B
228721	Kit: Duramax 75°/15° hand torch safety trigger with spring replacement
228714	Kit: Duramax 75° hand torch main body replacement (torches built before May 2012)
228958	Kit: Duramax 75° hand torch main body replacement (torches built after May 2012)
058519	O-ring: VITON .673 X .063
075504	Pilot terminal screw: MSCR:4-40 X 5/16 SW CN SEM PH PAN S/Z
228719	Kit: Duramax 75° hand torch cap-sensor switch replacement
228959	Kit: Duramax hand torch lead replacement, 7.6 m (25 ft)
228960	Kit: Duramax hand torch lead replacement, 15 m (50 ft)
228961	Kit: Duramax hand torch lead replacement, 23 m (75 ft)
128642	Kit: Trigger start switch replacement

## Duramax 15° hand torch replacement parts

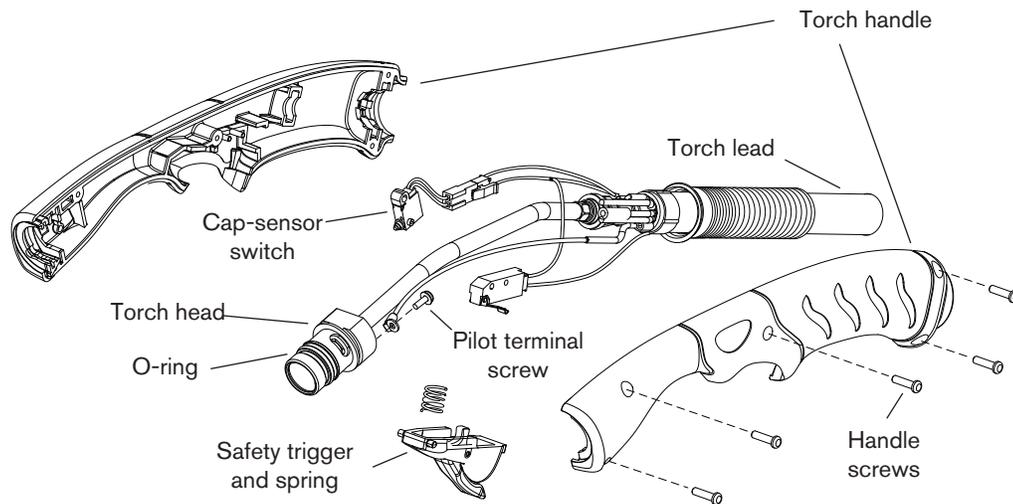


The entire hand torch and lead assembly can be replaced, or individual component parts can be replaced. Part numbers starting with 059 indicate complete torch and lead assemblies.

Part number	Description
059470	Powermax65/85/105 15° hand torch assembly with 7.6 m (25 ft) lead
059471	Powermax65/85/105 15° hand torch assembly with 15 m (50 ft) lead
059472	Powermax65/85/105 15° hand torch assembly with 23 m (75 ft) lead
228955	Kit: Duramax 15°/HRTs torch handle replacement
075714	Handle screws, #4 x 1/2 slotted TORX pan head, S/B
228721	Kit: Duramax 75°/15° hand torch safety trigger with spring replacement
228715	Kit: Duramax 15° hand torch main body replacement (torches built before May 2012)
228957	Kit: Duramax 15° hand torch main body replacement (torches built after May 2012)
058519	O-ring: VITON .673 X .063
075504	Pilot terminal screw: MSCR:4-40 X 5/16 SW CN SEM PH PAN S/Z
228109	Kit: Powermax30/45/65/85/105 15° hand torch/T30v/T45v/HRTs cap-sensor switch replacement
228959	Kit: Duramax hand torch lead replacement, 7.6 m (25 ft)
228960	Kit: Duramax hand torch lead replacement, 15 m (50 ft)
228961	Kit: Duramax hand torch lead replacement, 23 m (75 ft)
128642	Kit: Trigger start switch replacement

**Hand torch consumables**

<b>Part number</b>	<b>Description</b>
<b>Drag cutting</b>	
220818	Shield: 45/65/85 A
220854	Retaining cap 45/65/85/105 A
220941	45 A Nozzle
220819	65 A Nozzle
220816	85 A Nozzle
220842	Electrode 45/65/85/105 A
220857	Swirl ring 65/85 A
<b>Gouging</b>	
220798	Maximum Removal gouging shield 45/65/85/105 A
420480	Maximum Control gouging shield 45/65/85/105 A
220854	Retaining cap 45/65/85/105 A
220797	Gouging nozzle 65/85 A
220842	Electrode 45/65/85/105 A
220857	Swirl ring 65/85 A
<b>FineCut</b>	
220931	FineCut Deflector
220854	Retaining cap 45/65/85/105 A
220930	FineCut Nozzle
220842	Electrode 45/65/85/105 A
220947	FineCut Swirl ring
<b>CopperPlus</b>	
220777	CopperPlus electrode
<b>HyAccess</b>	
428414	Kit: Duramax HyAccess 65 A starter kit (includes 2 HyAccess electrodes and 1 of every other consumable listed below)
420413	Duramax HyAccess retaining cap
420410	Duramax HyAccess standard nozzle 65 A
420412	Duramax HyAccess gouging nozzle 65 A
420408	Duramax HyAccess electrode 65 A
220857	Swirl ring 65 A (standard Powermax65 swirl ring)

## Duramax 180° full-length machine torch replacement parts

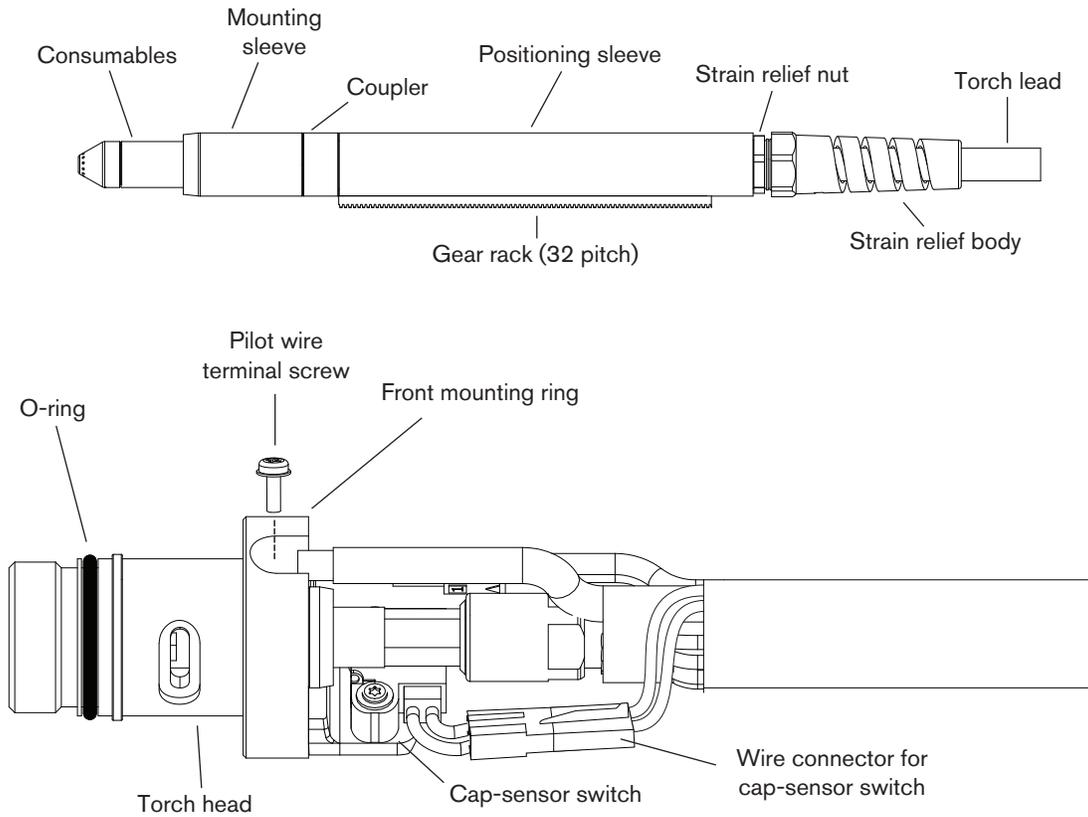

## PARTS


---

The entire machine torch and lead assembly can be replaced, or individual component parts can be replaced. Part numbers starting with 059 indicate complete torch and lead assemblies.

<b>Part number</b>	<b>Description</b>
059476	Powermax65/85/105 180° full-length machine torch assembly with 4.6 m (15 ft) lead
059477	Powermax65/85/105 180° full-length machine torch assembly with 7.6 m (25 ft) lead
059478	Powermax65/85/105 180° full-length machine torch assembly with 10.7 m (35 ft) lead
059479	Powermax65/85/105 180° full-length machine torch assembly with 15 m (50 ft) lead
059480	Powermax65/85/105 180° full-length machine torch assembly with 23 m (75 ft) lead
228737	Kit: Powermax65/85/105 180° full-length machine torch/MRT positioning sleeve
228738	Kit: Powermax65/85/105 180° full-length machine torch/MRT removable gear rack replacement
228735	Kit: Powermax65/85/105 180° full-length/mini machine torch/MRT front mounting sleeve
228736	Kit: Powermax65/85/105 180° full-length/mini machine torch/MRT adapter ring (coupler)
228716	Kit: Powermax65/85/105 180° full-length/mini machine torch main body replacement
228720	Kit: Duramax/MRT 180° machine and robotic torch cap-sensor switch replacement
058519	O-ring: VITON .673 X .063
075504	Pilot terminal screw: MSCR:4-40 X 5/16 SW CN SEM PH PAN S/Z
228730	Kit: Powermax65/85/105 180° full-length/mini machine torch lead replacement, 4.6 m (15 ft)
228731	Kit: Powermax65/85/105 180° full-length/mini machine torch lead replacement, 7.6 m (25 ft)
228732	Kit: Powermax65/85/105 180° full-length/mini machine torch lead replacement, 10.7 m (35 ft)
228733	Kit: Powermax65/85/105 180° full-length/mini machine torch lead replacement, 15 m (50 ft)
228734	Kit: Powermax65/85/105 180° full-length/mini machine torch lead replacement, 23 m (75 ft)
228314	Kit: Powermax45/65/85/105 torch quick disconnect repair (latch & spring)

## Duramax 180° mini machine torch replacement parts

Note: This illustration shows the Duramax 180° machine torch. The Duramax 180° mini machine torches do not have a positioning sleeve and gear rack.

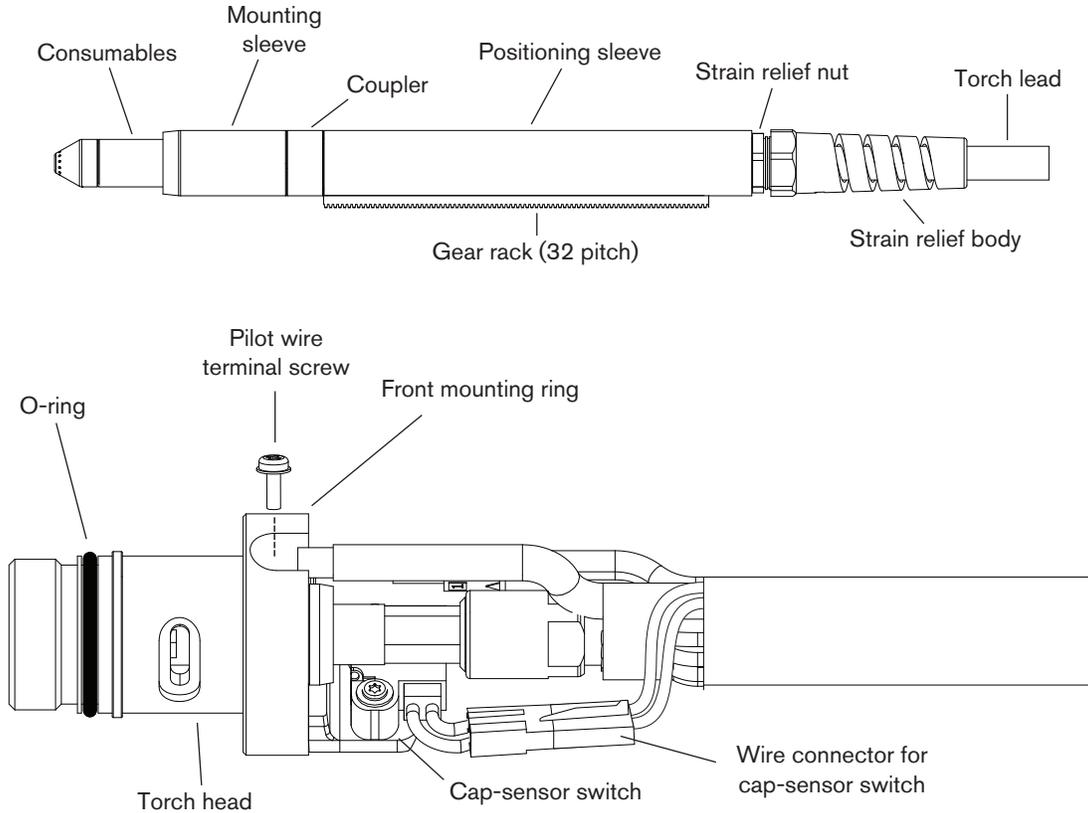

## PARTS

---

The entire machine torch and lead assembly can be replaced, or individual component parts can be replaced. Part numbers starting with 059 indicate complete torch and lead assemblies.

<b>Part number</b>	<b>Description</b>
059481	Powermax65/85/105 180° mini machine torch assembly with 4.6 m (15 ft) lead
059482	Powermax65/85/105 180° mini machine torch assembly with 7.6 m (25 ft) lead
059483	Powermax65/85/105 180° mini machine torch assembly with 10.7 m (35 ft) lead
059484	Powermax65/85/105 180° mini machine torch assembly with 15 m (50 ft) lead
228735	Kit: Powermax65/85/105 180° full-length/mini machine torch/MRT front mounting sleeve
228736	Kit: Powermax65/85/105 180° full-length/mini machine torch/MRT adapter ring (coupler)
228716	Kit: Powermax65/85/105 180° full-length/mini machine torch main body replacement
228720	Kit: Duramax/MRT 180° machine and robotic torch cap-sensor switch replacement
058519	O-ring: VITON .673 X .063
075504	Pilot terminal screw: MSCR:4-40 X 5/16 SW CN SEM PH PAN S/Z
228730	Kit: Powermax65/85/105 180° full-length/mini machine torch lead replacement, 4.6 m (15 ft)
228731	Kit: Powermax65/85/105 180° full-length/mini machine torch lead replacement, 7.6 m (25 ft)
228732	Kit: Powermax65/85/105 180° full-length/mini machine torch lead replacement, 10.7 m (35 ft)
228733	Kit: Powermax65/85/105 180° full-length/mini machine torch lead replacement, 15 m (50 ft)
228734	Kit: Powermax65/85/105 180° full-length/mini machine torch lead replacement, 23 m (75 ft)
228314	Kit: Powermax45/65/85/105 torch quick disconnect repair (latch & spring)

## Machine torch consumables

Part number	Description
<b>Shielded</b>	
220817	Shield 45/65/85 A
220854	Retaining cap 45/65/85/105 A
220953	Ohmic retaining cap 45/65/85/105 A
220941	45 A Nozzle
220819	65 A Nozzle
220816	85 A Nozzle
220842	Electrode 45/65/85/105 A
220857	Swirl ring 65/85 A
<b>Unshielded</b>	
220955	Deflector 65/85/105 A
220854	Retaining cap 45/65/85/105 A
220941	45 A Nozzle
220819	65 A Nozzle
220816	85 A Nozzle
220842	Electrode 45/65/85/105 A
220857	Swirl ring 65/85 A
<b>Gouging</b>	
220798	Maximum Removal gouging shield 45/65/85/105 A
420480	Maximum Control gouging shield 45/65/85/105 A
220854	Retaining cap 45/65/85/105 A
220797	Gouging nozzle 65/85 A
220842	Electrode 45/65/85/105 A
220857	Swirl ring 65/85 A
<b>FineCut*</b>	
220955	Deflector 65/85/105 A
220948	FineCut shield
220854	Retaining cap 45/65/85/105 A
220953	Ohmic retaining cap 45/65/85/105 A
220930	FineCut Nozzle
220842	Electrode 45/65/85/105 A
220947	FineCut swirl ring

\* The deflector (220955) is used only with the standard retaining cap (220854). The shield (220948) is used only with the ohmic retaining cap (220953).


**Accessory parts**

<b>Part number</b>	<b>Description</b>
024877	Leather torch sheathing, black leather with logos, 7.6 m (25 ft)
127102	Basic plasma (circles and lines) cutting guide
027668	Deluxe plasma (circles and lines) cutting guide
017059	Bevel cutting guide
127301	Powermax65/85 dust cover
128647	Kit: Elimimizer air filter (for moisture removal)
011092	Replacement filter element for Elimimizer air filter
228570	Kit: Elimimizer air filter with cover
228624	Kit: Elimimizer filter cover
428719	Kit: Oil removal coalescing filter
428720	Kit: Replacement filter element for oil removal coalescing filter
428718	Kit: Mounting bracket for Elimimizer air filter or oil removal coalescing filter
223125	Kit: 65 A Work lead with hand clamp, 7.6 m (25 ft)
223126	Kit: 65 A Work lead with hand clamp, 15 m (50 ft)
223127	Kit: 65 A Work lead with hand clamp, 23 m (75 ft)
223194	Kit: 65 A Work lead with C-style clamp, 7.6 m (25 ft)
223195	Kit: 65 A Work lead with C-style clamp, 15 m (50 ft)
223196	Kit: 65 A Work lead with C-style clamp, 23 m (75 ft)
223200	Kit: 65 A Work lead with ring terminal, 7.6 m (25 ft)
223201	Kit: 65 A Work lead with ring terminal, 15 m (50 ft)
223202	Kit: 65 A Work lead with ring terminal, 23 m (75 ft)
223035	Kit: 85 A Work lead with hand clamp, 7.6 m (25 ft)
223034	Kit: 85 A Work lead with hand clamp, 15 m (50 ft)
223033	Kit: 85 A Work lead with hand clamp, 23 m (75 ft)
223203	Kit: 85 A Work lead with C-style clamp, 7.6 m (25 ft)
223204	Kit: 85 A Work lead with C-style clamp, 15 m (50 ft)
223205	Kit: 85 A Work lead with C-style clamp, 23 m (75 ft)
223209	Kit: 85 A Work lead with ring terminal, 7.6 m (25 ft)
223210	Kit: 85 A Work lead with ring terminal, 15 m (50 ft)
223211	Kit: 85 A Work lead with ring terminal, 23 m (75 ft)
229370	Kit: Powermax65/85 Wheel kit assembly

# Powermax65/85 labels

Part number	Description
228649	Kit: Powermax65 labels, CSA
228650	Kit: Powermax65 labels, CE
228651	Kit: Powermax85 labels, CE
228652	Kit: Powermax85 labels, CSA

The label kits include the consumable label, appropriate safety labels, as well as front and side decals. The consumable and safety labels are pictured on the next page.

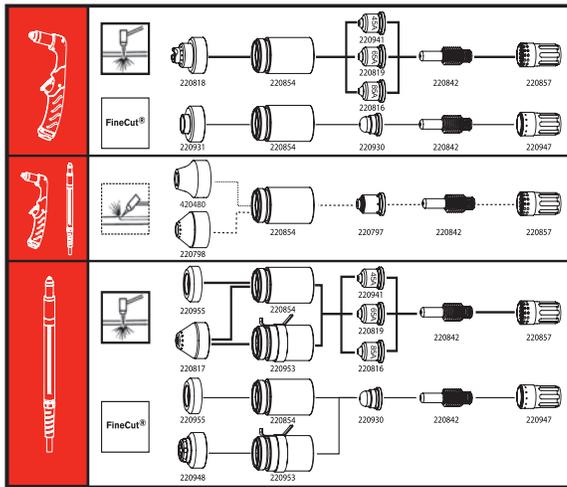

Consumable label



CE safety label

<b>WARNING</b>		<b>AVERTISSEMENT</b>	
<p>Read and follow these instructions, employer safety practices, and material safety data sheets. Refer to ANS Z49.1, "Safety in Welding, Cutting and Allied Processes" from American Welding Society (<a href="http://www.aws.org">http://www.aws.org</a>) and OSHA Safety and Health Standards, 29 CFR 1910 (<a href="http://www.osha.gov">http://www.osha.gov</a>).</p>		<p>Plasma cutting can be injurious to operator and persons in the work area. Consult manual before operating. Failure to follow all these safety instructions can result in death.</p>	
<p><b>1. Cutting sparks can cause explosion or fire.</b>                      1.1 Do not cut near flammables.                      1.2 Have a fire extinguisher nearby and ready to use.                      1.3 Do not use a drum or other closed container as a cutting table.</p>		<p><b>1. Les étincelles de coupage peuvent provoquer une explosion ou un incendie.</b>                      1.1 Ne pas couper près des matières inflammables.                      1.2 Un extincteur doit être à proximité et prêt à être utilisé.                      1.3 Ne pas utiliser un fût ou un autre contenant fermé comme table de coupage.</p>	
<p><b>2. Plasma arc can injure and burn; point the nozzle away from yourself. Arc starts instantly when triggered.</b>                      2.1 Turn off power before disassembling torch.                      2.2 Do not grip the workpiece near the cutting path.                      2.3 Wear complete body protection.</p>		<p><b>2. L'arc plasma peut blesser et brûler; éloigner la buse de soi. Il s'allume instantanément quand on l'active.</b>                      2.1 Couper l'alimentation avant de démonter la torche.                      2.2 Ne pas saisir la pièce à couper de la trajectoire de coupage.                      2.3 Se protéger entièrement le corps.</p>	
<p><b>3. Hazardous voltage. Risk of electric shock or burn.</b>                      3.1 Wear insulating gloves. Replace gloves when wet or damaged.                      3.2 Protect from shock by insulating yourself from work and ground.                      3.3 Disconnect power before servicing. Do not touch live parts.</p>		<p><b>3. Tension dangereuse. Risque de choc électrique ou de brûlure.</b>                      3.1 Porter des gants isolants. Remplacer les gants quand ils sont humides ou endommagés.                      3.2 Se protéger contre les chocs en s'isolant de la pièce et de la terre.                      3.3 Couper l'alimentation avant l'entretien. Ne pas toucher les pièces sous tension.</p>	
<p><b>4. Plasma fumes can be hazardous.</b>                      4.1 Do not inhale fumes.                      4.2 Use forced ventilation or local exhaust to remove the fumes.                      4.3 Do not operate in closed spaces. Remove fumes with ventilation.</p>		<p><b>4. Les fumées plasma peuvent être dangereuses.</b>                      4.1 Ne pas inhaler les fumées.                      4.2 Utiliser une ventilation forcée ou un extracteur local pour éliminer les fumées.                      4.3 Ne pas couper dans des espaces clos. Chasser les fumées par ventilation.</p>	
<p><b>5. Arc rays can burn eyes and injure skin.</b>                      5.1 Wear correct and appropriate protective equipment to protect head, eyes, ears, hands, and body. Button shirt collar. Protect ears from noise. Use welding helmet with the correct shade of filter.</p>		<p><b>5. Les rayons d'arc peuvent brûler les yeux et blesser la peau.</b>                      5.1 Porter un bon équipement de protection pour se protéger la tête, les yeux, les oreilles, les mains et le corps. Boutonner le col de la chemise. Protéger les oreilles contre le bruit. Utiliser un masque de soudeur avec un filtre de nuance appropriée.</p>	
<p><b>6. Become trained.</b> Only qualified personnel should operate this equipment. Use torches specified in the manual. Keep non-qualified personnel and children away.  <b>7. Do not remove, destroy, or cover this label.</b> Replace if it is missing, damaged, or worn.                      (PN 110873 Rev D)</p>		<p><b>6. Suivre une formation.</b> Seul le personnel qualifié a le droit de faire fonctionner cet équipement. Utiliser exclusivement les torches indiquées dans le manuel. Le personnel non qualifié et les enfants doivent se tenir à l'écart.  <b>7. Ne pas enlever, détruire ni couvrir cette étiquette.</b> La remplacer si elle est absente, endommagée ou usée.                      (PN 110873 Rev D)</p>	

CSA safety label

