

Miggytrac 1001 The perfect complement to your MIG power source

The Miggytrac 1001 is a superb alternative if you wish to automate your GMAW process.

The Miggytrac is ideal for use with ESAB's semi-automatic power sources and feed units.

The Miggytrac 1001 is a small, compact, motor powered tractor to which a standard ESAB welding torch can be attached quickly. The four driving wheels, together with the permanent magnet which is fitted on the tractor, guarantee an even, stable movement. The magnet holds the tractor in the correct position on the work-piece, even if it is bent or angled and follows the joint using guide wheels, which can be adjusted to allow the unit to drive itself against the workpiece.

The tractor functions as a straightforward remote control for the feed unit; you decide on the travel direction, then start and stop welding from the panel. The panel features additional functions such as travel speed settings (150-1200 mm/min), wire feed speed, voltage, voltage and welding on/off.

Cored-wire welding - a process in keeping with the times

It is easy to mechanize a semi-automatic welding machine using the Miggytrac 1001. The welding speed can be increased significantly, especially when cored wire is used.



Simply connect the tractor to a suitable semiautomatic power source with a feed unit.

Alternatively, an external source can be connected. The automatic welder performs the long and monotonous weld runs.

The torch holder

The torch holder is equipped with two manual slides for fine corrections of the torch position. The torch holder has also a rotating slide which gives maximum opportunities to get the best possible torch angle.

Technical data

Control voltage 36 - 46 V AC Power 20 W

Welding speed 150 -1200 mm/min
Remote control outlet Volt and ampere
(wire feed speed)

Connection Burndy, 12 pins
Dimensions (LxWxH) 266x257x267 mm

Weight 7 kg


Ordering information


Miggytrac 1001 0457 357 881 Welding screen 0457 463 880

| CABLE KEY DIAGRAM | | | | | | | | | | | | | |
|-------------------------|-------|---------------|--------------------|---------------------|--------------|----------------|--------------------|--------------------|---------|---------|-------|--------|----------------|
| Feeder unit | Brand | 0457 360 880 | 0457 360 881 | 0457 360 883 | 0457 462 880 | 0443 341 880 | 0459 681 880 | 0457 467 880 | Voltage | Current | Power | On/Off | |
| ESABFeed 30-4; M12 | | Х | | | | | | | - | Х | Х | Х | |
| ESABFeed 48-4; M12 | | Х | | | | | | | - | Х | Х | Х | |
| ESABFeed 30-4; M13, M14 | | Х | | | | | | | Х | Х | Х | Х | _ |
| ESABFeed 48-4; M13, M14 | ESAB | Х | | | | | | | Х | Х | Х | Х | ò |
| AristoFeed 30-4, 48-4 | | Х | | | | | Х | | Х | Х | Х | Х | 19 |
| MEK 4 | | Х | | | Х | | | | Х | Х | Х | Х | ပ္ |
| MEH 44 | ESAB | | | Х | | Х | | | Х | Х | Х | Х | Miggytrac 1001 |
| Universal | ? | | Χ | | | | | Χ | ? | ? | Χ | Χ | Aig |
| | | | | pins | | | | | | | | | _ |
| | | Cable 23 pins | Sable without plug | Cable 4 pins + 12 p | Cable kit | Connection kit | Remote adapter kit | Fransformer | | | | | |

Remote control of voltage and current only when connected to a suitable power source/wire feed unit.

The cable must be ordered as the cable key diagram shows.

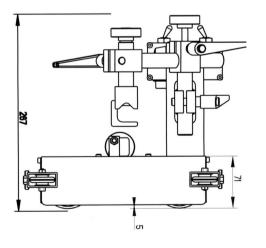

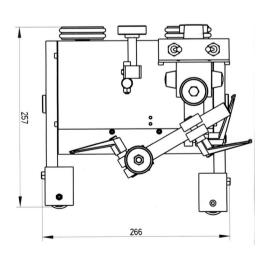

ESAB reserves the right to alter specifications without prior notice ESAB is approved according to ISO 9001:2000



ESAB AB Welding Equipment SE-695 81 LAXÅ SWEDEN Phone: +46 584 81000

SE-695 81 LAXA SWEDE Phone: +46 584 81000 Fax: +46 584 411721 E-mail: info@esab.se